

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/12/2024		M57 Pretoria Road - 1619
Inspection Date	23/12/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	KDL218NW
Model	FOCUS 1.5 ECOBOOST TREND 5-DR POWERSHIFT [2015-2018]	Register Number	
VIN	WF05XXGCC5GB31206	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2024
Color	SILVER	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT METALLIC
Km Reading	222,027 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Management Lights Set	Repair
Windscreen Wiper Worn	Replace
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Damaged	Replace
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF05XXGCC5GB31206

Damage	Repair Way
Gearbox Oil Sweat	Repair
Radiator Cradle Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.02	3.37	-	
Rear	1.88	0.11	-	
Emergency / Parking	1.64	1.49	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/50R17	91V	Hankook	Radial	V	1813	0 mm
Front Right	225/50R17	98W	Nexen	Radial	V	4120	0 mm
Rear Left	225/55R17	101Y	Continental	Contipremium	V	0416	0 mm
Rear Right	235/45R17	97W	Cachland	Radial	V	4821	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR PON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Battery loose.
Body • Exterior: Minor dents and scratches and stone chips. Signs of repair work done to somebody panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



FRONT RIGHT CORNER



REAR LEFT CORNER

VIN: W05XXGCC5GB31206

2 / 12



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

VIN: WF05XXGCC5GB31206

3 / 12



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

VIN: WF05XXGCC5GB31206

4 / 12




LR TYRE TREAD



RR TYRE TREAD

VIN: WF05XXGCC5GB31206

5 / 12

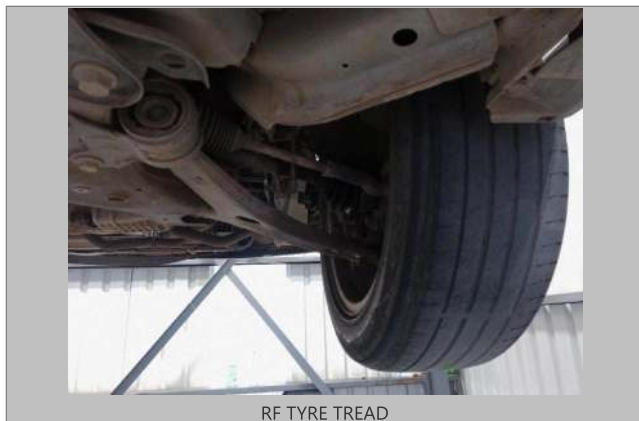


RF TYRE TREAD




LICENSE DISC




VIN PLATE OR STICKER

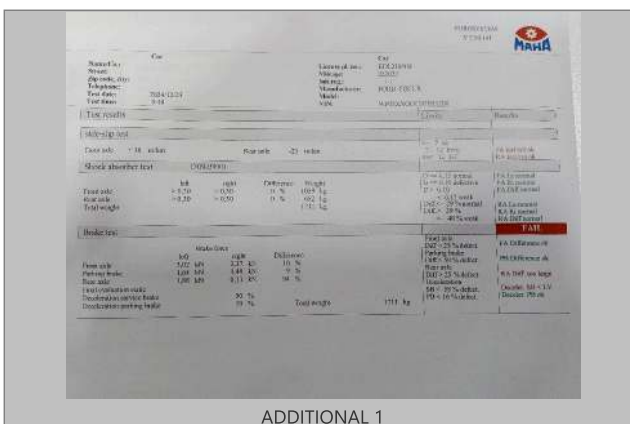

ADDITIONAL 1

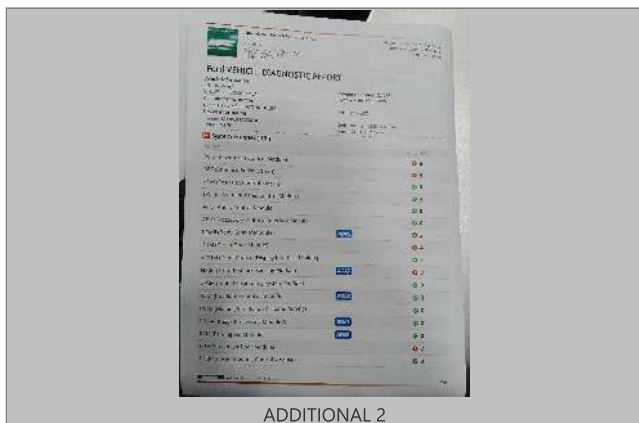


ADDITIONAL 2

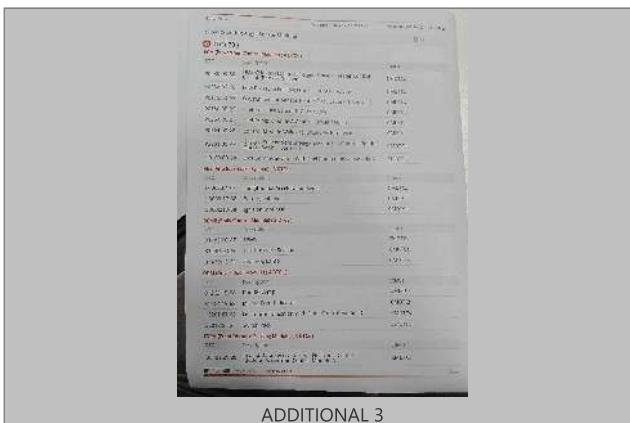


ADDITIONAL 3


VIN: WF05XXGCC5GB31206

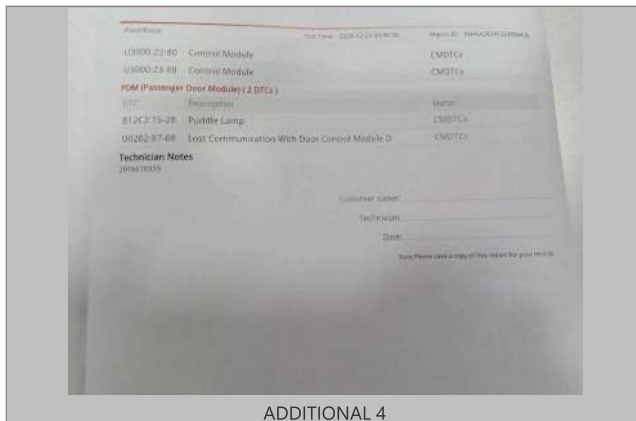

ADDITIONAL 4

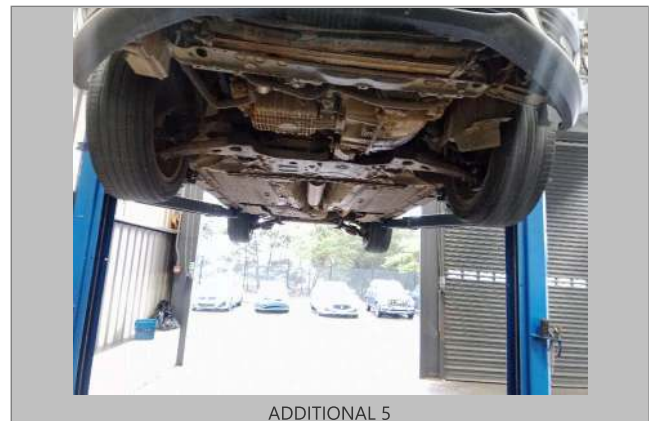


ADDITIONAL 5

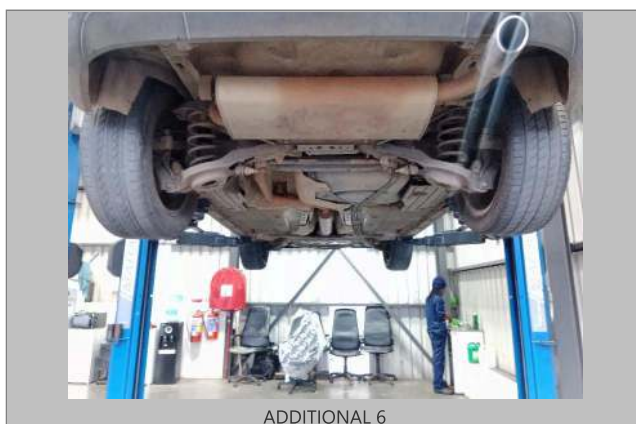

ADDITIONAL 6



ENGINE 1

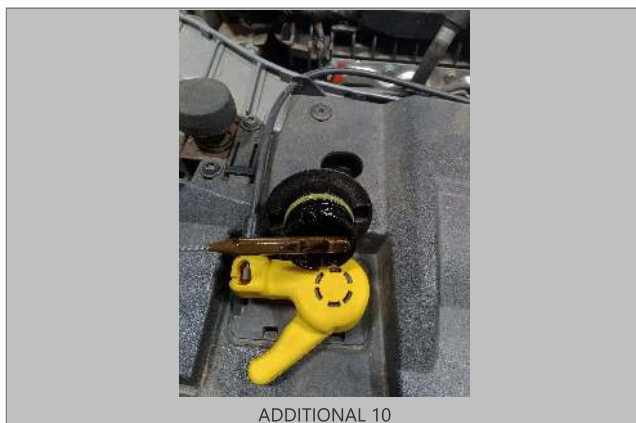

ADDITIONAL 10



ADDITIONAL 11

VIN: WF05XXGCC5GB31206

8 / 12



Water level



Front Bumper

VIN: VF05XXGCC5GB31206

9 / 12



Front Bumper



Bonnet



Front Fender Left



Door Front Left

VIN: WF05XXGCC5GB31206

10 / 12



Door Rear Left



Rear bumper



Rear bumper



Door Rear Right

VIN: WF05XXGCC5GB31206

11 / 12



Door Front Right



Rear Fender Right

VIN: WF05XXGCC5GB31206

12 / 12



Front Fender Right



Windscreen



Tyre Rear Left



Tyre Rear Right



Tyre Front Left



Tyre Front Right



Engine



Gearbox



Radiator Cradle




Seat Front Right



Engine Management Lights



Windscreen Wiper

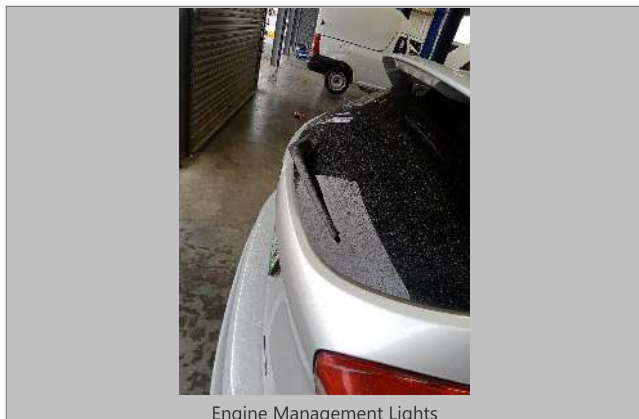



CONDITION REPORT

Report No: 2016670339

DATE
23/12/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za