



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 07/05/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 06/05/2025        |                     | Kempton Park - GT        |


## Vehicle Data

|                 |                                               |                         |              |
|-----------------|-----------------------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE                             | Registered Owner        |              |
| Manufacturer    | FORD                                          | Registration Number     | JB40BLGP     |
| Model           | KUGA 2.0 ECOBOOST TITANIUM AWD AT [2014-2016] | Register Number         |              |
| VIN             | WF0AXXWPMAC68334                              | Date Of First Licensing |              |
| Engine Number   |                                               | Last COR                |              |
| Doors           | 5                                             | License Expiry Date     |              |
| Color           | WHITE                                         | Power / Displacement    |              |
| Year Model      | 2015                                          | Paint Finish            | TWO COAT UNI |
| Km Reading      | 203,706 KM                                    | Fuel                    | PETROL       |
| Cab / Body Type | STATION WAGON                                 | Transmission            | AUTOMATIC    |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

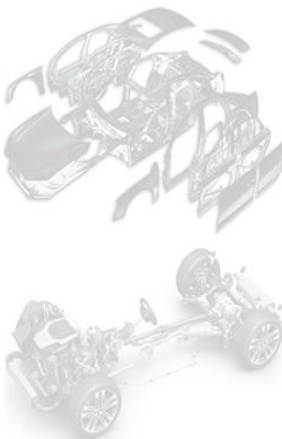

| Damage                                                  | Repair Way |
|---------------------------------------------------------|------------|
| Engine Oil Leak                                         | Repair     |
| Engine Wiring Damaged                                   | Repair     |
| Radiator Defective                                      | Repair     |
| Center Console / Cubbyhole + Lid Defective              | Repair     |
| Switch Electrical Window Winder front right Malfunction | Replace    |
| Windscreen Wiper Damaged                                | Replace    |
| Windscreen Washer Damaged                               | Replace    |
| Air Conditioner Insufficient                            | Replace    |
| Indicator Light Front Left Damaged                      | Repair     |
| Indicator Light Front Right Broken                      | Repair     |
| Fog Light Front Right Missing                           | Replace    |
| Headlight Left Damaged                                  | Replace    |
| Headlight Right Damaged                                 | Replace    |
| Parcel Tray Missing                                     | Replace    |
| Steering Wheel Trim Defective                           | Repair     |
| Number Plate Front Missing                              | Replace    |
| Front Bumper Damaged                                    | Repair     |
| Bonnet Paintwork • Scratched                            | Repair     |
| Front Fender Left Dented                                | Repair     |

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

 DATE  
06/05/2025

| Damage                                                              | Repair Way                                     |
|---------------------------------------------------------------------|------------------------------------------------|
| Front Fender Right Paintwork • Scratched                            | Repair                                         |
| Rear Fender Left Paintwork • Scratched                              | Repair                                         |
| Rear Fender Right Paintwork • Scratched                             | Repair                                         |
| Front Fender Left / Inner Tray Damaged                              | Repair                                         |
| Front Fender Right / Inner Tray Damaged                             | Replace                                        |
| Rear Fender Right / Inner Tray Residual Traces of Repair            | Repair                                         |
| Door Front Left Paintwork • Scratched                               | Repair                                         |
| Door Front Right Paintwork • Scratched                              | Repair                                         |
| Door Rear Left Paintwork • Scratched                                | Repair                                         |
| Door Rear Right Paintwork • Scratched                               | Repair                                         |
| Rear bumper Paintwork • Scratched                                   | Repair                                         |
| Inner Boot Floor Pan and Spare Wheel Well Residual Traces of Repair | Repair                                         |
| Windscreen Cracked                                                  | Replace                                        |
| Tie Rod End left Damaged                                            | Replace                                        |
| Tie Rod left Damaged                                                | Replace                                        |
| Ball Joint(s) Front Axle Left Damaged                               | Replace                                        |
| Tyre Front Left Damaged                                             | Replace                                        |
| Tyre Front Right Damaged                                            | Replace                                        |
| Spare Tyre Damaged                                                  | Replace                                        |
| Rim Front Left Scratched                                            | Repair                                         |
| Rim Front Right Scratched                                           | Repair                                         |
| Rim Rear Left Damaged                                               | Repair                                         |
| Bolt(s) / Nut(s) Rear Wheel Left Missing                            | Replace                                        |
| Bolt(s) / Nut(s) Rear Wheel Right Missing                           | Replace                                        |
| Main Beam Right Residual Traces of Repair                           | Repair                                         |
| Chassis Damaged                                                     | Repair                                         |
| Engine mountings Damaged                                            | Replace                                        |
| CV Joint(s) Boot(s) Front Left (inner/outer) Damaged                | Replace                                        |
| Engine Performance Malfunction                                      | Repair                                         |
| Engine Noise Excessive                                              | Repair                                         |
| Body and Exterior                                                   | Vehicle license disk missing                   |
| Tyres and rims                                                      | Front and rear tyre sizes different.           |
| Body and Exterior                                                   | Traces of repair work done on rear of vehicle. |
| Road test                                                           | Excessive shifting when selecting gears        |
| Body and Exterior                                                   | Signs of impact damage to front of vehicle     |
| Body and Exterior                                                   | Dents and scratches on some body panels        |
| Body and Exterior                                                   | Some body panels misaligned                    |
| Road test                                                           | Gearbox faulty                                 |
| Road test                                                           | Vehicle unsafe to drive                        |
| Vehicle electronics malfunctioning                                  | Repair                                         |
| Axle and suspension                                                 | Signs of vehicle grabbing                      |

### Brakes

#### Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.64               | 3.28               | -                |                                  |
| Rear                | 3.13               | 3.06               | -                |                                  |
| Emergency / Parking | 2.05               | 2.1                | -                |                                  |

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

 DATE  
06/05/2025

### Tyres and Rims

#### Tyre Specification & Measurement

|             | Size        | Load/Speed Index | Manufacture | Model     | Type* | Production Date | Tread Depth (mm) |
|-------------|-------------|------------------|-------------|-----------|-------|-----------------|------------------|
| Front Left  | 255/45 R19  | 100V             | Pirelli     | Scorpion  | V     | 1618            | 0 mm             |
| Front Right | 255/45 R19  | 100V             | Pirelli     | Scorpion  | V     | 1618            | 0 mm             |
| Rear Left   | 245/50 R19  | 105W             | Michelin    | Latitude  | V     | 5017            | 1 mm             |
| Rear Right  | 245/50 R19  | 105W             | Michelin    | Latitude  | V     | 5117            | 2 mm             |
| Spare       | T115/70 R17 | 110M             | Maxxis      | Temporary | V     | 4714            | 0 mm             |

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System                         | Code        | Description                                      | Status |
|----|--------------------------------|-------------|--------------------------------------------------|--------|
| 1  | PCM(POWERTRAIN CONTROL MODULE) | P164D:00-6C | ALL WHEEL DRIVE ID BOOK CORRUPTED,NOT PROGRAMMED |        |

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0AXXWPMAC68334




## CONDITION REPORT


Report No: 2016866839

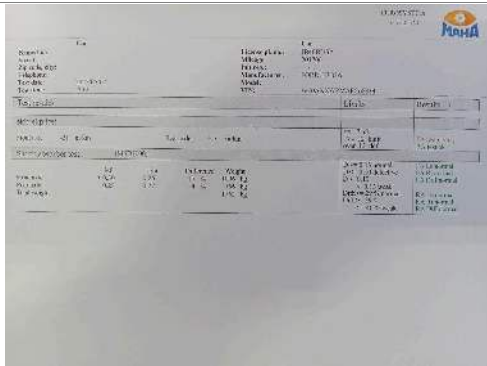DATE  
06/05/2025

Shock absorber report

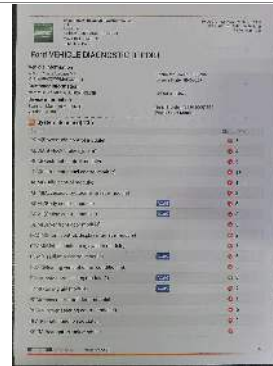

Diagnostic report page 1

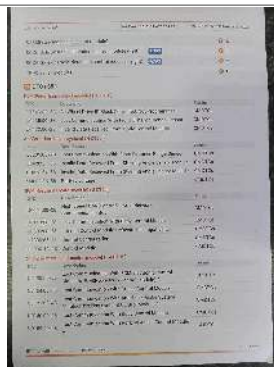

Diagnostic report page 2



Diagnostic report page 3



Diagnostic report page 4



Diagnostic report page 5

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

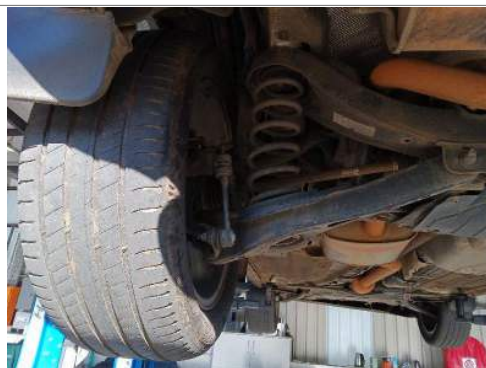

LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

RR TYRE TREAD



RF TYRE TREAD




Spare wheel Accessories



Spare wheel



No license disc

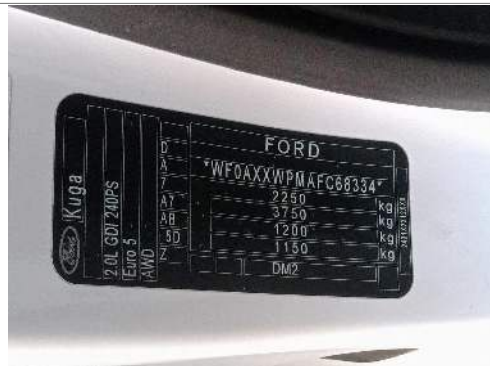

VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WFOAXXWPM AFC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

ENGINE 1



Front chassis



Rear chassis



Oil cap And dipstick



Center Console / Cubbyhole + Lid



Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

Door Rear Right



Door Front Right



Front Fender Right



Indicator Light Front Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

Bonnet



Fog Light Front Right



Number Plate Front



Front Fender Left



Front Fender Left



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334




## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025


Indicator Light Front Left

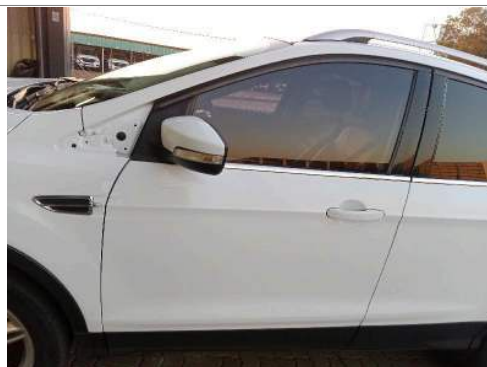

Door Front Left



Door Rear Left

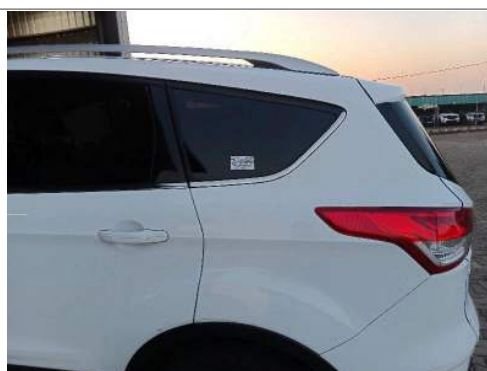

Rear Fender Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

Spare Tyre



Parcel Tray



Steering Wheel Trim



Headlight Right



Headlight Left



Windscreen

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPM AFC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025


Air Conditioner



Front Fender Right / Inner Tray



Rim Front Right

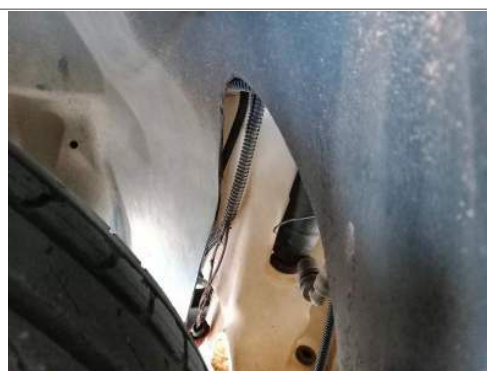

Engine Wiring



Windscreen Washer



Bolt(s) / Nut(s) Rear Wheel Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025

Bolt(s) / Nut(s) Rear Wheel Left



Rim Rear Left



Tyre Front Left



Rim Front Left



Front Fender Left / Inner Tray



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT


Report No: 2016866839

DATE  
06/05/2025


Front Bumper



Radiator

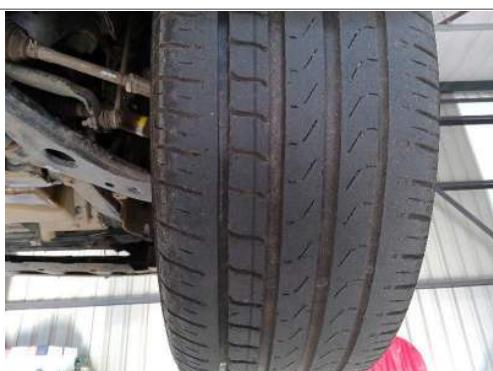

Tyre Front Right

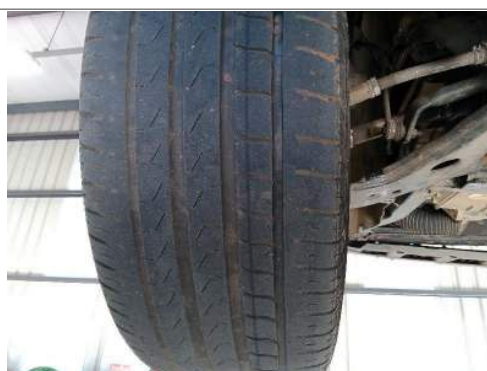

Tyre Front Left



Tie Rod End left



Tie Rod left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025


Ball Joint(s) Front Axle Left



Engine



CV Joint(s) Boot(s) Front Left (inner/outer)

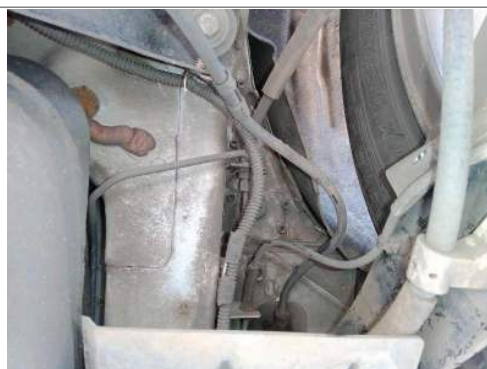

Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Chassis

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: WF0AXXWPMAC68334



## CONDITION REPORT

Report No: 2016866839

DATE  
06/05/2025


Main Beam Right



Main Beam Right



Inner Boot Floor Pan and Spare Wheel Well

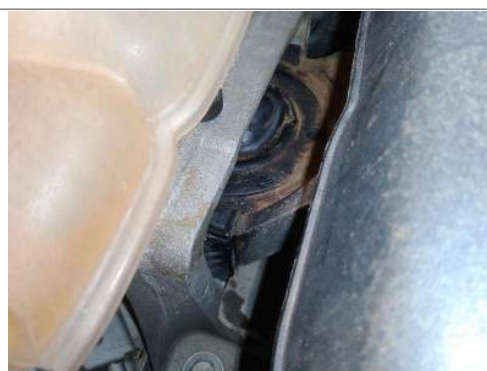

Engine mountings



Water level



Switch Electrical Window Winder front right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: WF0AXXWPMAC68334