

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/12/2023		M57 Pretoria Road - 1619
Inspection Date	27/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	HV06RLGP
Model	FIESTA	Register Number	
VIN	WFOJXXGAHJJB66814	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2023
Color	BROWN	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	64,852 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Air cleaner Defective	Repair
Switch Electrical Window Winder front left Defective	Repair
Switch Electrical Window Winder front right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Defective	Repair
Seat Rear Damaged	Repair
Hood Lining Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Fuel Cap Damaged	Replace
Rocker Panel Left Dented	Repair
Rocker Panel Right Dented	Repair
Roof Paintwork • Scratched	Repair
Windscreen Chipped	Replace
Rim Rear Left Dented	Repair
Main Beam Left Defective	Repair
Chassis Dented	Repair

Damage	Repair Way
Cross Member Front Left Dented	Repair
Cross Member Front Right Dented	Repair
Sub Frame Dented	Repair
Engine to silencer pipe Defective	Repair
Belly plates Damaged	Replace
Gearbox Mountings Defective	Replace
Engine Noise Excessive	Repair
Triangle Missing	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.35	3.59	-	
Rear	1.57	1.53	-	
Emergency / Parking	1.1	1.19	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55 R16	91H	Campiro	GT Radial	V	3721	3 mm
Front Right	195/55 R16	91H	Campiro	GT Radial	V	5021	3 mm
Rear Left	195/55 R16	87V	Michelin	Primacy	V	3218	1 mm
Rear Right	195/55 R16	91V	Michelin	Primacy	V	0620	3 mm
Spare	195/50 R15	82V	Sumitomo	HTR V5	V	0322	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	RCM(RESTRAINT CONTROL MODULE)	B1404:13-08	DRIVER SIDE AIRBAG DEPLOYMENT CONTROL	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.
 Engine Compartment: Engine bay dirty. Brake fluid level ok. Corrosion on battery box. Fan Cowley loose. Rust inside expansion bottle.
 Interior: Vehicle interior dirty and some interior panels scratched.
 Body • Exterior: Minor dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels. Residual traces of repair on some body panels. Signs of impact damage to front of vehicle.
 Tyres and Rims: Alloy rims scratched. Rear left tyre has reached legal limit.
 Undercarriage: Vehicle undercarriage dirty. Front exhaust heat shield damaged

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge,

operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




Manual Transmission

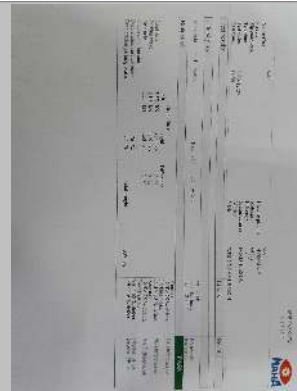

Brake and shock absorber report



Diagnostic report page 1

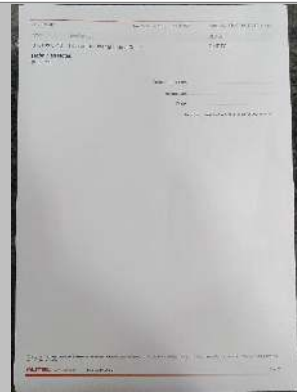

Diagnostic report page 2



Spare wheel and Accessories



Oil cap and dipstick



Front chassis




Rear chassis



FRONT RIGHT CORNER



REAR LEFT CORNER

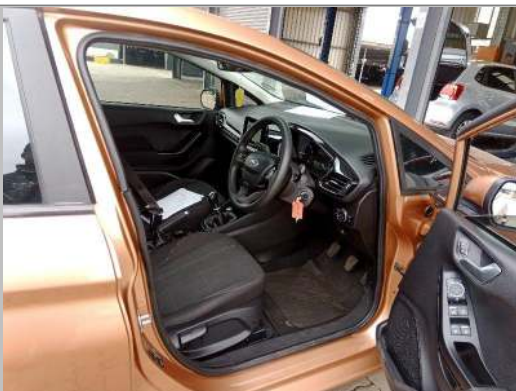

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

VIN: WFOJXXGAHJB66814

7 / 14



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

VIN: WFOJXXGAHJB66814


8 / 14



LR TYRE TREAD



RR TYRE TREAD

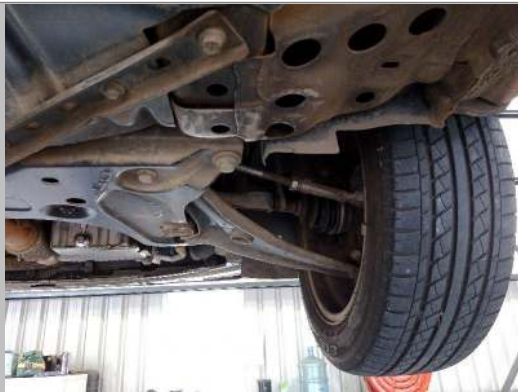

LF TYRE TREAD



VIN: WF0JXXGAHJB66814

10 / 14




Hood Lining




Switch Electrical Window Winder front right




Switch Electrical Window Winder front left

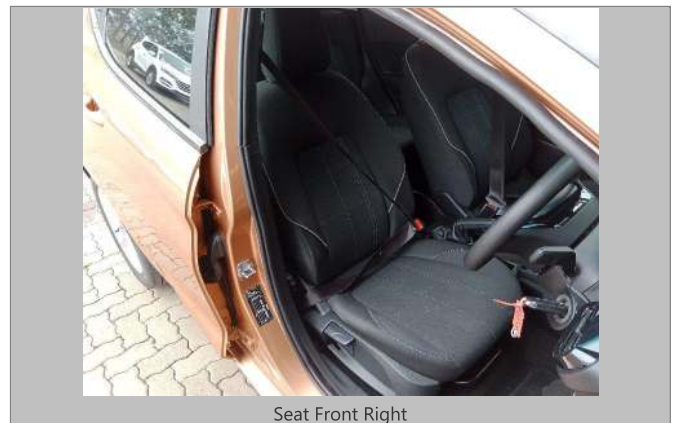

Seat Front Right

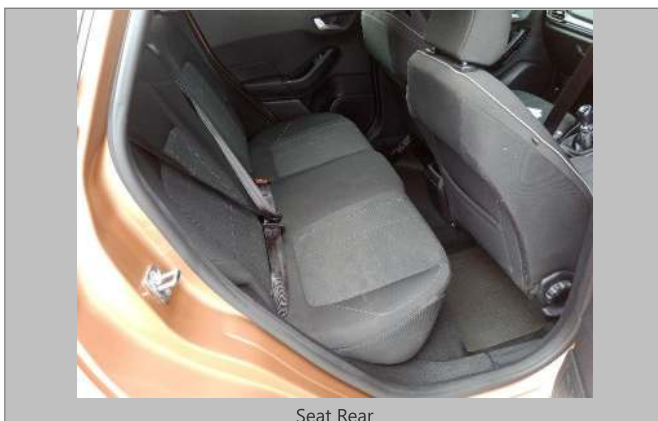

Seat Rear

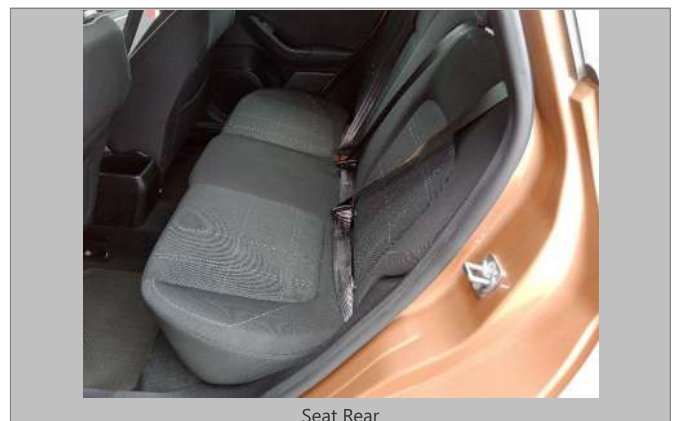

Seat Rear

VIN: WFOJXXGAHJB66814

12 / 14



Seat Front Left



13 / 14

Front Bumper



Front Bumper



Bonnet



Fuel Cap



Rear bumper

VIN: WFOJXXGAHJB66814

14 / 14




Rear bumper



Side Mirror Right



Front Fender Right

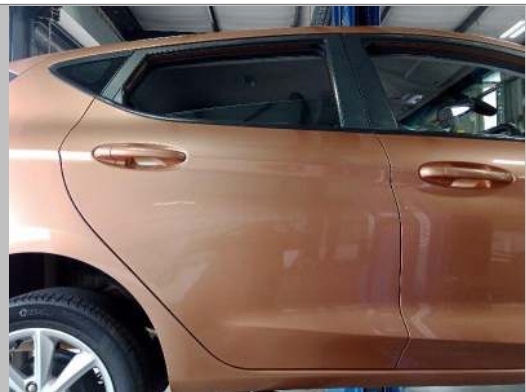

Door Rear Right



Rear Fender Right



Rear Fender Left



Door Rear Left



Door Front Left



Front Fender Left



Side Mirror Left



Rocker Panel Left



Rocker Panel Right



Belly plates



Gearbox Mountings



Cross Member Front Left



Cross Member Front Right



Sub Frame



Engine to silencer pipe



Engine



Rim Rear Left



Engine to silencer pipe



Chassis



Main Beam Left



Belly plates



Chassis



Door Front Right



Roof



Windscreen



Water level



Air cleaner



CONDITION REPORT

Report No: 2016212366

DATE
27/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za