



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/04/2025		M57 Pretoria Road - 1619
Inspection Date	02/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	KST174MP
Model	FIESTA 1.0 TREND 5-DR [2018-2019]	Register Number	
VIN	WF0JXXGAHJJU07422	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT UNI
Km Reading	209,161 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Switch Electrical Window Winder front left Defective	Replace
Switch Electrical Window Winder front right Damaged	Replace
Switch Electrical Window Winder rear right Damaged	Replace
Tail Light Left Cracked	Replace
Headlight Left Defective	Replace
Headlight Right Damaged	Replace
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Hood Lining Dirty	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Dented	Repair
B • Pillar Right Dented	Repair
Front Fender Left Damaged	Replace
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Damaged	Repair
Front Fender Right / Inner Tray Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Damage	Repair Way
Door Front Left Paintwork • Scratched	Repair
Door Front Right Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Damaged	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Dented	Repair
Roof Dented	Repair
Brake disc 1. Axle right Defective	Replace
Tyre Front Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Scratched	Repair
Rim Spare Wheel Dented	Repair
Cross Member Rear Right Dented	Repair
Engine to silencer pipe Defective	Repair
Belly plates Damaged	Repair
Gearbox Mountings Damaged	Replace
Gearbox Oil Sweat	Repair
Steering Noisy	Repair
Engine Noise Excessive	Repair
Gear Selections Malfunction	Repair
Body and Exterior	Front left quarter window missing.
Electrical instruments and components	Rain sensor damaged
Warning light illuminated on dashboard	Repair
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Dents and scratches on some body panels
Tyres and rims	Rear left and right tyre sizes different
Engine	Engine bay dirty.
Tyres and rims	Spare wheel deflated

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.36	2.68	-	
Rear	1.8	1.73	-	
Emergency / Parking	1.29	1.16	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55 R16	91H	Campiro	GT Radial	V	2321	1 mm
Front Right	195/55 R16	87V	Anchee	Radial	V	3823	2 mm
Rear Left	175/65 R14	82T	Continental	ContiEco	V	3413	1 mm
Rear Right	195/55 R16	91V	Sumitomo	BC100	V	1419	0 mm
Spare	195/55 R16	91V	Sumitomo	BC100	V	1419	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

 DATE
02/04/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM(POWERTRAIN CONTROL MODULE)	P0131:00-28	OXYGEN SENSOR SENSOR CIRCUIT LOW VOLTAGE(BANK 1 SENSOR 1)	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WF0JXXGAHJU07422




CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

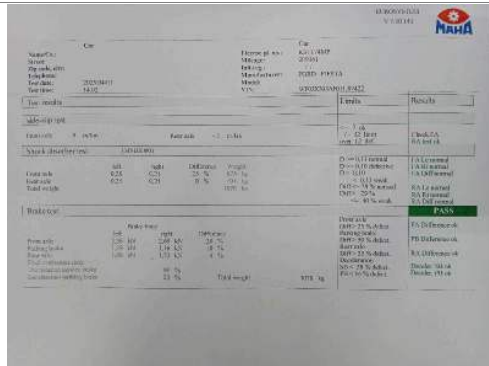


Brake and shock absorber report

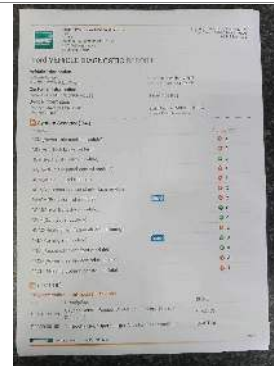

Diagnostic report page 1



Diagnostic report page 2

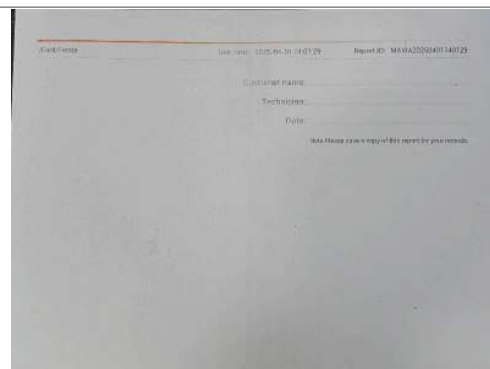

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025



Spare wheel and Accessories



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Rain sensor



Oil cap and dipstick



Hood Lining



Steering Wheel Trim



Switch Electrical Window Winder front left



Switch Electrical Window Winder front right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Switch Electrical Window Winder rear right



Seat Front Right



B • Pillar Right



Seat Rear



Rear Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT


Report No: 2016824067

DATE
02/04/2025

Door Front Right



Side Mirror Right

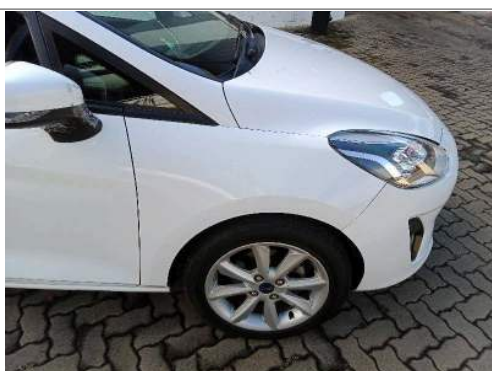

Front Fender Right



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Switch Electrical Window Winder front left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Rear bumper



Rear bumper



Roof



Tail Light Left



Headlight Left



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Water level



Engine



Rim Spare Wheel



Inner Boot Floor Pan and Spare Wheel Well



Sill Panel Right



Rim Front Right


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

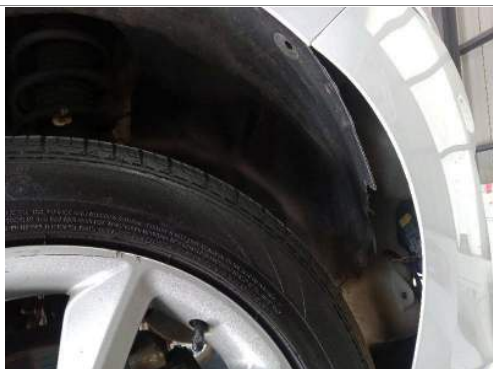DATE
02/04/2025

Front Fender Right / Inner Tray



Brake disc 1. Axle right



Tyre Rear Right



Tyre Rear Right



Rim Front Left



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Belly plates



Gearbox Mountings



Belly plates



Engine to silencer pipe



Gearbox



Cross Member Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422



CONDITION REPORT

Report No: 2016824067

DATE
02/04/2025

Belly plates



Engine



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0JXXGAHJU07422