



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/07/2025		M57 Pretoria Road - 1619
Inspection Date	25/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	FORD	Registration Number	KNX706MP
Model	FOCUS 2.0 GTDI ST3 5-DR [2012-2013]	Register Number	
VIN	WF0KXXGCBKCY72807	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2024
Color	WHITE	Power / Displacement	
Year Model	2013	Paint Finish	TWO COAT UNI
Km Reading	274,770 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025

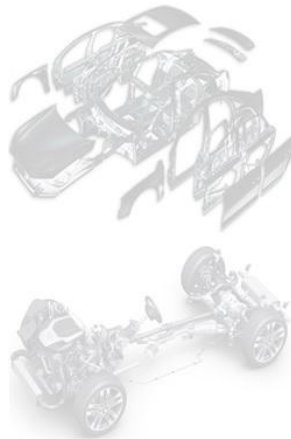

Damage	Repair Way
Engine Oil Leak	Repair
Caps Missing	Replace
Hoses Water Leak	Replace
Air cleaner Defective	Replace
Central Air Vent Cracked	Repair
Radio/CD/USB Damaged	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Switch Electrical Window Winder rear right Malfunction	Replace
Air Conditioner Insufficient	Replace
Fog Light Front Left Damaged	Repair
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Right Damaged	Repair
Door Panel Front Right Damaged	Repair
Parcel Tray Damaged	Repair
Clutch Pedal Rubber Missing	Replace
Brake Pedal Rubber Missing	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
C • Pillar Left Residual Traces of Repair	Repair
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Damaged	Repair
Front Fender Right / Inner Tray Damaged	Repair
Rear Fender Right / Inner Tray Damaged	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Rocker Panel Left Damaged	Repair
Rocker Panel Right Damaged	Repair
Roof Residual Traces of Repair	Repair
Windscreen Chipped	Repair
Shock Absorber Front Left Sweat	Replace
Shock Absorber Front Right Leak	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Left Loose / Excessive Play	Replace
Ball Joint(s) Front Axle Right Loose / Excessive Play	Replace
Spare Tyre Torn / Cut	Replace
Rim Front Left Scratched	Repair
Rim Front Right Dented	Repair
Rim Rear Left Dented	Repair
Sub Frame Dented	Repair
Engine to silencer pipe Defective	Replace
Silencer Defective	Replace
Catalytic converter Missing	Replace
Belly plates Defective	Repair
Gearbox Oil Sweat	Repair
Steering Noisy	Repair
Engine Performance Idling / Hunting	Repair
Engine Noise Excessive	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025

Damage	Repair Way
Engine Smoke Excessive	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Warning lights illuminated on dashboard	Repair
Engine	Foreign substance on oil cap
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Front right shock absorber weak	Replace
Tyres and rims	Front left and right tyre sizes different
Road test	Vehicle unsafe to drive
Interior	Vehicle interior dirty and some panels scratched

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.82	2.45	-	
Rear	1.94	2.02	-	
Emergency / Parking	1.62	1.52	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/35 R19	92Y	Bridgestone	Potenza	V	4722	2 mm
Front Right	255/35 R19	92Y	Bridgestone	Potenza	V	4922	2 mm
Rear Left	235/35Z R19	91W	Davanti	DX640	V	0422	3 mm
Rear Right	235/35Z R19	91Y	Nexen	Nfera	V	5020	4 mm
Spare	205/55 R16	91W	Michelin	Primacy 4	V	0419	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM(POWERTRAIN CONTROL MODULE)	P0030:00-28	H02(HEATED EXHAUST OXYGEN SENSOR)HEATER CONTROL CI	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025

[illegible]

Brake and shock absorber report

Shock absorber test				
(MSL23100)				
	left	right	Difference	Weight
Front axle	0.29	0.85	93 %	513 kg
Rear axle	> 0.30	> 0.29	0 %	570 kg
Total weight				1483 kg

Brake test				
	Brake force			
	left	right	15 % bonus	
Front axle	2.87 kN	2.41 kN	13 %	
Parking brake	1.62 kN	1.55 kN	6 %	
Rear axle	1.64 kN	2.03 kN	4 %	
Final evaluation state		62 %		
Difference on parking brake		22 %		
			Total weight	1483 kg

Shock absorber readings

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2

[illegible]

Diagnostic report page 3

[illegible]

Diagnostic report page 4

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Front chassis



Rear chassis



Oil cap and dipstick



Center Console / Cubbyhole + Lid



Seat Front Right



Door Panel Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Front Fender Right



Door Front Right



Door Rear Right



Rear Fender Right



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Boot Lid / Hatch door



Rear Fender Left



Door Rear Left



Door Front Left



Central Air Vent



Radio/CD/USB

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Air Conditioner



Spare Tyre




Parcel Tray



C • Pillar Left



C • Pillar Right

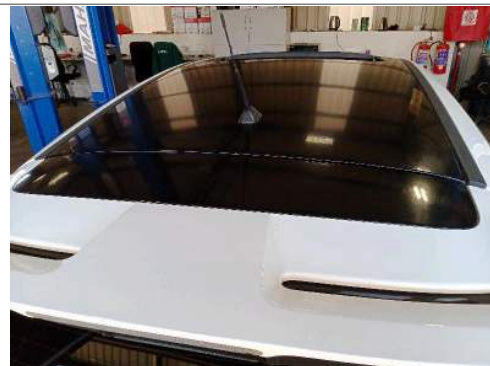

Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Front Fender Left



Front Bumper



Front Bumper



Bonnet



Headlight Right



Headlight Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Air cleaner



Caps



Hoses



Hoses



Engine



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Shock Absorber Front Right



Front Fender Right / Inner Tray



Rocker Panel Right



Rim Rear Left



Rim Front Left



Rocker Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Shock Absorber Front Left



Ball Joint(s) Front Axle Left



Ball Joint(s) Front Axle Right



Fog Light Front Left



Belly plates



Belly plates

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Gearbox



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right



Sub Frame



Catalytic converter



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Silencer



Rear Fender Right / Inner Tray



Engine to silencer pipe



Water level



Windscreen



Switch Electrical Window Winder rear right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807



CONDITION REPORT



Report No:
2016957999
DATE
25/07/2025



Clutch Pedal Rubber



Brake Pedal Rubber

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0KXXGCBKCY72807