



CONDITION REPORT



Report No:
2017304536
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	HBS917L
Model	FOCUS	Register Number	
VIN	WF0MXXGCBMCC19148	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/10/2026
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	227,142 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:

2017304536

DATE

29/09/2026



Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Dim Light Left Defective	Repair
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	Repair
Tyre Rear Right Excessive Wear & Tear	Replace
Spare Tyre Smooth	Replace
Gearbox Oil Sweat	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Rear tyre size differs	Replace
suspension excessive noise	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.3	-	
Rear	1.8	2.6	-	
Emergency / Parking	1.5	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/45R17	91W	Annaite	AN606	V	4824	3 mm
Front Right	215/45R17	91W	Annaite	AN606	V	0325	4 mm
Rear Left	T125/90R19	98M	Hankook	Temporary	V	0712	3 mm
Rear Right	215/45R17	91W	Aptany	Sport	V	1924	0 mm
Spare	215/45R17	91W	Annaite	AN606	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:
2017304536
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	POWERTRAC CONTROL MODULE	P0504:92-28	BRAKE SWITCH A/B CORRELATION	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS / RESIDUAL TRACES OF REPAIR WORK DONE ON BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:

2017304536

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:

2017304536

DATE

29/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:
2017304536
DATE
29/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:

2017304536

DATE


29/09/2026



LF TYRE TREAD



RF TYRE TREAD

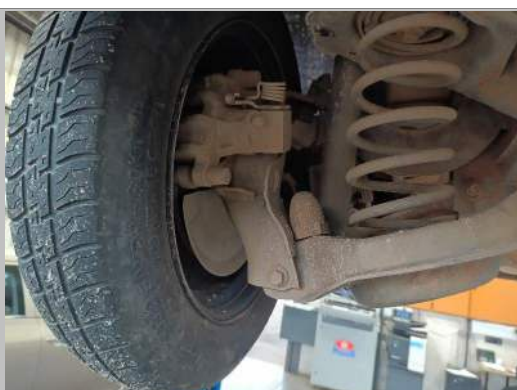


LR TYRE TREAD



RR TYRE TREAD



Sparewheel

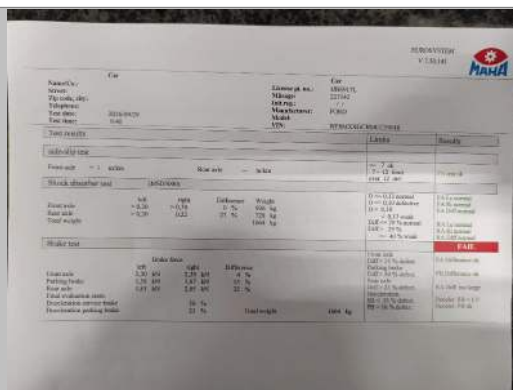

Shock and brake

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WF0MXXGCBMCC19148




CONDITION REPORT




Report No:
2017304536
DATE
29/09/2026

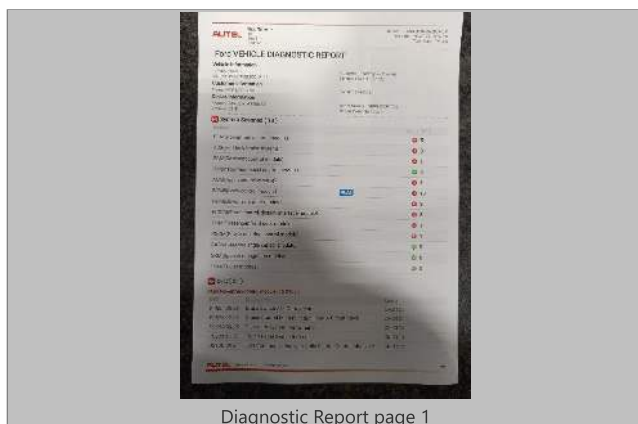


Diagnostic Report page 1

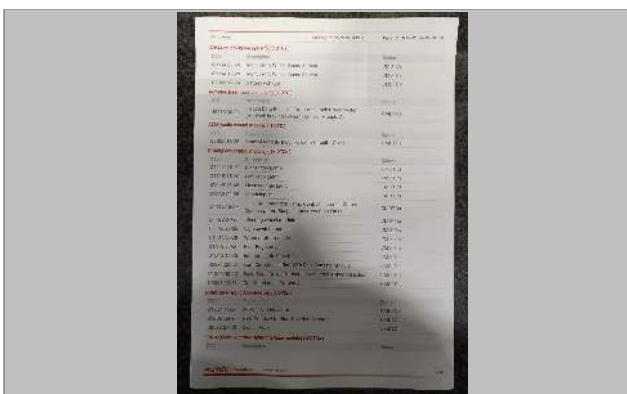


Diagnostic Report page 2

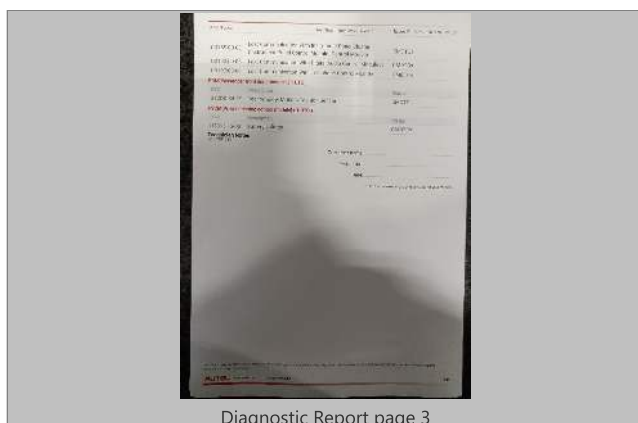


Diagnostic Report page 3

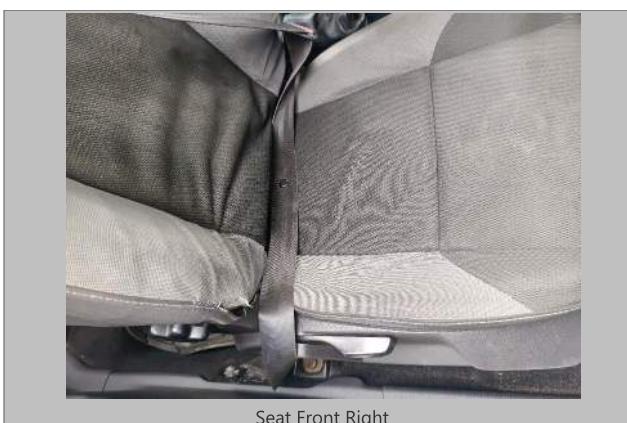

Seat Front Right

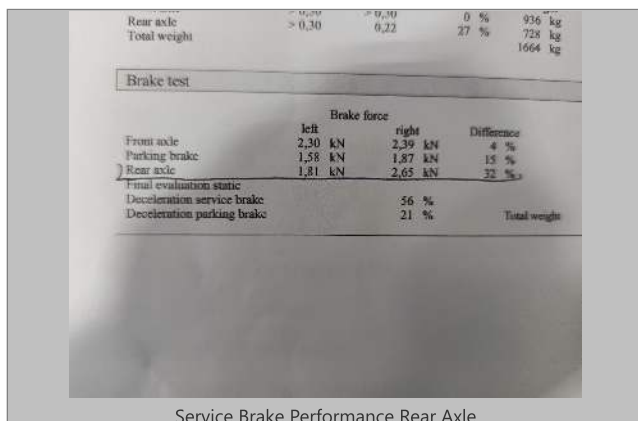

Service Brake Performance Rear Axle

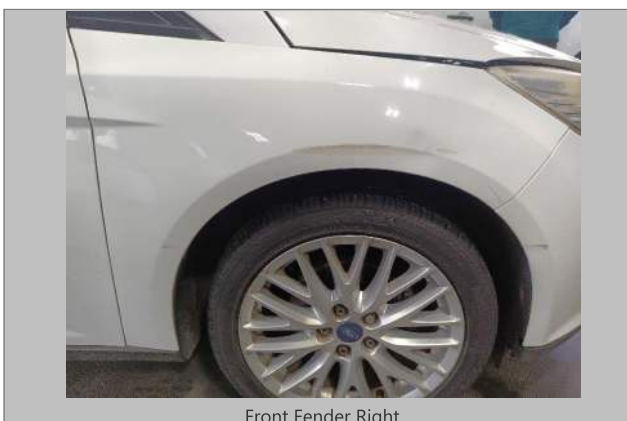

Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:
2017304536
DATE
29/09/2026



Door Front Right



Door Rear Right



Spare Tyre



Front Fender Left



Bonnet



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148




CONDITION REPORT



Report No:
2017304536
DATE
29/09/2026



CV Joint(s) Boot(s) Front Right (inner/outer)

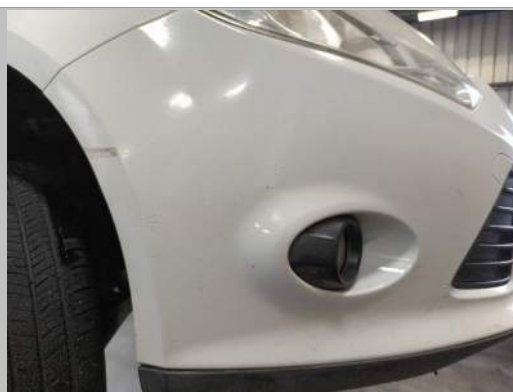

Front Bumper



Front Bumper



Front Bumper



Front Bumper



Dim Light Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:

2017304536

DATE

29/09/2026



CV Joint(s) Boot(s) Front Left (inner/outer)



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT




Report No:

2017304536

DATE

29/09/2026

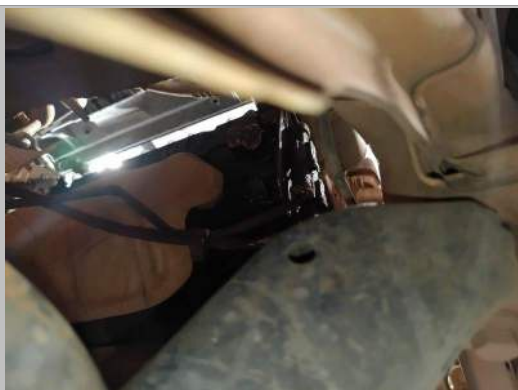

Engine



Engine



Gearbox



Engine Wiring



Tyre Rear Right



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148



CONDITION REPORT



Report No:
2017304536
DATE
29/09/2026



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0MXXGCBMCC19148