



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	YXM824GP
Model	FOCUS 2.5 ST 5-DR [2008-2012]	Register Number	
VIN	WF0PXXGCDP9C76861	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	ORANGE	Power / Displacement	
Year Model	2010	Paint Finish	M - METALLIC
Km Reading	230,135 KM	Fuel	PETROL
Cab / Body Type		Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:

2017301938

DATE

22/09/2026

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Bonnet cable Missing	Replace
Fog Light Front Right Defective	Repair
Seat Front Right Torn / Cut	Repair
Side Mirror Right Paintwork • Flaking	Repair
Front Bumper Paintwork • Flaking	Repair
Grill Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Defective	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Flaking	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Flaking	Repair
Boot Lid / Hatch door Paintwork • Flaking	Repair
Rear bumper Paintwork • Flaking	Repair
Windscreen Cracked	Replace
Tie Rod End left Damaged	Replace
Tie Rod End right Cracked	Replace
Steering Rack Boot Left Leak	Replace
Ball Joint(s) Front Axle Left Damaged	Replace
Rim Front Left Deformed	Repair
Rim Front Right Deformed	Repair
Rim Rear Left Deformed	Repair
Engine to silencer pipe Welded	Replace
Catalytic converter Missing	Replace
Gearbox Mountings Cracked	Replace
Gearbox Oil Leak	Repair
Warning lights illuminated	Repair
Boot does not open	Repair
Aftermarket exhaust system fitted	Repair
Bonnet struggling to open	Repair
Front suspension excessive knocking noise	Repair
Body exterior	Signs of spray work done on body panels

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.8	3.8	-	
Rear	2.4	2.3	-	
Emergency / Parking	1.2	1	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92Y	Royal Black	Explorer	V	4425	6 mm
Front Right	225/40R18	92Y	Diamond Blac	DSH	V	2821	2 mm
Rear Left	225/40R18	92Y	Diamond Blac	DSH	V	2821	6 mm
Rear Right	225/40R18	92H	Diamond Blac	DSH	V	2821	6 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	RESTRAINT CONTROL MODULE	B1318-20	BATTERY VOLTAGE TOO LOW	
2	MESSAGE CENTER	B1389-20	OIL TEMPERATURE SENSOR CIRCUIT FAILURE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE REAR



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



RR TYRE TREAD



RF TYRE TREAD



Oil cap and dipstick



Expansion bottle



REAR



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



ENGINE 2




CHASSIS




VIN PLATE OR STICKER



LICENSE DISC

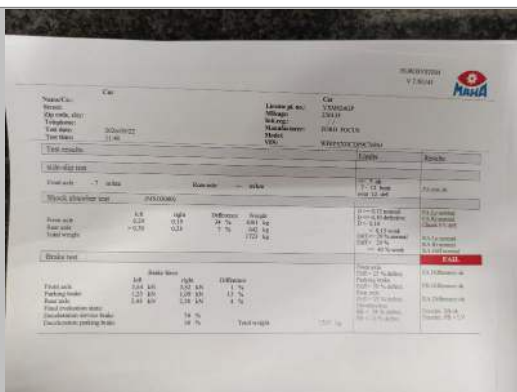

SHOCK AND BRAKE REPORT

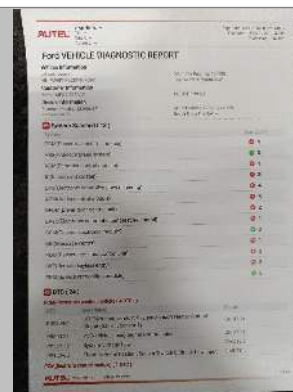

DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT




Report No:


2017301938

DATE

22/09/2026

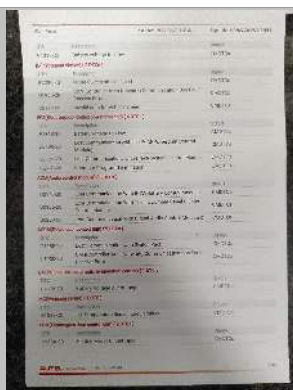

DIAGNOSTIC REPORT PAGE 2

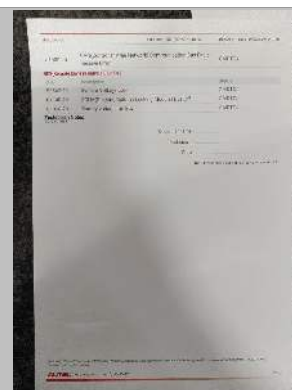

DIAGNOSTIC REPORT PAGE 3



Warning lights illuminated



Seat Front Right



Side Mirror Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Door Front Right



Boot Lid / Hatch door



Rear bumper



Door Rear Left



Door Front Left



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Windscreen




Windscreen



Bonnet cable



Bonnet cable

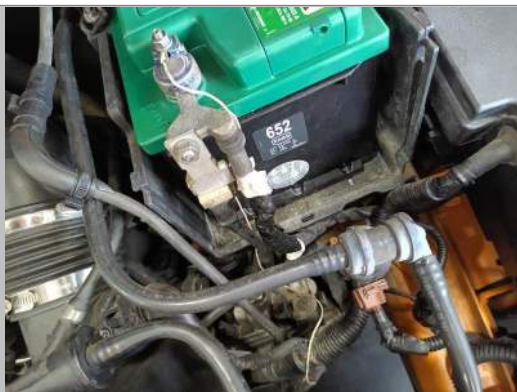

Engine Wiring



Bonnet slam plate (Shock tower/ Inner tray)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Grill



Water level



Rim Front Right



Rim Front Right



Fog Light Front Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Front Bumper



Front Bumper



Front Bumper



Rim Front Left



Tie Rod End left



Steering Rack Boot Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Ball Joint(s) Front Axle Left



Tie Rod End right




Engine



Engine



Engine

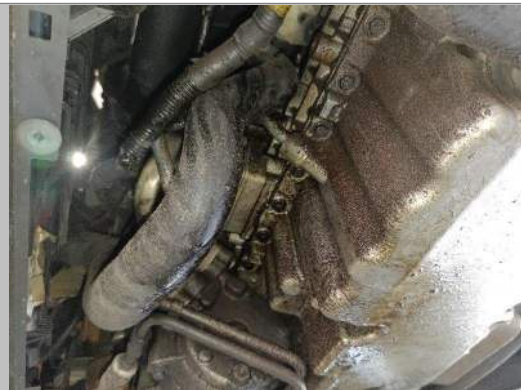

Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Engine



Gearbox



Gearbox



Catalytic converter



Gearbox Mountings



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Engine to silencer pipe



Engine to silencer pipe




Engine to silencer pipe



Engine to silencer pipe



Engine to silencer pipe

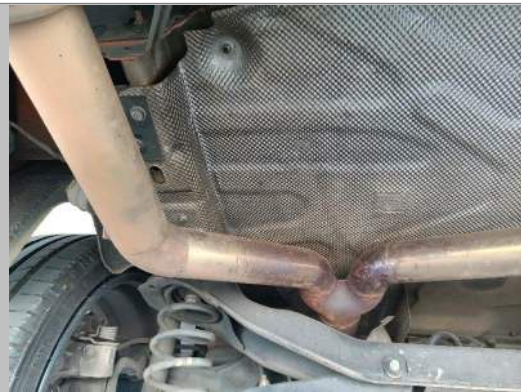

Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861



CONDITION REPORT



Report No:
2017301938
DATE
22/09/2026



Engine to silencer pipe



Engine to silencer pipe



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WF0PXXGCDP9C76861