



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/06/2025		M57 Pretoria Road - 1619
Inspection Date	25/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	LCH503NW
Model	TIGUAN ALLSPACE 1.4 TSI TRENDLINE 110KW DSG [2018-2019]	Register Number	
VIN	WVGZZZ5NZJM217021	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2018	Paint Finish	C - COMMON
Km Reading	130,817 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJM217021



CONDITION REPORT




Report No:

2016924173

DATE

25/06/2025

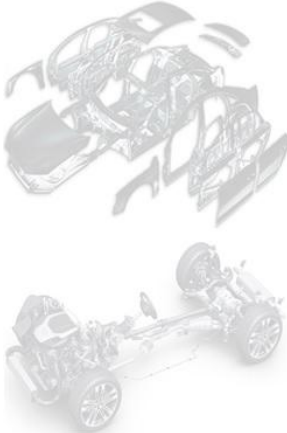	Damage	Repair Way
	Engine Oil Leak Radiator Damaged Headlight Left Damaged Side Mirror Right Damaged Front Bumper Damaged Bonnet Damaged Front Fender Left Damaged Front Fender Right Damaged Rear Fender Left Residual Traces of Repair Door Front Right Damaged Door Rear Left Residual Traces of Repair Windscreen Cracked Parking Brake Performance Left / Right Difference out of legal range Gearbox Oil Leak Radiator Cradle Damaged Gear Selections Insufficient Clutch Operation Insufficient No reverse gear Body exterior Body exterior Undercarriage Multiple warning lights illuminated	Repair Repair Replace Replace Replace Repair Repair Repair Repair Repair Repair Replace Repair Replace Replace Repair Replace Replace Repair Repair Repair Repair Signs of spray work done on some body panels Minor dents scratches stone chips on some body pan Undercarriage is covered Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.2	3.1	-	
Rear	2.3	2.5	-	
Emergency / Parking	1.3	0.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R17	99V	Pirelli	Scorpion	V	3719	3 mm
Front Right	215/65R17	99V	Pirelli	Scorpion	V	3719	1 mm
Rear Left	215/65R17	99V	Pirelli	Scorpion	V	3719	3 mm
Rear Right	215/65R17	99V	Pirelli	Scorpion	V	3719	3 mm
Spare	T145/85R18	103M	Dunlop	Temporary	V	////////	5 mm

* Tyre Legend: V=Virgin, R=Recap



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	U112300	DATABUS ERROR VALUE RECEIVED	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



Warning lights illuminated




Warning lights illuminated



Sparewheel



Automatic

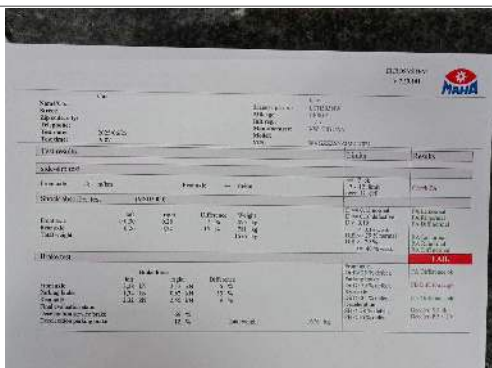

Shock and brake report



Diagnostic test

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZJM217021




CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



Diagnostic test

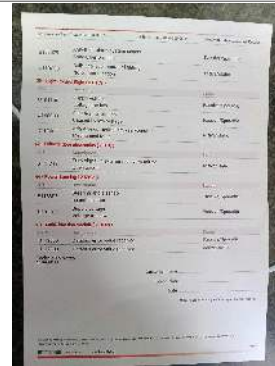

Diagnostic test



Expansion bottle



Oil cap and dipstick



Rear end



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



90 DEGREE RIGHT




90 DEGREE REAR



90 DEGREE LEFT



LICENSE DISC

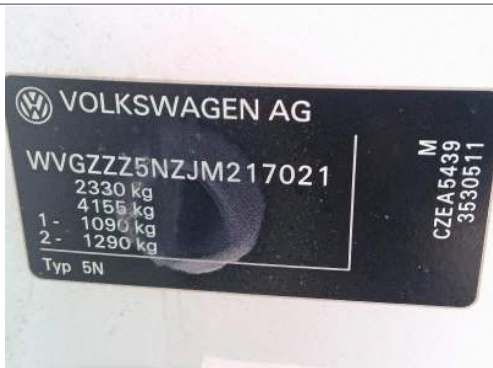

VIN PLATE OR STICKER



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1



CHASSIS



ENGINE 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025

Brake Test			
Front axle	Left	Right	
Brake disk	150 mm	150 mm	
Brake pad	150 mm	150 mm	
Brake fluid	150 mm	150 mm	
Brake pressure	150 mm	150 mm	
Brake force	150 mm	150 mm	
Brake torque	150 mm	150 mm	
Brake efficiency	150 mm	150 mm	
Brake wear	150 mm	150 mm	
Brake condition	150 mm	150 mm	
Brake test result	150 mm	150 mm	
Brake test date	150 mm	150 mm	
Brake test location	150 mm	150 mm	
Brake test operator	150 mm	150 mm	
Brake test vehicle	150 mm	150 mm	
Brake test weight	150 mm	150 mm	

Parking Brake Performance



Front Fender Right



Door Front Right



Side Mirror Right



Windscreen



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVZZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



Door Rear Left



Door Rear Left



Front Fender Left



Front Bumper



Front Bumper



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



Headlight Left



Water level



Gearbox



Radiator Cradle



Radiator Cradle



Radiator

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZ5NZJM217021



CONDITION REPORT



Report No:
2016924173
DATE
25/06/2025



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZ5NZJM217021