

CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025

MFC Auction House M57 Pretoria Rd, Glenmarais, KEMPTON PARK Gauteng

DEKRA MFC M57 Pretoria Rd - 1619 KEMPTON PARK - GT 08610 33572









31/05/2025



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/05/2025		M57 Pretoria Road - 1619
Inspection Date	20/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner		
Manufacturer	VOLKSWAGEN	Registration Number	JM78WFGP	
Model	TIGUAN ALLSPACE 1.4 TSI 110KW	Register Number		
	COMFORTLINE DSG [2019-2021]	Date Of First Licensing		

VIN WVGZZZ5NZKM197439 Last COR

Engine Number License Expiry Date

Doors 5 Power / Displacement

ColorWHITEPaint FinishTWO COAT UNIYear Model2020FuelPETROLKm Reading83,706 KMTransmissionAUTOMATIC

Cab / Body Type HATCHBACK

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way	
Seat Front Right Damaged	Repair	
Front Bumper Damaged	Repair	
Bonnet Damaged	Repair	
Rear Fender Right Damaged	Repair	
Door Front Right Damaged	Repair	
Door Rear Left Damaged	Repair	
Door Rear Right Damaged	Repair	
Boot Lid / Hatch door Damaged	Repair	
Rear bumper Damaged	Repair	
Tyre Rear Left Worn	Replace	
Tyre Rear Right Worn	Replace	



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.23	4.88	-	
Rear	2.34	2.12	-	
Emergency / Parking	1.8	1.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/45R19	100V	Continental	Contisport	V	0324	3 mm
Front Right	255/45R19	100V	Continental	Contisport	V	0324	3 mm
Rear Left	255/45R19	100V	Continental	Contisport	V	3818	0 mm
Rear Right	255/45R19	100V	Continental	Contisport	V	3718	0 mm

^{*} Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIR CONDITIONING	B131207	BUTTON IN OPERATING UNIT MECHANICAL MALFUNCTION	

Inspection Conditions

No Test Drive

Battery Flat

 $\label{lem:engine} \textbf{Engine number} - \textbf{not possible to verify engine number (not visible without dismantling)}$

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 7 DTC'S AT TIME OF TESTING SEE DTC REPORT. Undercarriage: bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za





CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025

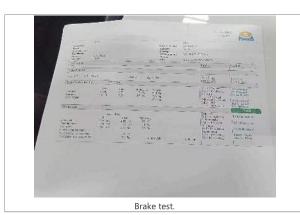

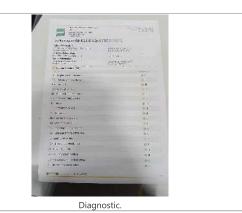

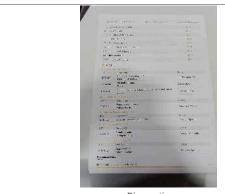



Diagnostic.





DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic.



90 DEGREE FRONT







DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025



90 DEGREE LEFT





R TYRE TREAD







DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear



Oil cap and dipstick.



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025



Front Bumper



Front Bumper



3onnet



Door Rear Left



Rear bumper



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025



Boot Lid / Hatch door



Rear Fender Right




Door Front Right



Door Rear Right



Seat Front Right

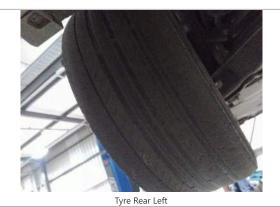

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867

www.dekraauto.co.za



CONDITION REPORT

Report No: 2016883776

DATE 20/05/2025



DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za