



CONDITION REPORT



Report No:
2017303559
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	KVV783NW
Model	T-CROSS 1.0 TSI 85KW HIGHLINE DSG [2022-2024]	Register Number	
		Date Of First Licensing	
VIN	WVGZZZC1ZPY017527	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2023	Fuel	PETROL
Km Reading	90,568 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZZC1ZPY017527



CONDITION REPORT



Report No:

2017303559

DATE

25/09/2026

Damage

Repair Way

Switch Electrical Window Winder front left Damaged

Replace

Headlight Left Damaged

Replace

Front Bumper Damaged

Repair

Bonnet Damaged


Repair

Rear bumper Damaged

Repair

Windscreen Damaged

Repair

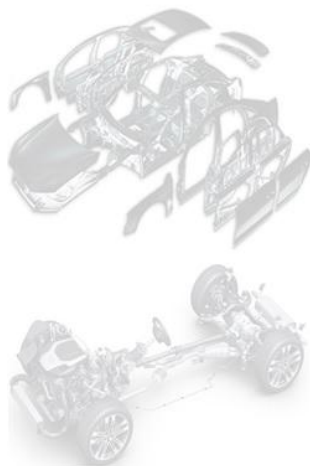

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.28	3.49	-	
Rear	2.72	2.39	-	
Emergency / Parking	1.26	1.03	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/45R18	89V	Pirelli	Radial	V	3425	2 mm
Front Right	215/45R18	89V	Pirelli	Radial	V	3425	2 mm
Rear Left	215/45R18	89V	Pirelli	Radial	V	1925	3 mm
Rear Right	215/45R18	89V	Pirelli	Radial	V	1925	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527

**CONDITION REPORT**

Report No:
2017303559
DATE
25/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527



CONDITION REPORT



Report No:
2017303559
DATE
25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527



CONDITION REPORT



Report No:

2017303559

DATE

25/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Automatic.



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527



CONDITION REPORT



Report No:


2017303559

DATE

25/09/2026



LR TYRE TREAD

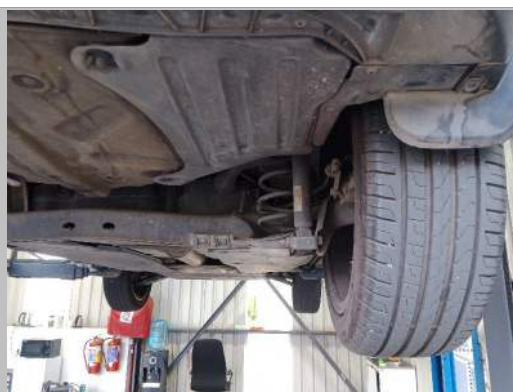

RR TYRE TREAD



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527



CONDITION REPORT



Report No:
2017303559
DATE
25/09/2026



VIN PLATE OR STICKER



LICENSE DISC

Vehicle Data		Test Results	
Make	Volkswagen	Brake Force	1.2 kN
Model	Volkswagen	Brake Torque	0.8 Nm
Year	2017	Brake Pressure	1.2 MPa
Engine	1.8 TFSI	Brake Temperature	120 °C
Transmission	6-Speed	Brake Wear	Low
Weight	1750 kg	Brake Efficiency	95%

BRAKE TEST REPORT

Parameter	Value	Status
Engine Speed	1500 RPM	Normal
Transmission Temp	80 °C	Normal
Oil Pressure	2.5 bar	Normal
Water Temp	90 °C	Normal
Brake Pressure	1.2 MPa	Normal
Steering Angle	0°	Normal

DIAGNOSTIC REPORT PAGE 1

Parameter	Value	Status
Engine Speed	1500 RPM	Normal
Transmission Temp	80 °C	Normal
Oil Pressure	2.5 bar	Normal
Water Temp	90 °C	Normal
Brake Pressure	1.2 MPa	Normal
Steering Angle	0°	Normal

DIAGNOSTIC REPORT PAGE 2

Parameter	Value	Status
Engine Speed	1500 RPM	Normal
Transmission Temp	80 °C	Normal
Oil Pressure	2.5 bar	Normal
Water Temp	90 °C	Normal
Brake Pressure	1.2 MPa	Normal
Steering Angle	0°	Normal

DIAGNOSTIC REPORT PAGE 3

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527



CONDITION REPORT



Report No:
2017303559
DATE
25/09/2026



Water level



Headlight Left



Front Bumper



Front Bumper



Bonnet



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527



CONDITION REPORT



Report No:
2017303559
DATE
25/09/2026



Rear bumper



Windscreen



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVGZZC1ZPY017527