

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/04/2025		M57 Pretoria Road - 1619
Inspection Date	23/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KLR619NW
Model	JETTA 6 GP 1.4 TSI COMFORTLINE [2015-2017]	Register Number	
VIN	WVWZZZ16ZGM005020	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/02/2025
Color	WHITE	Power / Displacement	
Year Model	2015	Paint Finish	C - COMMON
Km Reading	267,269 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Wiper Switch Defective	Repair
Side Mirror Left Damaged	Replace
Side Mirror Right Paintwork • Discoloured	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Discoloured	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Smooth	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ16ZGM005020

Damage	Repair Way
CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Repair
Tyre pressure warning light illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.7	-	
Rear	1.9	2.0	-	
Emergency / Parking	1.2	1.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Continental	Contact	V	4523	2 mm
Front Right	205/55R16	91V	Firestone	Touring	V	2122	0 mm
Rear Left	205/60R16	96V	Kumho	Ecsta	V	3319	0 mm
Rear Right	205/60R16	92V	Lanvigator	Comfort	V	4121	0 mm
Spare	195/65R15	91V	Apollo	Manchester u	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE/ SPORADIC	U101100	SUPPLY VOLTAGE VOLTAGE TOO LOW	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got minor scratches, stone chips and dents. Discoloring on some body panels. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers





This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ16ZGM005020

strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

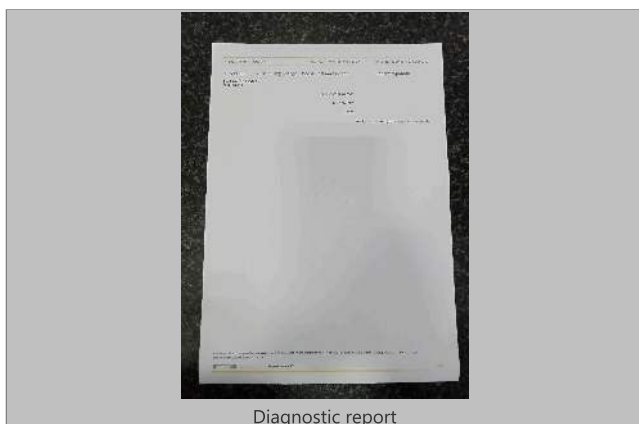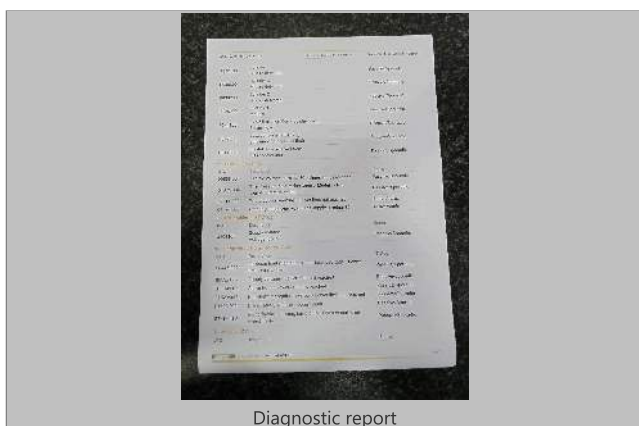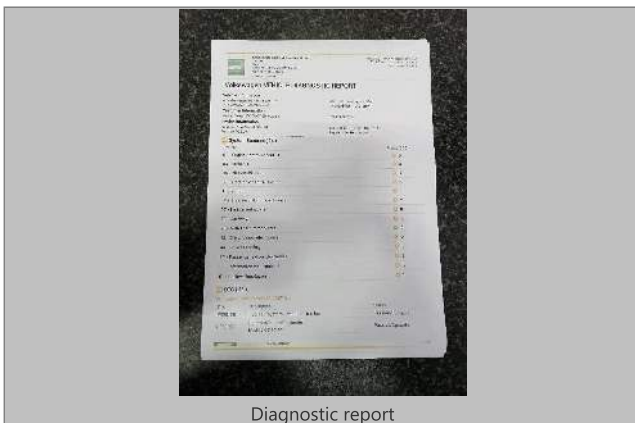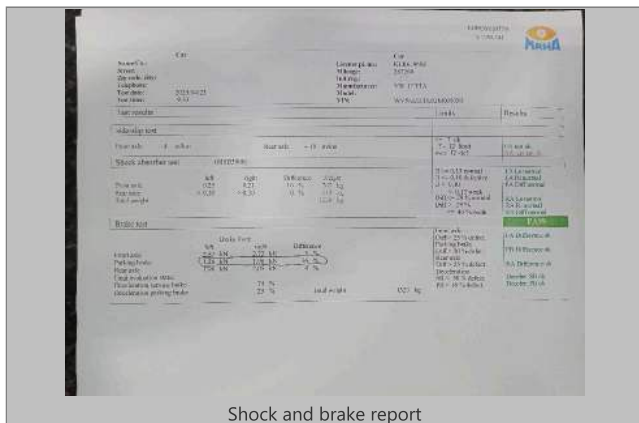



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT




90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD

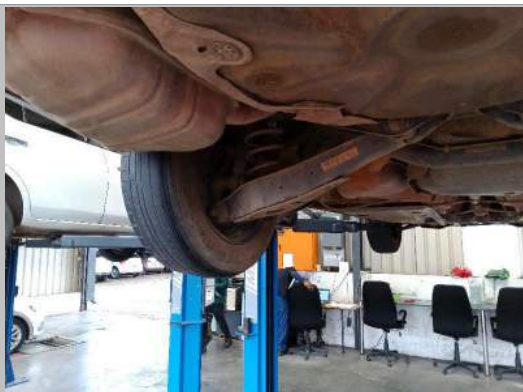

LR TYRE TREAD

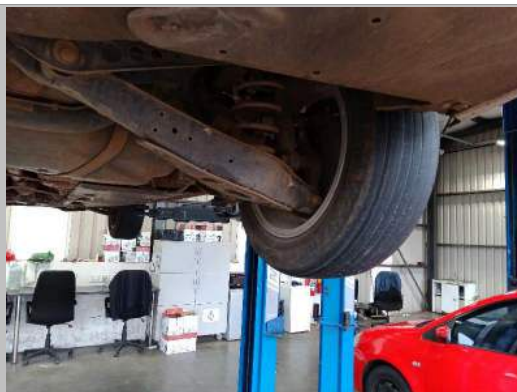

RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Expansion bottle



Oil cap and dipstick



Spare Tyre



Water level



Bonnet



Wiper Switch



Side Mirror Left




Side Mirror Right

Test results	
side-slip test	Front axle: < 4 m/km
Shock absorber test	Rear axle: + 19 mm/km
	(ASD3000)
Brake test	Weight 787 kg
	Distance 16 %
	Front axle: 0.25
	Rear axle: > 0.30
	Total weight: 1329 kg
	Brake force
	Left: 1.87 kN
	Right: 2.79 kN
	Difference: 0.92 kN
	Front axle: 1.26 kN
	Rear axle: 1.96 kN
	Brake test: 2.05 kN
	Front evaluation static: 1.96 kN
	Deceleration service brake: 74 %
	Electron parking brake: 25 %
	Total weight: 1329 kg

Parking Brake Performance



Door Rear Right

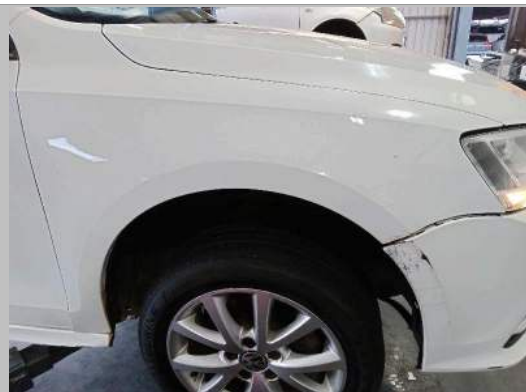

Front Fender Right



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Rear bumper



Tyre Rear Left



Tyre Rear Right



Tyre Front Right



CV Joint(s) Boot(s) Front Left (inner/outer)



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ16ZGM005020