



CONDITION REPORT



Report No:
2017290740
DATE
27/08/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/08/2026		M57 Pretoria Road - 1619
Inspection Date	27/08/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LHK687MP
Model	GOLF 6 1.4 TSI COMFORTLINE 5-DR DSG [2012-2013]	Register Number	
		Date Of First Licensing	
VIN	WWWZZZ1KZDW111059	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	RED	Paint Finish	M - METALLIC
Year Model	2012	Fuel	PETROL
Km Reading	198,884 KM	Transmission	AUTOMATIC
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWWZZZ1KZDW111059



CONDITION REPORT



Report No:

2017290740

DATE

27/08/2026



Damage	Repair Way
Engine Oil Leak	Repair
Water level Insufficient	Repair
Bonnet stay and shocks Defective	Repair
Switch Electrical Window Winder front left Defective	Repair
Switch Electrical Window Winder rear left Defective	Repair
Side Mirror Right Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Dull	Repair
Front Fender Right Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Flaking	Repair
Door Front Right Paintwork • Scratched	Repair
Shock Absorber Rear Right Sweat	Repair
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Gearbox Oil Leak	Repair
Body exterior	Signs of spray work done on body panels
Body exterior	Minor dents scratches stone chips on body panels
Warning lights illuminated	Repair
Undercarriage	Is fully covered

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	3.9	-	
Rear	2.2	2.2	-	
Emergency / Parking	1.8	2.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Royal black	Mile	V	4623	3 mm
Front Right	205/55R16	91V	Royal black	Mile	V	4623	1 mm
Rear Left	205/55R16	91V	Royal	Mile		4623	5 mm
Rear Right	205/55R16	91V	Royal black	Mile	V	4623	5 mm
Spare	205/60R16	92V	Hankook	Kinergy	V	///////	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: VVWZZZ1KZDW111059



CONDITION REPORT



Report No:
2017290740
DATE
27/08/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	GATEWAY	01332:004	FRONT PASSENGER DOOR CONTROL MODULE - NO	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZ1KZDW111059



CONDITION REPORT



Report No:
2017290740
DATE
27/08/2026



Automatic transmission




Warning lights illuminated



Sparewheel



Electric mirror knob damaged

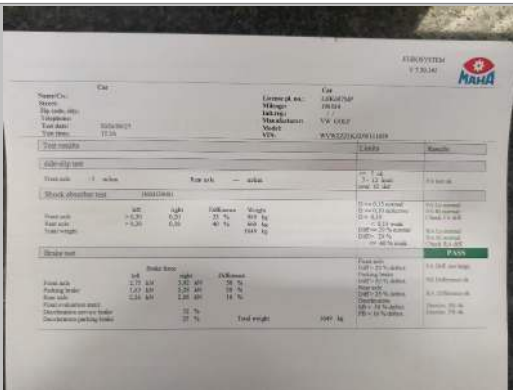

Shock and brake report



Diagnostics report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZ1KZDW111059



CONDITION REPORT



Report No:

2017290740

DATE

27/08/2026



Diagnostics report



Expansion bottle



Oil cap and dipstick



Warning lights illuminated



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZ1KZDW111059



CONDITION REPORT



Report No:

2017290740

DATE

27/08/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)




ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT

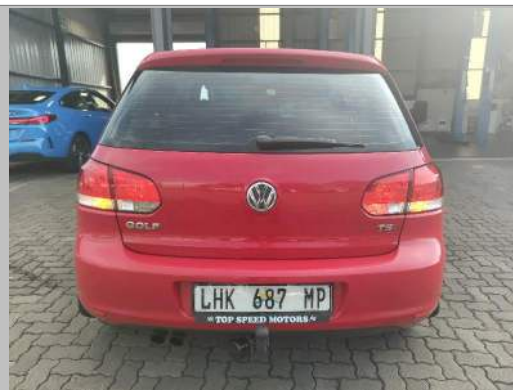

90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ1KZDW111059



CONDITION REPORT



Report No:
2017290740
DATE
27/08/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ1KZDW111059



CONDITION REPORT



Report No:

2017290740

DATE

27/08/2026



VIN PLATE OR STICKER



REAR



CHASSIS



ENGINE 2



ENGINE 1



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ1KZDW111059



CONDITION REPORT



Report No:


2017290740

DATE

27/08/2026



Switch Electrical Window Winder rear left

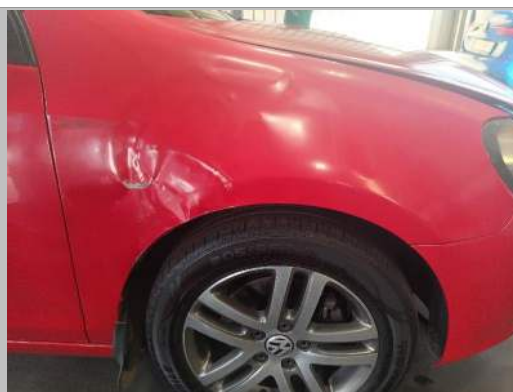

Front Fender Right



Door Front Right



Side Mirror Right



Rear Fender Right



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZ1KZDW111059



CONDITION REPORT



Report No:
2017290740
DATE
27/08/2026



Bonnet



Bonnet stay and shocks



Switch Electrical Window Winder front left



Switch Electrical Window Winder rear left



Stabilizer Mounting Front Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ1KZDW111059



CONDITION REPORT




Report No:
2017290740
DATE
27/08/2026



Stabilizer Mounting Front Left



Control Arm Bush(es) Front Axle Left

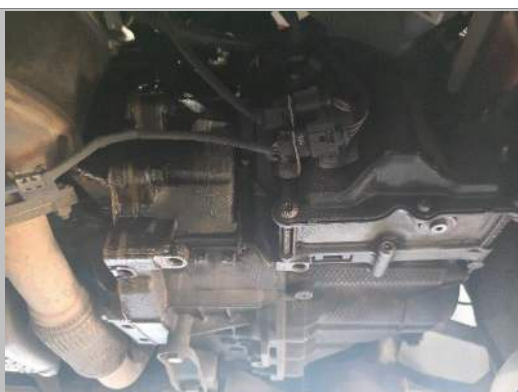

Gearbox



Gearbox



Gearbox



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ1KZDW111059



CONDITION REPORT



Report No:

2017290740

DATE

27/08/2026



Engine



Engine



Shock Absorber Rear Right



Water level



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ1KZDW111059