



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/08/2024		M57 Pretoria Road - 1619
Inspection Date	13/08/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	HC50ZLGP
Model	POLO	Register Number	
VIN	WVWZZZ60ZJT063252	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	13/08/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	201,985 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION



Damage	Repair Way
Caps Missing	Replace
Radiator Damaged	Replace
Bonnet stay and shocks Missing	Replace
Heater control Defective	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Switch Electrical Window Winder front right Malfunction	Repair
Indicator Light Front Right Malfunction	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Belt Front Left Missing	Replace
Seat Belt Front Right Dirty	Replace
Door Panel Front Right Defective	Repair
Carpet Rear Dirty	Repair
Boot Panel Right Missing	Replace
Mirror Adjusters Damaged	Repair
Side Mirror Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Discoloured	Repair
A • Pillar Left Paintwork • Discoloured	Repair
A • Pillar Right Paintwork • Flaking	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Cracked	Repair
Rear Fender Left Cracked	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Cracked	Repair
Door Front Right Dented	Repair
Door Rear Left Cracked	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Discoloured	Repair



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

Damage	Repair Way
Rear bumper Paintwork • Scratched	Repair
Roof Paintwork • Discoloured	Repair
Service Brake Performance Front Axle Left / Right	Repair
Difference out of legal range	Replace
Radiator Cradle Missing	Replace
Both left side safety handle missing	Replace
Antenna missing	Replace
L/R inner seat panel missing	Replace
Both front fender liner missing	Replace
Steering noisy	Repair

Brakes**Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	2.0	3.3	-	-
Rear	2.0	2.0	-	-
Emergency / Parking	1.5	1.8	-	-

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88T	Firestone	T series	V	0000	4 mm
Front Right	185/70R14	88T	Firestone	T series	V	0000	4 mm
Rear Left	185/70R14	88T	Firestone	T series	V	0000	4 mm
Rear Right	175/70R14	84H	Autogrip	Grip200	V	4622	2 mm
Spare	185/70R14	88T	Firestone	T series	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

No	System	Code	Description	Status
1	PASSIVE/SPORADIC	B102800	FRONT CRASH DATA STORED	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got some scratches, stone chips and dents. Signs of spray work done on some body panels. Signs of repair work done on some body panels. Discoloring on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksdorp, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: WWWW7Z697T062352

Report No. 2018489888

2 / 14

DATE

13/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016489888


VIN: WVWZZZ60ZJT063252

DATE


13/08/2024

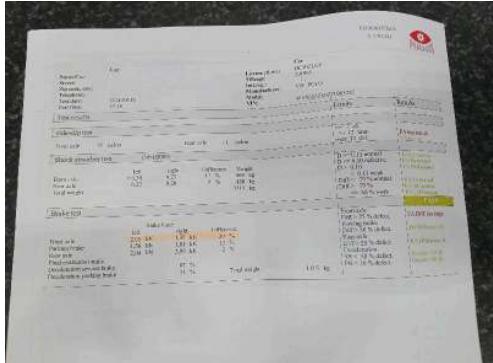


Shock and brake report

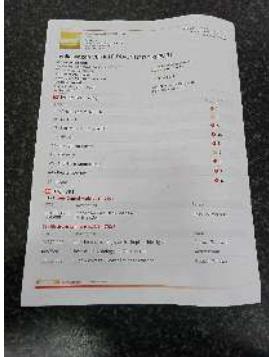

Diagnostic report

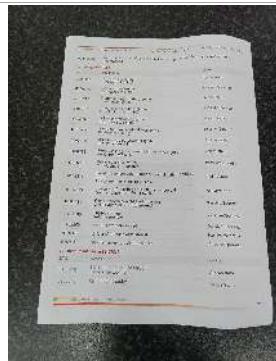

Diagnostic report

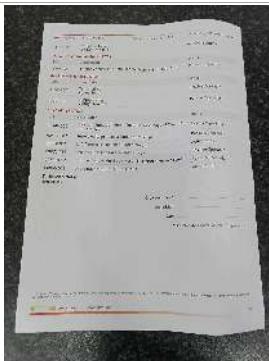

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016489888

DATE

VIN: VVWZZZ60ZJT063252

13/08/2024

4 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016489888

DATE

13/08/2024

VIN: WWWZZZ60ZJT063252

5 / 14



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

VIN: WVWZZZ60ZJT063252

6 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

VIN: WVWZZZ60ZJT063252

8 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

Spare wheel




VIN: WZZZ60ZJT063252

9 / 14

LICENSE DISC



VIN PLATE OR STICKER

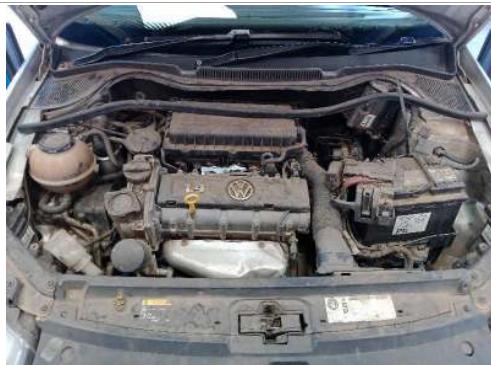

ENGINE 1



ENGINE 2



CHASSIS



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

VIN: WVWZZZ60ZJT063252

10 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

L/R inner seat panel missing



Expansion bottle



Battery loose




Oil cap and dipstick

side-slip test		steer angle				
Front axle	-> 19 °/km	Rear axle	-> 1 °/km			
Shock absorber test (MSD3000)						
Front axle						
Front axle	left: > 0,30	right: 0,25	Difference: 17 %			
Front axle	0,22	0,20	9 %			
Total weight	665 kg					
Brake test						
Brake force						
Front axle	left: 2,05 kN	right: 3,35 kN	Difference: 39 %			
Parking brake	1,56 kN	1,81 kN	13 %			
Rear axle	2,04 kN	2,09 kN	2 %			
Final evaluation static	87 %					
Deceleration service brake	31 %					
Deceleration parking brake	Total weight					

Service Brake Performance Front Axle



Water level

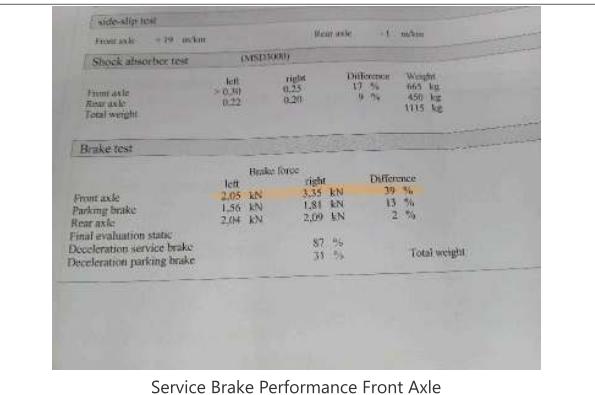



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

VIN: WVWZZZ60ZJT063252

12 / 14



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

Caps



Headlight Left

VIN: WVWZZZ60ZJT063252
13 / 14

Headlight Right



Bonnet stay and shocks



Bonnet



Roof



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

VIN: VVWZZZ60ZJT063252

14 / 14



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

Seat Belt Front Left



Seat Belt Front Right



Carpet Rear



Door Panel Front Right



Heater control



Center Console / Cubbyhole + Lid



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

Switch Electrical Window Winder front right



Mirror Adjusters



Boot Panel Right



Boot Lid / Hatch door



Side Mirror Right



A • Pillar Right



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

Front Bumper



Front Fender Left



A • Pillar Left



Door Front Left



Door Rear Left



Rear Fender Left



CONDITION REPORT

Report No: 2016489888

DATE
13/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016489888

DATE
13/08/2024


Rear bumper



Rear bumper

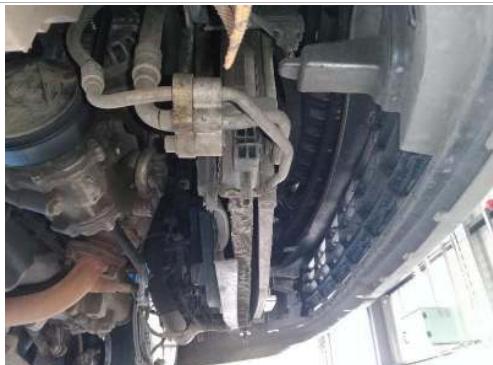

Radiator Cradle

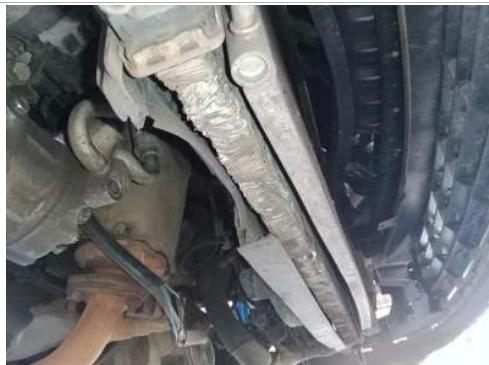

Radiator



Indicator Light Front Right



**CONDITION REPORT**

Report No: 2016489888

DATE
13/08/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za