



CONDITION REPORT



Report No:
2017302493
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	MT44KPGP
Model	POLO SEDAN 1.6 COMFORTLINE [2019-2021]	Register Number	
VIN	WVWZZZ60ZLT072578	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2020	Paint Finish	C - COMMON
Km Reading	197,021 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZ60ZLT072578



CONDITION REPORT



Report No:

2017302493

DATE

23/09/2026

Damage

Repair Way

Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Chipmarks	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Front tires deferred name brand	Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	2.6	-	
Rear	2.9	3.1	-	
Emergency / Parking	0.8	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Firestone	Touring	V	3422	3 mm
Front Right	185/60R15	84H	Anchee	Ac808	V	4225	3 mm
Rear Left	185/60R15	84H	Continental	Contact	V	2723	3 mm
Rear Right	185/60R15	84H	Continental	Contact	V	4024	3 mm
Spare	175/70R14	84T	Apollo	Alnac	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVWZZZ60ZLT072578



CONDITION REPORT



Report No:
2017302493
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE SPORADIC	28823:000	LOST COMMUNICATION WITH RESTRAINTS CONTROL MODULE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZ60ZLT072578



CONDITION REPORT



Report No:

2017302493

DATE

23/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: VVVZZZ60ZLT072578



CONDITION REPORT



Report No:

2017302493

DATE

23/09/2026



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ60ZLT072578



CONDITION REPORT



Report No:


2017302493

DATE

23/09/2026



LR TYRE TREAD

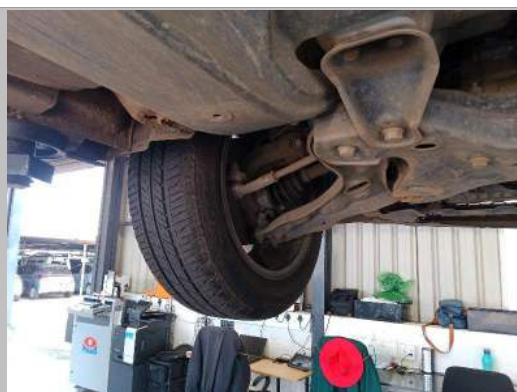

LF TYRE TREAD



Spare wheel



Expansion bottle



Oil cap and dipstick



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZ60ZLT072578



CONDITION REPORT



Report No:
2017302493
DATE
23/09/2026



ENGINE 2




CHASSIS



VIN PLATE OR STICKER



LICENSE DISC

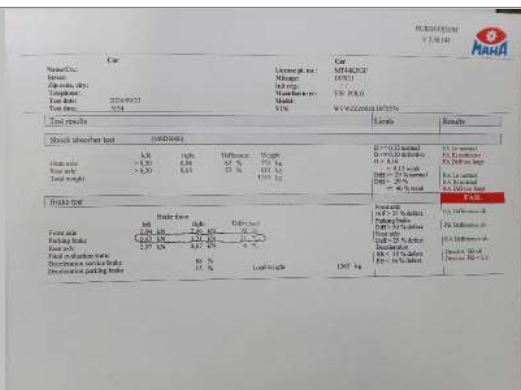

Shock and brake report



DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZLT072578



CONDITION REPORT



Report No:


2017302493

DATE

23/09/2026



DIAGNOSTIC REPORT PAGE 2

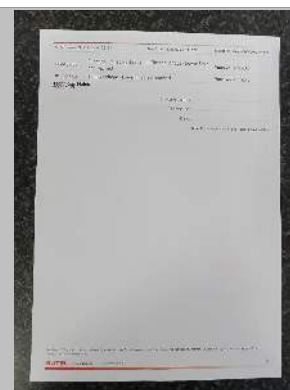

DIAGNOSTIC REPORT PAGE 3

Car				Car	
Name/Cn:				License pl. no.:	MT446PGP
Street:				Mileage:	19702
Zip code, city:				Int.rep.:	VW POLO
Telephone:				Manufacturer:	VW POLO
Test date:	2026/09/23			Model:	
Test time:	9:54			VIN:	WVWZZZ60ZLT072578
Test results					
Shock absorber test				(MSD/000)	
				Limits	
Front axle	left	right	Difference	Weight	D = 0.15 normal
Rear axle	> 0.10	0.04	17 %	355 kg	D = 0.10 normal
Total weight	> 0.10	0.15	31 %	689 kg	D = 0.08
				1263 kg	D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal
					D = 0.10 normal
					D = 0.13 normal



CONDITION REPORT



Report No:

2017302493

DATE

23/09/2026



Rear bumper




Rear bumper



Door Rear Left



Door Front Left

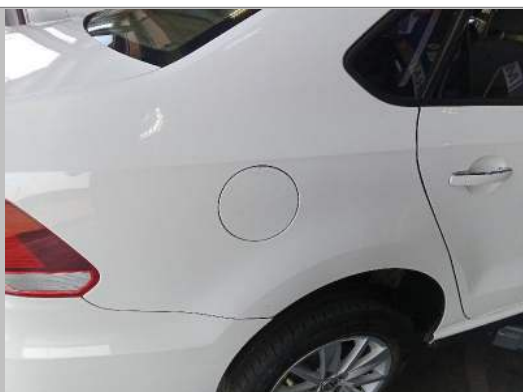

Rear Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZ60ZLT072578



CONDITION REPORT



Report No:
2017302493
DATE
23/09/2026



Door Front Right



Front Fender Right



Front Bumper



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZ60ZLT072578