

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/05/2025		M57 Pretoria Road - 1619
Inspection Date	27/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	JR20CZGP
Model	GOLF 7 2.0 TSI GTI PERFORMANCE PACK 5-DR DSG [2015-2017]	Register Number	
VIN	WVWZZZAUZGW054867	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2022
Color	WHITE	Power / Displacement	
Year Model	2016	Paint Finish	C - COMMON
Km Reading	299,129 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Hoses Oil Leak	Repair
Water level Insufficient	Repair
Air conditioner pump Damaged	Replace
Bonnet stay and shocks Insufficient	Replace
Switch Electrical Window Winder rear left Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Door Sealing Rubber Front Right Torn / Cut	Replace
Carpet Front Torn / Cut	Repair
Side Mirror Left Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Left Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Fuel Flap Damaged	Repair
Windscreen Cracked	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVWZZZAUZGW054867

Damage	Repair Way
Stabilizer Mounting Rear Right Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Right Smooth	Replace
Rim Rear Left Damaged	Repair
Rim Rear Right Welded	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Belly plates Damaged	Replace
Gearbox Oil Leak	Repair
Alternator belt missing	Replace
Vehicle electronics malfunction	Repair
Boot does not open, electric malfunction	Repair
Vehicle push into Dekra parking	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.8	3.9	-	
Rear	1.8	2.0	-	
Emergency / Parking	1	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/35R19	91Y	Sailun	Atrezzo	V	2821	1 mm
Front Right	235/35R19	91W	Davanti	DX640	V	1924	5 mm
Rear Left	235/35R19	91Y	Pirelli	Pzero	V	2221	2 mm
Rear Right	235/35R19	91W	Rapid	P609	V	3422	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P029900	TURBOCHARGER SUPERCHARGER UNDERBOOST	
2	ELECTRONIC CENTRAL ELECTRIC	U101100	SUPPLY VOLTAGE VOLTAGE TOO LOW	

Inspection Conditions

No Test Drive
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body panels. Residual traces of repair work done on some body panels. Axle and Suspension: Both front control arm bushes covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Trevino Julius


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

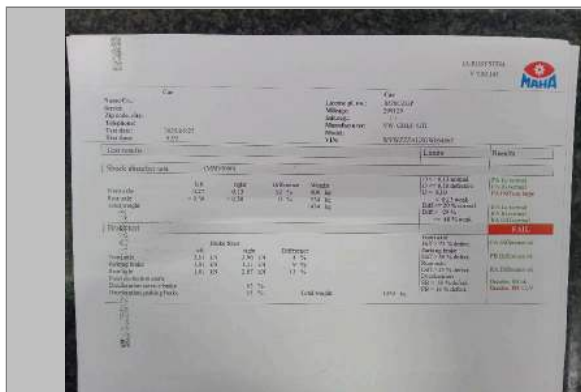


Shock and brake report

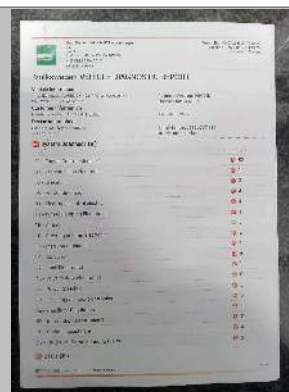


Diagnostic test

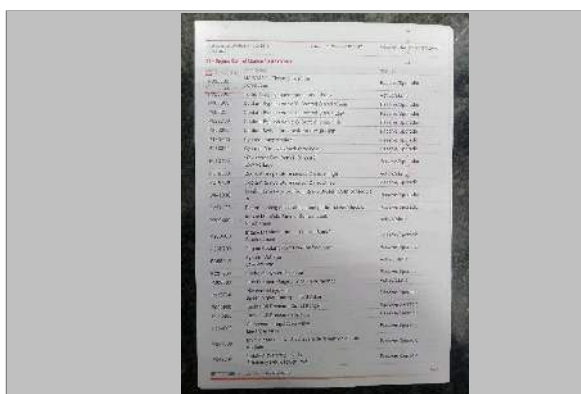


Diagnostic test results

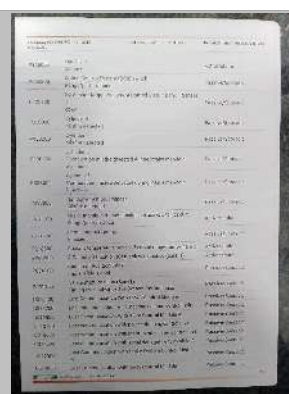

Diagnostic test

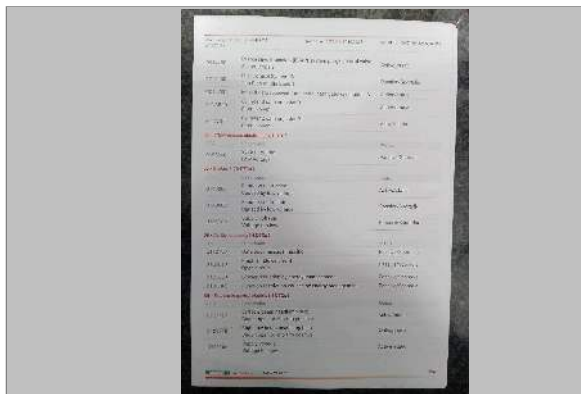


Diagnostic test

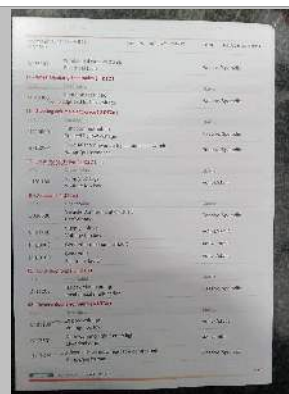

Diagnostic test



Diagnostic test

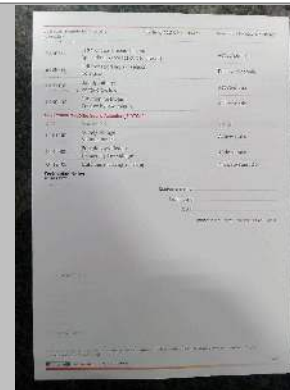

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CHASSIS



Rear end



Warning lights illuminated



Expansion bottle




Oil cap and dipstick



ENGINE 2



Windscreen

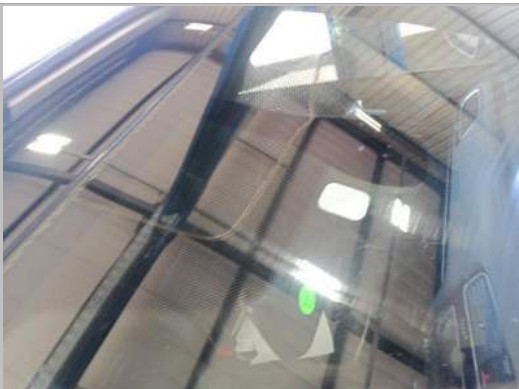

Windscreen



Side Mirror Right



Seat Front Right



Fuel Flap



Rear Fender Left



Switch Electrical Window Winder rear left



Door Rear Left



Seat Front Left



Side Mirror Left



Side Mirror Left



Windscreen



Door Front Left



Side Mirror Right



Bonnet stay and shocks



Air conditioner pump



Hoses



Hoses



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Bolt(s) / Nut(s) Rear Wheel Left



Bolt(s) / Nut(s) Rear Wheel Right



Hoses



Gearbox



Hoses



Engine



Engine



Engine



Engine



Belly plates



Gearbox



Tyre Front Right



Rim Rear Left



Tyre Rear Right



Rim Rear Right



Stabilizer Mounting Rear Right



Water level



Door Sealing Rubber Front Right



Door Sealing Rubber Front Right



Carpet Front



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZGW054867