

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/03/2025		M57 Pretoria Road - 1619
Inspection Date	13/03/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	NO REG
Model	GOLF 7 2.0 TSI GTI 5-DR DSG [2016-2017]	Register Number	
VIN	WWWZZZAUZH017431	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2025
Color	GREY	Power / Displacement	
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	152,330 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Bonnet cable Damaged	Repair
Wiring connections Defective	Replace
Seat Rear Torn / Cut	Repair
Front Bumper Damaged	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Right Dented	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Rear Left Excessive Wear & Tear	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Gear Selections Insufficient	Repair
Rear tyre size differs	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZAUZH017431

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.8	-	
Rear	1.9	1.5	-	
Emergency / Parking	0.6	0.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R18	92W	Royal black	Royal	V	4021	2 mm
Front Right	225/40R18	92W	Royal black	Royal	V	1822	1 mm
Rear Left	225/40R18	92W	Dunlop	Sport	V	2617	1 mm
Rear Right	T125/70R18	99M	Continental	Contact	V	3522	5 mm
Spare	225/40R18	92W	Three	P609	V	/////	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL MODULE	P164E00	OIL PRESSURE REGULATION VALVE ELECTRICAL ERROR	

Inspection Conditions

No Test Drive
Rain at time of inspection
Vehicle doesn't start
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of repair work done on some body panels. Signs of spray work done on some body panels. Undercarriage: Undercarriage is covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Trevino Julius


This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

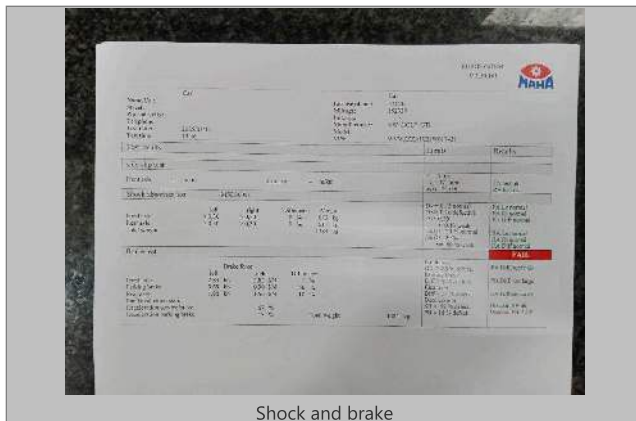


Shock and brake

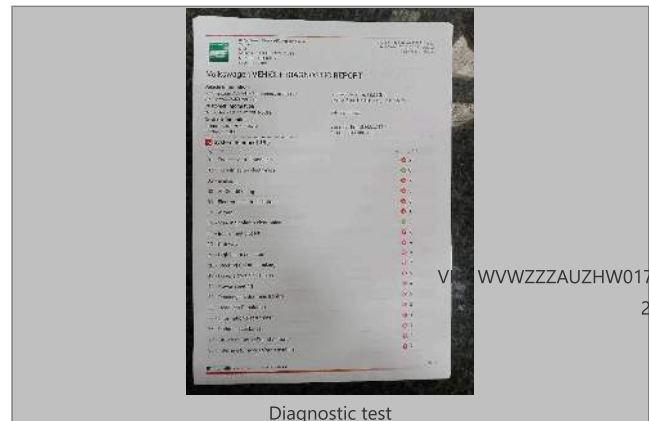


Diagnostic test

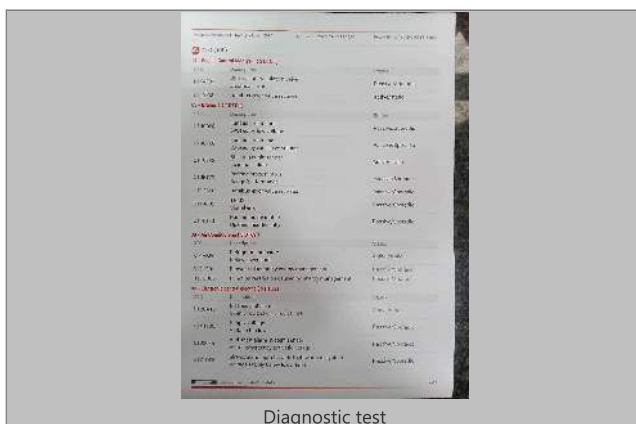


Diagnostic test

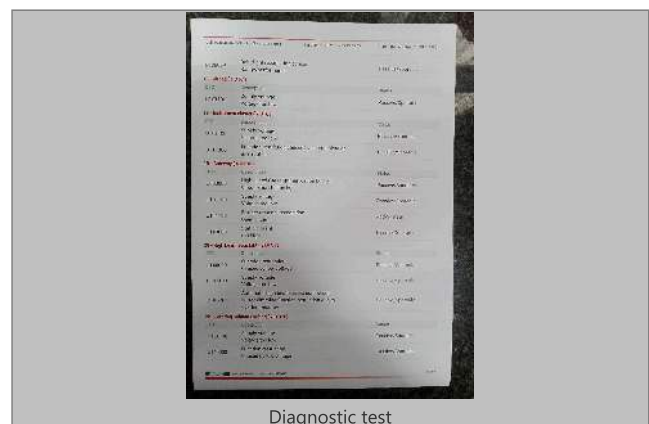

Diagnostic test

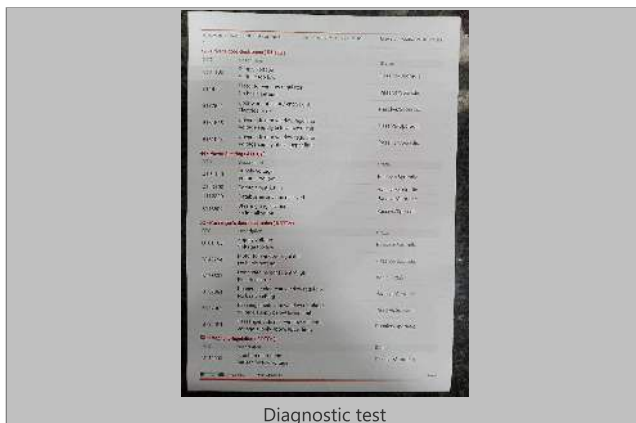


Diagnostic test

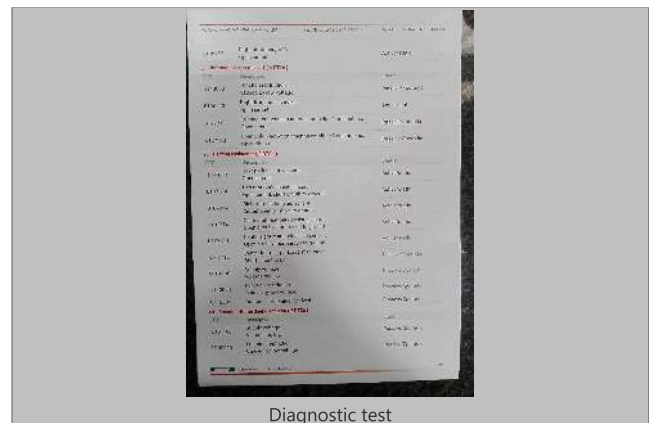

Diagnostic test

VIN: WWZZZAUZH017431

3 / 12

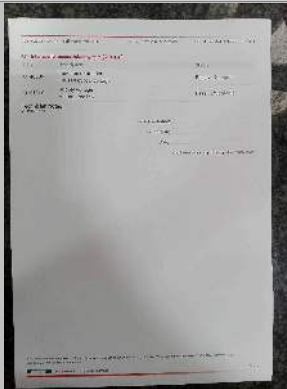

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

VIN: WWZZZAUZH017431

5 / 12



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

VIN: WVVZZZAUZHWO17431

6 / 12



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER

VIN: WWZZZAUZHW017431

8 / 12



ENGINE 1



ENGINE 2

VIN: WVVZZZAUZH017431
9 / 12

CHASSIS



Rear end



Oil cap and dipstick



Expansion bottle

VIN: WWZZZAUZH017431

10 / 12



Warning lights illuminated



Bonnet cable



Door Front Right



Door Rear Right

VIN: WVVZZZAUZH017431

11 / 12



Rear Fender Right




Bonnet cable

VIN: WWZZZAUZH017431

12 / 12



Water level

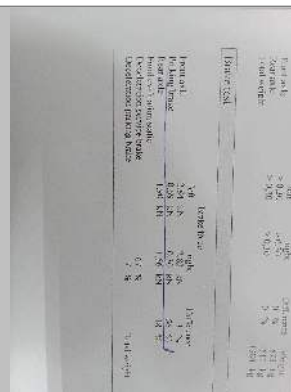

Parking Brake Performance



Bolt(s) / Nut(s) Front Wheel Right



Front Bumper



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Bolt(s) / Nut(s) Rear Wheel Right




Tyre Rear Left



Wiring connections



Seat Rear

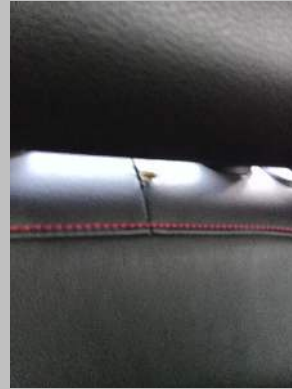

Seat Rear



Boot Lid / Hatch door



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear Fender Left



CONDITION REPORT

Report No: 2016800274

DATE
13/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za