



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	24/07/2025		M57 Pretoria Road - 1619
Inspection Date	24/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KZM034NW
Model	GOLF 7 1.0 TSI TRENDLINE BLUEMOTION 81KW 5-DR [2017-2019]	Register Number	
		Date Of First Licensing	
VIN	WVWZZZAUZJP126606	Last COR	
Engine Number		License Expiry Date	31/12/2025
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2018	Fuel	PETROL
Km Reading	264,736 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVWZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025

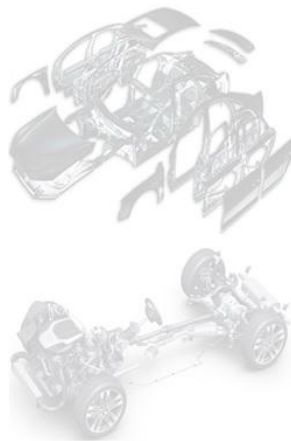

Damage	Repair Way
Engine Oil Leak	Repair
Caps Missing	Replace
Headlight Left Defective	Repair
Headlight Right Damaged	Replace
Seat Front Right Damaged	Repair
Front Bumper Damaged	Replace
Bonnet Residual Traces of Repair	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Dented	Repair
Front Fender Left / Inner Tray Damaged	Replace
Front Fender Right / Inner Tray Damaged	Replace
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Windscreen Chipped	Repair
Wheel Cylinder / Caliper 2. Axle left Defective	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Spare Tyre Damaged	Replace
Rim Spare Wheel Damaged	Replace
Chassis Dented	Repair
Fuel Tank Defective	Repair
Warning lights illuminated on dashboard	Repair
Interior	Vehicle interior dirty and some panels scratched
Lights	Hazard light switch defective
Undercarriage	Excessive oil leak on engine splash plate
Undercarriage	Bottom of engine and gearbox fully covered
Undercarriage	Cannot pin direction of oil leak
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Some body panels misaligned

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.11	3.16	-	
Rear	2.11	2.36	-	
Emergency / Parking	0.73	0.88	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65 R15	91H	Continental	Contipremuim	V	3321	2 mm
Front Right	195/65 R15	91H	Autogrip	Radial	V	0225	5 mm
Rear Left	195/65 R15	91H	Autogrip	Radial	V	0225	6 mm
Rear Right	195/65 R15	91H	Autogrip	Radial	V	0225	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P06E900	ENGINE STARTER PERFORMANCE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025

[illegible]

Brake and shock absorber report

AUTUMN		WINTER		
WATERBURY VERMONT STATE COLLEGE Waterbury, Vermont 1960-1961 1961-1962 1962-1963 1963-1964 1964-1965 1965-1966 1966-1967 1967-1968 1968-1969 1969-1970 1970-1971 1971-1972 1972-1973 1973-1974 1974-1975 1975-1976 1976-1977 1977-1978 1978-1979 1979-1980 1980-1981 1981-1982 1982-1983 1983-1984 1984-1985 1985-1986 1986-1987 1987-1988 1988-1989 1989-1990 1990-1991 1991-1992 1992-1993 1993-1994 1994-1995 1995-1996 1996-1997 1997-1998 1998-1999 1999-2000 2000-2001 2001-2002 2002-2003 2003-2004 2004-2005 2005-2006 2006-2007 2007-2008 2008-2009 2009-2010 2010-2011 2011-2012 2012-2013 2013-2014 2014-2015 2015-2016 2016-2017 2017-2018 2018-2019 2019-2020 2020-2021 2021-2022 2022-2023 2023-2024 2024-2025 2025-2026 2026-2027 2027-2028 2028-2029 2029-2030 2030-2031 2031-2032 2032-2033 2033-2034 2034-2035 2035-2036 2036-2037 2037-2038 2038-2039 2039-2040 2040-2041 2041-2042 2042-2043 2043-2044 2044-2045 2045-2046 2046-2047 2047-2048 2048-2049 2049-2050 2050-2051 2051-2052 2052-2053 2053-2054 2054-2055 2055-2056 2056-2057 2057-2058 2058-2059 2059-2060 2060-2061 2061-2062 2062-2063 2063-2064 2064-2065 2065-2066 2066-2067 2067-2068 2068-2069 2069-2070 2070-2071 2071-2072 2072-2073 2073-2074 2074-2075 2075-2076 2076-2077 2077-2078 2078-2079 2079-2080 2080-2081 2081-2082 2082-2083 2083-2084 2084-2085 2085-2086 2086-2087 2087-2088 2088-2089 2089-2090 2090-2091 2091-2092 2092-2093 2093-2094 2094-2095 2095-2096 2096-2097 2097-2098 2098-2099 2099-2100 2100-2101 2101-2102 2102-2103 2103-2104 2104-2105 2105-2106 2106-2107 2107-2108 2108-2109 2109-2110 2110-2111 2111-2112 2112-2113 2113-2114 2114-2115 2115-2116 2116-2117 2117-2118 2118-2119 2119-2120 2120-2121 2121-2122 2122-2123 2123-2124 2124-2125 2125-2126 2126-2127 2127-2128 2128-2129 2129-2130 2130-2131 2131-2132 2132-2133 2133-2134 2134-2135 2135-2136 2136-2137 2137-2138 2138-2139 2139-2140 2140-2141 2141-2142 2142-2143 2143-2144 2144-2145 2145-2146 2146-2147 2147-2148 2148-2149 2149-2150 2150-2151 2151-2152 2152-2153 2153-2154 2154-2155 2155-2156 2156-2157 2157-2158 2158-2159 2159-2160 2160-2161 2161-2162 2162-2163 2163-2164 2164-2165 2165-2166 2166-2167 2167-2168 2168-2169 2169-2170 2170-2171 2171-2172 2172-2173 2173-2174 2174-2175 2175-2176 2176-2177 2177-2178 2178-2179 2179-2180 2180-2181 2181-2182 2182-2183 2183-2184 2184-2185 2185-2186 2186-2187 2187-2188 2188-2189 2189-2190 2190-2191 2191-2192 2192-2193 2193-2194 2194-2195 2195-2196 2196-2197 2197-2198 2198-2199 2199-2200 2200-2201 2201-2202 2202-2203 2203-2204 2204-2205 2205-2206 2206-2207 2207-2208 2208-2209 2209-2210 2210-2211 2211-2212 2212-2213 2213-2214 2214-2215 2215-2216 2216-2217 2217-2218 2218-2219 2219-2220 2220-2221 2221-2222 2222-2223 2223-2224 2224-2225 2225-2226 2226-2227 2227-2228 2228-2229 2229-2230 2230-2231 2231-2232 2232-2233 2233-2234 2234-2235 2235-2236 2236-2237 2237-2238 2238-2239 2239-2240 2240-2241 2241-2242 2242-2243 2243-2244 2244-2245				

Diagnostic report page 1

[illegible]

Diagnostic report page 2

[illegible]

Diagnostic report page 3

[illegible]

Diagnostic report page 4

/rtdkmsapty/Gtd

Test Time: 2025-07-24 18:56:46

Report ID: MA20A76379274086644

Customer name: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

Diagnostic report page 5

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



RR TYRE TREAD




RF TYRE TREAD



Spare rim and Accessories



LICENSE DISC

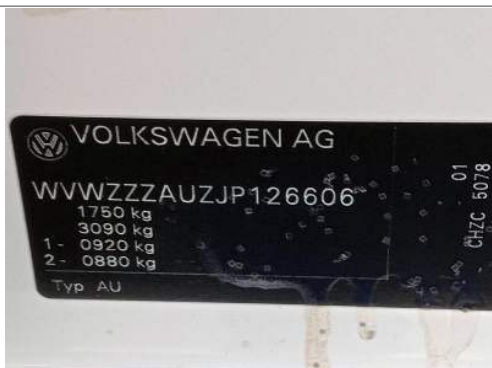

VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



Front chassis



Rear chassis



Oil cap and dipstick



Front Fender Right



Front Fender Right / Inner Tray



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



Door Rear Right



Seat Front Right



Rear bumper



Rear bumper



Boot Lid / Hatch door



Rim Spare Wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



Spare Tyre



Rear Fender Left



Door Rear Left



Door Front Left



Front Fender Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WVVZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025

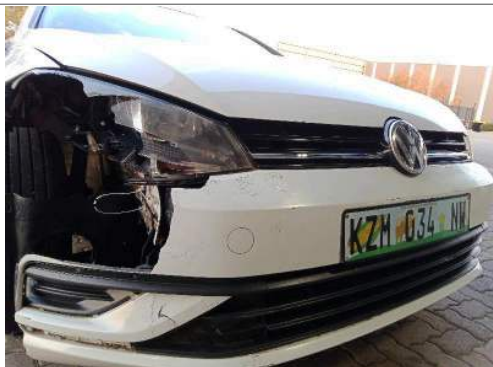


Front Bumper



Front Bumper




Bonnet

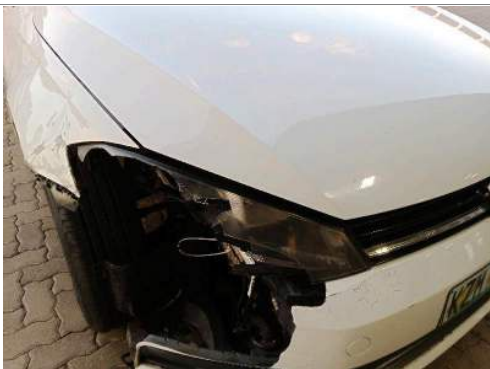

Headlight Right



Headlight Left

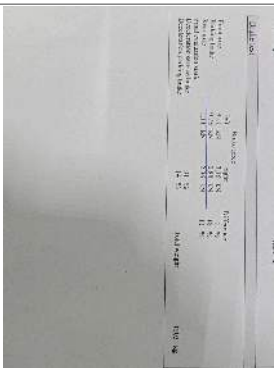

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WWWZZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



Windscreen



Water level



Caps



Water level



Sill Panel Right



Wheel Cylinder / Caliper 2. Axle left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZAUZJP126606



CONDITION REPORT



Report No:
2016957348
DATE
24/07/2025



Front Fender Left / Inner Tray



Engine



Chassis



Fuel Tank

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WVVZZZAUZJP126606