



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLVO	Registration Number	KW53KXGP
Model	S60 T5 2.0 R-DESIGN [2012-2013]	Register Number	
VIN	YV1FS47H1D2178260	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2012	Paint Finish	TWO COAT UNI
Km Reading	176,941 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026

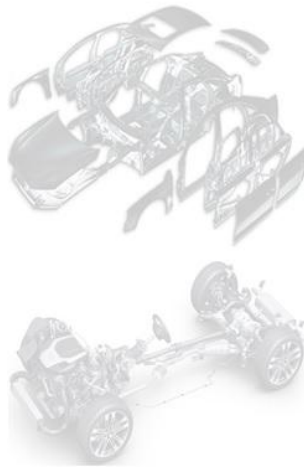

Damage	Repair Way
Engine Oil Leak	Repair
Central Air Vent Damaged	Replace
Fog Light Front Right Cracked	Replace
Headlight Left Defective	Repair
Headlight Right Defective	Repair
Seat Front Left Excessive Wear & Tear	Repair
Seat Front Right Excessive Wear & Tear	Repair
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Shock Absorber Rear Right Sweat	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Torn / Cut	Replace
Rim Front Right Welded	Repair
Rim Rear Left Scratched	Repair
Belly plates Damaged	Replace
Gearbox Oil Sweat	Repair
Fuel Lines Defective	Repair
Radiator Cradle Dented	Repair
Rear left door lock switch damaged	Replace
Warning light illuminated on dashboard	Repair
Deceleration parking brake defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.29	4.26	-	
Rear	2.04	2.32	-	
Emergency / Parking	1.13	0.87	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/50 R18	92W	Michelin	Primacy 3	V	1722	1 mm
Front Right	215/50 R18	92W	Michelin	Primacy 3	V	1722	2 mm
Rear Left	215/50 R18	92W	Michelin	Primacy 3	V	3916	0 mm
Rear Right	215/50 R18	92W	Michelin	Primacy 3	V	1722	2 mm
Spare	T125/80 R17	99M	Continental	Temporary	V	3811	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	CEM(CENTRAL ELECTRONIC MODULE)	B103C04	LEFT HEADLAMP CONTROL, GENERAL FAULT INFORMATION,S	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Rust inside expansion bottle.
Electrical Components and Instruments: Cluster cracked.
Lights: Front left and right Headlight lenses faded.
Body • Exterior: Residual traces of repair on body panels.Body panels misaligned.Stone chips and spray work on body panels.Dents and scratches on body panels.
Undercarriage: Bottom of engine and gearbox fully covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



Rear left door lock switch



Spare Wheel



Spare Wheel Accessories



Oil cap and dipstick



Diagnostic report page 3



Diagnostic report page 4

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1F547H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



Manual Transmission




Front chassis



Rear chassis

Car		Car	
Model	Volvo V40	Year	2017
Registration	2017	Engine	2.0 T4
Chassis	2017	Transmission	Manual
Color	Black	VIN	YV1F547H1D2178260
Test results		Level	Results
Side-slip test		Car	1.1 m/s²
Steering wheel test		Car	1.1 m/s²
Brake test		Car	1.1 m/s²
Shock absorber test		Car	1.1 m/s²
Weight		Car	1.1 m/s²
Fuel consumption		Car	1.1 m/s²
Emission		Car	1.1 m/s²
Safety		Car	1.1 m/s²
Tire		Car	1.1 m/s²
Light		Car	1.1 m/s²
Sound		Car	1.1 m/s²
Other		Car	1.1 m/s²

Brake and shock absorber report

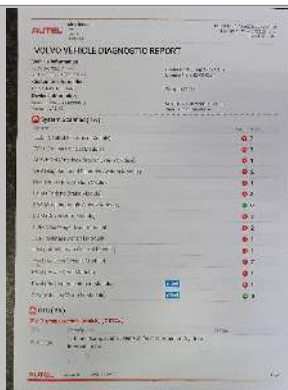

Diagnostic report page 1



Diagnostic report page 2

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1F547H1D2178260



CONDITION REPORT



Report No:

2017303120

DATE

25/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Central Air Vent



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



Door Front Right



Door Front Right



Door Rear Right



Door Rear Right



Rear Fender Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026

Xtreme 012 804 3144



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door



Rear Fender Left



Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:

2017303120

DATE

25/09/2026



Door Rear Left



Seat Front Left



Windscreen



Bonnet



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



Front Bumper



Fog Light Front Right



Front Bumper



Rim Rear Left



Tyre Rear Right



Rim Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right



Engine



Gearbox



Belly plates



Fuel Lines

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260




CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



Belly plates

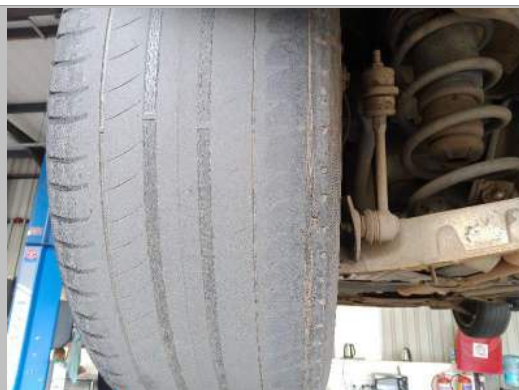

Tyre Rear Left



Shock Absorber Rear Right



Radiator Cradle



Headlight Left



Headlight Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260



CONDITION REPORT



Report No:
2017303120
DATE
25/09/2026



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: YV1FS47H1D2178260