



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LC96PZGP
Model	QUANTUM	Register Number	
VIN	AHTSS22P407146534	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2027
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	253,641 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:

2017305354

DATE

30/09/2026

Damage

Repair Way

Central Air Vent Damaged	Repair
Engine Management Lights Set	Replace
Seat Front Left Damaged	Replace
Seat Front Right Damaged	Replace
Seat Rear Damaged	Repair
Seat Rear (2. Row) Damaged	Repair
Door Panel Front Right Damaged	Replace
Window Winder front left Damaged	Replace
Window Winder front right Damaged	Replace
Carpet Rear Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
C • Pillar Left Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Replace
Door Front Left Damaged	Replace
Boot Lid / Hatch door Damaged	Repair
Sill Panel Left Damaged	Repair
Wheel Cylinder / Caliper 2. Axle right Leak	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tyre Front Left Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Sub Frame Damaged	Replace
Gearbox Oil Leak	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.64	4.61	-	
Rear	0.62	0.42	-	
Emergency / Parking	2.62	0.61	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15C	104S	Dunlop	sp	V	2921	0 mm
Front Right	195R15C	104S	Continental	Contivan	V	4723	1 mm
Rear Left	195R15C	104R	Tracmax	Radial	V	0125	0 mm
Rear Right	195R15C	104S	Continental	Contivan	V	4723	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS/VSC/TRC	C1241	LOW OR HIGH POWER SUPPLY VOLTAGE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 15 DTC'S AT TIME OF TESTING SEE DTC REPORT. Electrical Components and Instruments: vehicle electronics malfunctional. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Repair work done to vehicle below standard.
Brakes: rear brakes binding.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534




CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026

[illegible]

Brake test.

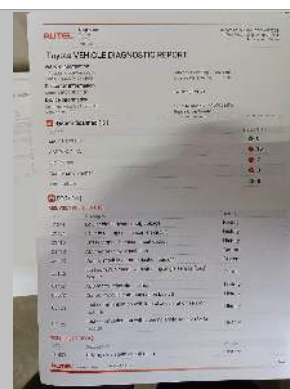

Diagnostic.

C:\Program Files\Verity		Test Time: 2024-09-30 11:20:41	Report ID: B4D8A326D99E172041
B1806	P squib circuit open		History
Continuation master (3 DTCs)			
DTC	Description		Status
U0100	Lost communication with ECM/PCM/VEH A*		History
U0129	Lost communication with brake system control module		History
U0151	Lost communication with restraints control module		History
Technician Notes 3017302534			
Customer name: _____			
Technician: _____			
Date: _____			
Note: Please save a copy of this report for your records.			

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT




Report No:
2017305354
DATE
30/09/2026




90 DEGREE LEFT



LF TYRE TREAD

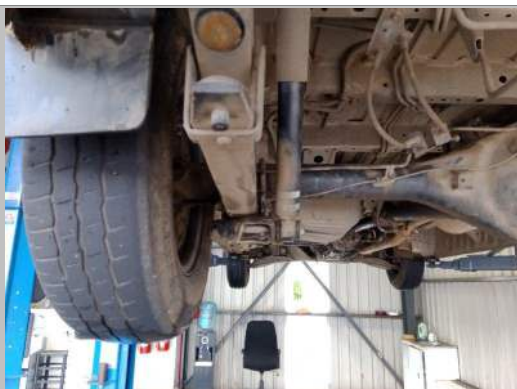

LR TYRE TREAD

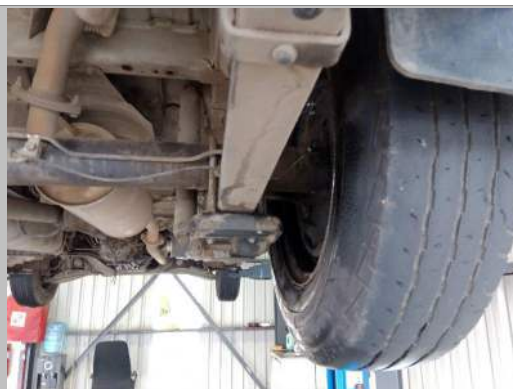

RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026



Front Bumper



Front Bumper



Bonnet



Door Front Left



Door Front Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026



Sill Panel Left



Rear Fender Left



C • Pillar Left



Boot Lid / Hatch door



Rear Fender Right



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026




Window Winder front right



Door Panel Front Right



Window Winder front left

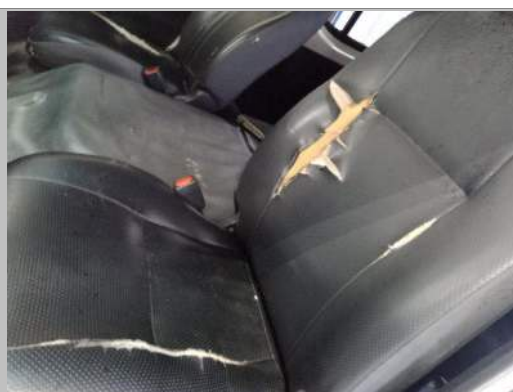

Seat Front Left



Seat Rear



Seat Rear (2. Row)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:

2017305354

DATE

30/09/2026



Seat Rear (2. Row)



Carpet Rear



Carpet Rear



Tyre Rear Left



Tyre Rear Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534



CONDITION REPORT



Report No:
2017305354
DATE
30/09/2026



Gearbox



Sub Frame



Wheel Cylinder / Caliper 2. Axle right



Central Air Vent

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P407146534