



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/09/2026		M57 Pretoria Road - 1619
Inspection Date	30/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	MINI BUS	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	KF03HPGP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2020-2022]	Register Number	
VIN	AHTSS22P807125380	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	C - COMMON
Km Reading	512,760 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026

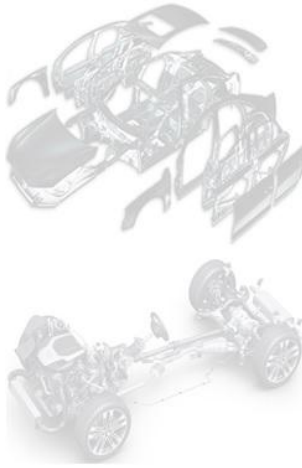

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Hoses Oil Sweat	Repair
Bonnet stay and shocks Missing	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Tail Light Right Damaged	Replace
Seat Rear Torn / Cut	Repair
Seat Rear (2. Row) Torn / Cut	Repair
Hood Lining Excessive Wear & Tear	Repair
Side Mirror Left Broken	Replace
Grill Damaged	Replace
Bonnet Paintwork • Scratched	Repair
B • Pillar Left Damaged	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Sliding Door Paintwork • Scratched	Repair
Roof Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	Repair
Steering Rack Boot Right Leak	Repair
Hydraulics System Leak	Repair
Stabilizer Mounting Front Right Damaged	Replace
Alignment Left / Right Difference out of legal range	Repair
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Tyre Rear Left Smooth	Replace
Tyre Rear Right Smooth	Replace
Spare Tyre Torn / Cut	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Sub Frame Deformed	Repair
Gearbox Oil Leak	Repair
Clutch Operation Incorrect	Repair
Vehicle idling while testing	Battery
Warning lights illuminated	Repair
Front suspension excessive knocking noise	Repair
Front tyres size differs	Replace
Rear tyres size differs	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.5	3.0	-	
Rear	1.9	3.5	-	
Emergency / Parking	0.6	0.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/70R15	104/102R	Continental	Contact	V		0 mm
Front Right	195R15	106/104S	Dunlop	SP	V		0 mm
Rear Left	195R15	106/104S	Bridgestone	Steel		0514	0 mm
Rear Right	195/70R15	104/102R	Continental	Contact	V	0721	0 mm
Spare	205/65R15	94H	Dunlop	Sport	V	0000	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C0200	RIGHT FRONT SPEED SENSOR CIRCUIT	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



No license disc



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Oil cap and dipstick



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026

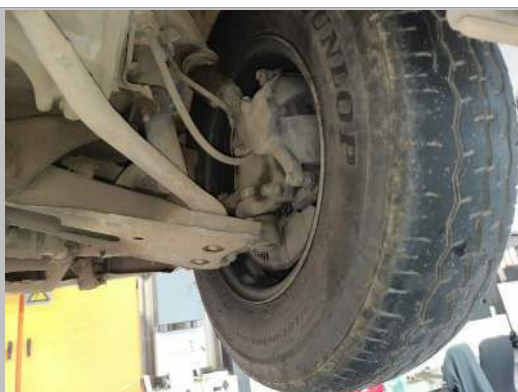

RF TYRE TREAD



LF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD



Sparewheel

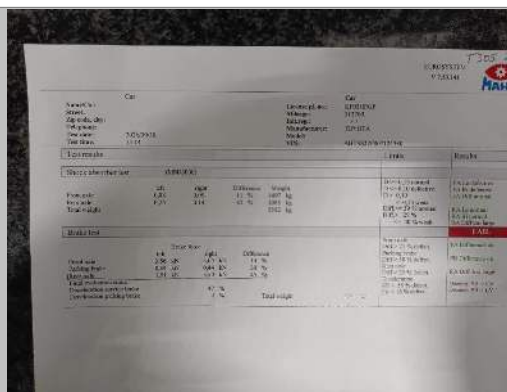

Shock and brake

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P807125380




CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026

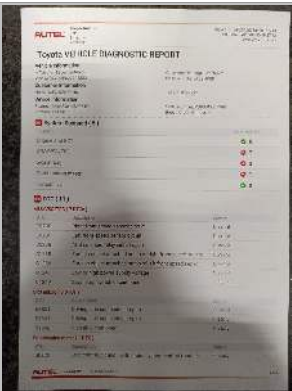

Diagnostic Report page 1

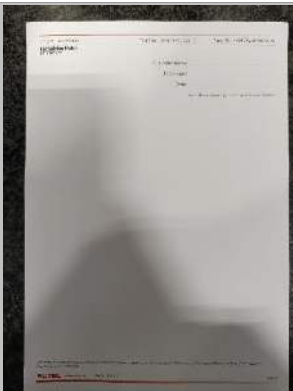

Diagnostic Report page 2



Warning lights illuminated

Brake test			
Total weight			
0.14	42 %	2	
Service Brake Performance Rear Axle			
Brake force			
Difference			
Front axle			
3.56 kN	14 %	3.05 kN	
Rear axle			
1.91 kN	45 %	3.50 kN	
Final evaluation static			
0.64 kN	30 %	0.44 kN	
Deceleration service brake			
47 %			
4 %			
Total			

Service Brake Performance Rear Axle



Windscreen



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



Windscreen



Door Front Right



Rear Fender Right



Rear Fender Right



Rear Fender Right



Tail Light Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026

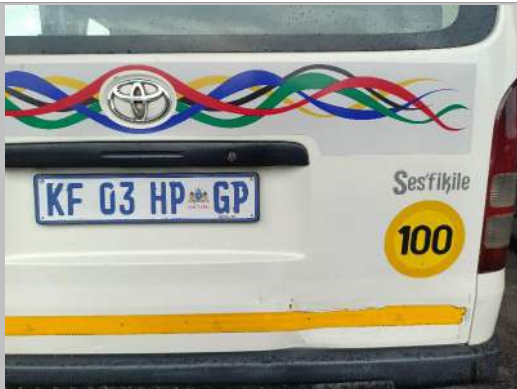

Boot Lid / Hatch door



Boot Lid / Hatch door



Spare Tyre



Seat Rear (2. Row)



Seat Rear (2. Row)



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



Rear Fender Left



Rear Fender Left



Sliding Door



Sliding Door



B • Pillar Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



Bonnet



Bonnet



Bolt(s) / Nut(s) Front Wheel Right



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Right



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026




Tyre Front Left



Engine



Engine

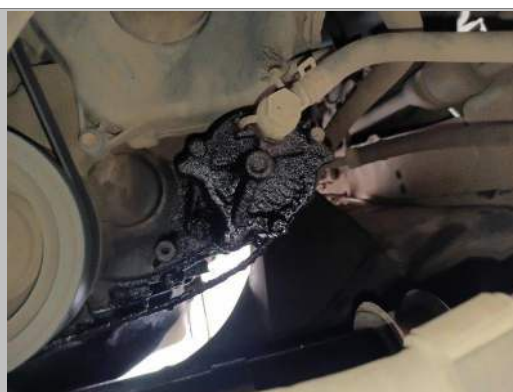

Engine



Hydraulics System



Stabilizer Mounting Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



Engine Wiring



Engine Wiring



Sub Frame



Steering Rack Boot Right



Hoses



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



Gearbox



Tyre Rear Left



Tyre Rear Right



Side Mirror Left



Bonnet stay and shocks



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380



CONDITION REPORT



Report No:
2017305272
DATE
30/09/2026



Hood Lining



Hood Lining



Center Console / Cubbyhole + Lid



Seat Rear



Seat Rear



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807125380