



CONDITION REPORT



Report No:
2017303929
DATE
28/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/09/2026		M57 Pretoria Road - 1619
Inspection Date	28/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LJ31MYGP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2021-2024]	Register Number	
VIN	AHTSS22P807152644	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/08/2026
Color	WHITE	Power / Displacement	
Year Model	2023	Paint Finish	C - COMMON
Km Reading	313,051 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AHTSS22P807152644



CONDITION REPORT



Report No:
2017303929
DATE
28/09/2026

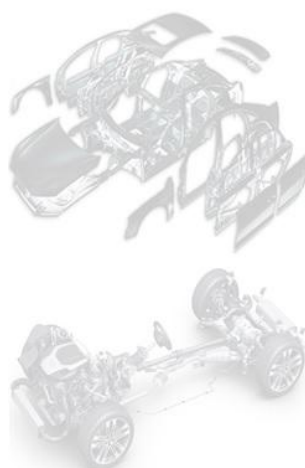

Damage	Repair Way
Engine Wiring Defective	Repair
Headlight Left Damaged	Replace
Seat Rear Torn / Cut	Repair
Door Lock Boot Lid Defective	Repair
Carpet Front Torn / Cut	Repair
Side Mirror Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Sliding Door Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Service Brake Performance Rear Axle Left / Right Difference out of legal range	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Hydraulics System Leak	Repair
Spare Tyre Smooth	Replace
Gearbox Oil Leak	Repair
Some body panels misaligned	Repair
Warning lights illuminated	Repair
Vehicle is idling while testing, struggling to sta	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.5	4.6	-	
Rear	3.3	0.1	-	
Emergency / Parking	0	0	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15	106/104S	Sailun	Commercial	V	3924	1 mm
Front Right	195R15	106/104S	Sailun	Commercial	V	3624	2 mm
Rear Left	195R15	106/104R	Powertrac	Vantour	V	4225	3 mm
Rear Right	195R15	106/104R	Powertrac	Vantour	V	0623	6 mm
Spare	195R15	106/104S	Toyo	H07	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644

**CONDITION REPORT**

Report No:
2017303929
DATE
28/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:

2017303929

DATE _____

28/09/2026

[illegible]

Shock and brake report



Diagnostics report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:

2017303929

DATE

28/09/2026



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:

2017303929

DATE

28/09/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:

2017303929

DATE

28/09/2026



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



REAR



Expansion bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:

2017303929

DATE

28/09/2026



Oil cap and dipstick



Warning lights illuminated

Front axle	left	right	Difference	Weight
Rear axle	0,13	0,11	15 %	1471 kg
Total weight	0,23	0,14	39 %	1672 kg
				2543 kg

Brake test

	left	right	Difference
Front axle	4,59 kN	4,61 kN	0 %
Parking brake	--- kN	--- kN	--- %
Rear axle	3,38 kN	0,18 kN	95 %
Final evaluation static			
Deceleration service brake		51 %	
Deceleration parking brake		--- %	
			Total weight

Parking Brake Performance

Front axle	0,13	0,11	15 %	1471 kg
Rear axle	0,23	0,14	39 %	1672 kg
Total weight				2543 kg

Brake test

	left	right	Difference
Front axle	4,59 kN	4,61 kN	0 %
Parking brake	--- kN	--- kN	--- %
Rear axle	3,38 kN	0,18 kN	95 %
Final evaluation static			
Deceleration service brake		51 %	
Deceleration parking brake		--- %	
			Total weight

Service Brake Performance Rear Axle



Rear Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:

2017303929

DATE

28/09/2026



Rear Fender Right



Rear Fender Right



Boot Lid / Hatch door



Rear Fender Left



Rear Fender Left



Sliding Door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:
2017303929
DATE
28/09/2026



Sliding Door



Door Front Left



Side Mirror Left



Side Mirror Left



Side Mirror Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:

2017303929

DATE

28/09/2026



Headlight Left



Windscreen



Windscreen



Windscreen



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:
2017303929
DATE
28/09/2026



Front Bumper



Engine Wiring



Hydraulics System



Gearbox



Gearbox



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644



CONDITION REPORT



Report No:
2017303929
DATE
28/09/2026



Bonnet



Bonnet



Seat Rear



Door Lock Boot Lid



Carpet Front

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P807152644