



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	21/09/2026		M57 Pretoria Road - 1619
Inspection Date	21/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	SUZUKI	Registration Number	KV61DBGP
Model	DZIRE 1.2 GA MC [2020-2025]	Register Number	
VIN	MBHCZF63S00299288	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2027
Color	GREY	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT METALLIC
Km Reading	199,653 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026

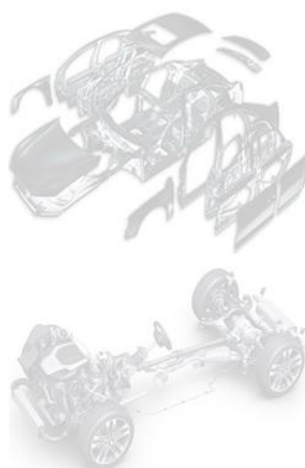

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Damaged	Repair
Fan Damaged	Replace
Radiator Damaged	Replace
Battery clamps Damaged	Replace
Bonnet stay and shocks Missing	Replace
Hooter Defective	Repair
Engine Management Lights Set	Repair
Windscreen Wiper Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Carpet Front Damaged	Replace
Carpet Rear Damaged	Replace
Boot Carpet Damaged	Replace
Gear Lever Dust Boot Damaged	Replace
Side Mirror Left Corrosion	Replace
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Windscreen Damaged	Repair
Sealing Window Rear Door Left Damaged	Replace
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Steering Rack Boot Right Damaged	Replace
Shock Absorber Front Left Damaged	Replace
Shock Absorber Rear Left Worn	Replace
Shock Absorber Rear Right Worn	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Control Arm Bush(es) Front Axle Right Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Worn	Replace
Main Beam Left Damaged	Repair
Chassis Damaged	Replace
Catalytic converter Welded	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cross Member Damaged	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.35	2.2	-	
Rear	1.46	1.84	-	
Emergency / Parking	0.17	1.37	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	T125/70R16	95M	Kumho	Temporary	V	4312	0 mm
Front Right	175/65R14	82T	Sava	Radial	V	3722	0 mm
Rear Left	175/65R14	86T	Kumho	Radial	V	4619	0 mm
Rear Right	175/65R14	82H	Autogrip	Radial	V	0122	0 mm
Spare	175/65R14	88T	Ovation	Radial	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ECM/PCM	P0011	A CAMSHAFT POSITION TIMING OVER ADVANCED OR SYSTEM PERFORMANCE	HISTORY

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. 22 DTC'S AT TIME OF TESTING SEE DTC REPORT. SIGNS OF TAMPERING DONE TO VEHICLE AIRBAGS.Engine Compartment: Foreign substance on oil filler cap. fan cowling damaged.
Electrical Components and Instruments: hooter does not work.
Interior: signs of surface rust in boot.
Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Repair work done to vehicle below standard. Vehicle body in poor condition. Signs of impact damage to front of vehicle. Signs of hail damage to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026

[illegible]

Brake test.

[illegible]

Diagnostic.

Patient: [Name]
 Date: 10/10/10
 Time: 10:00
 Symptoms:
 1. [Symptom] 10/10/10 10:00
 2. [Symptom] 10/10/10 10:00
 3. [Symptom] 10/10/10 10:00
 4. [Symptom] 10/10/10 10:00
 5. [Symptom] 10/10/10 10:00
 6. [Symptom] 10/10/10 10:00
 7. [Symptom] 10/10/10 10:00
 8. [Symptom] 10/10/10 10:00
 9. [Symptom] 10/10/10 10:00
 10. [Symptom] 10/10/10 10:00
 Signs:
 1. [Sign] 10/10/10 10:00
 2. [Sign] 10/10/10 10:00
 3. [Sign] 10/10/10 10:00
 4. [Sign] 10/10/10 10:00
 5. [Sign] 10/10/10 10:00
 6. [Sign] 10/10/10 10:00
 7. [Sign] 10/10/10 10:00
 8. [Sign] 10/10/10 10:00
 9. [Sign] 10/10/10 10:00
 10. [Sign] 10/10/10 10:00
 Diagnosis:
 1. [Diagnosis] 10/10/10 10:00
 2. [Diagnosis] 10/10/10 10:00
 3. [Diagnosis] 10/10/10 10:00
 4. [Diagnosis] 10/10/10 10:00
 5. [Diagnosis] 10/10/10 10:00
 6. [Diagnosis] 10/10/10 10:00
 7. [Diagnosis] 10/10/10 10:00
 8. [Diagnosis] 10/10/10 10:00
 9. [Diagnosis] 10/10/10 10:00
 10. [Diagnosis] 10/10/10 10:00
 Treatment:
 1. [Treatment] 10/10/10 10:00
 2. [Treatment] 10/10/10 10:00
 3. [Treatment] 10/10/10 10:00
 4. [Treatment] 10/10/10 10:00
 5. [Treatment] 10/10/10 10:00
 6. [Treatment] 10/10/10 10:00
 7. [Treatment] 10/10/10 10:00
 8. [Treatment] 10/10/10 10:00
 9. [Treatment] 10/10/10 10:00
 10. [Treatment] 10/10/10 10:00

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:

2017301452

DATE

21/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:

2017301452

DATE

21/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT




Report No:

2017301452

DATE

21/09/2026

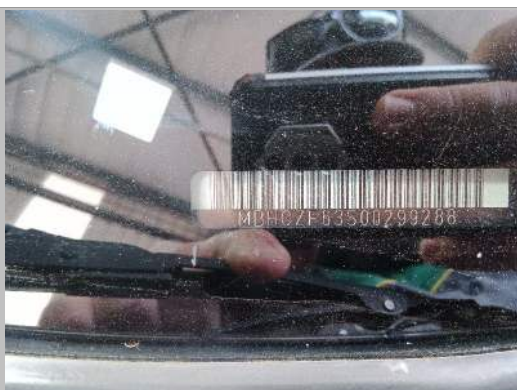

VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Bonnet stay and shocks

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:


2017301452

DATE

21/09/2026



Battery clamps

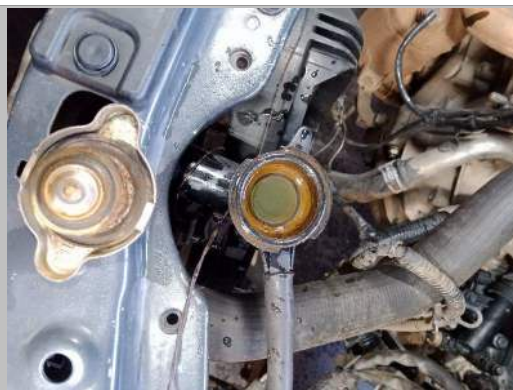

Water level



Headlight Right



Headlight Left



Catalytic converter



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



Front Bumper



Bonnet




Bonnet



Grill



Front Fender Left

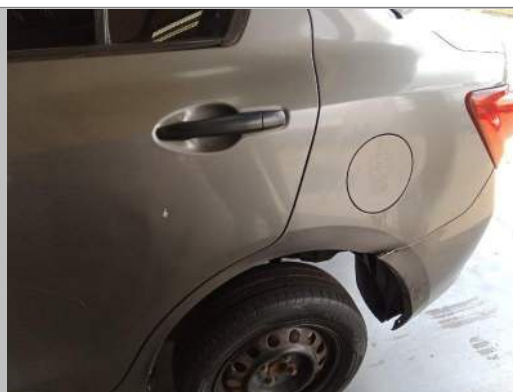

Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:

2017301452

DATE

21/09/2026



Door Front Left



Door Rear Left



Boot Lid / Hatch door



Rear bumper



Rear bumper



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



Door Front Right




Front Fender Right



Rear Fender Right



Roof

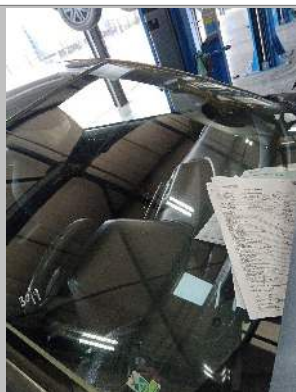

Windscreen



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



Engine Wiring



Engine Wiring



Fan



Shock Absorber Rear Left



Shock Absorber Rear Right



Tyre Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288




CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



Tyre Front Left

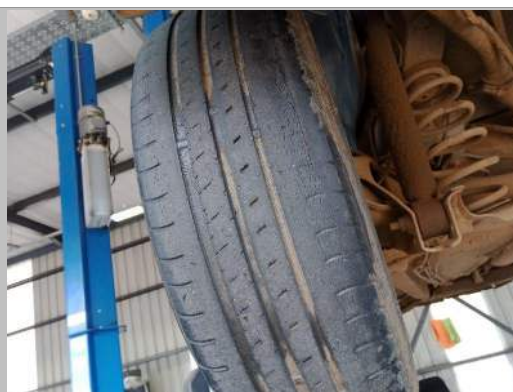

Tyre Rear Left



Tyre Front Right



Tyre Rear Right



Chassis



Steering Rack Boot Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



CV Joint(s) Boot(s) Front Left (inner/outer)



CV Joint(s) Boot(s) Front Right (inner/outer)



Engine



Gearbox



Radiator



Radiator Cross Member

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:

2017301452

DATE

21/09/2026



Main Beam Left



Main Beam Left



Main Beam Left



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Shock Absorber Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



Brake disc 1. Axle left



Brake disc 1. Axle left



Brake disc 1. Axle right



Control Arm Bush(es) Front Axle Right



Side Mirror Left



Gear Lever Dust Boot

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288



CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



Carpet Front



Carpet Front



Carpet Rear



Boot Carpet



Spare Tyre



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288




CONDITION REPORT



Report No:
2017301452
DATE
21/09/2026



Sealing Window Rear Door Left

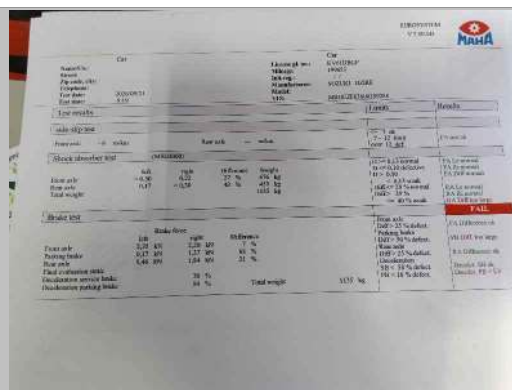

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MBHCZF63S00299288