



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	17/04/2025		M57 Pretoria Road - 1619
Inspection Date	17/04/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	JN77JYGP
Model	POLO VIVO 1.6 COMFORTLINE 5-DR TIPTRONIC [2019-2021]	Register Number	
VIN	AAVZZZ6RZLU017266	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	28/02/2026
Color	SILVER	Power / Displacement	
Year Model	2020	Paint Finish	M - METALLIC
Km Reading	109,750 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

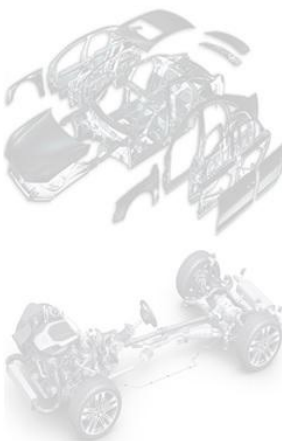

Damage	Repair Way
Radio/CD/USB Missing	Replace
Center Console / Cubbyhole + Lid Defective	Repair
Switch Electrical Window Winder front left Damaged	Repair
Switch Electrical Window Winder front right Damaged	Repair
Windscreen Wiper Damaged	Replace
Parcel Tray Missing	Replace
Dash Padding Damaged	Repair
Window Winder rear right Defective	Repair
Steering Wheel Trim Damaged	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Discoloured	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

Damage	Repair Way
Door Rear Right Dented	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Dented	Repair
Roof Dented	Repair
Bonnet release handle missing	Replace
Airbag light on	Repair
Boot panel missing	Replace
Both front fender liner damage	Replace
Windscreen washers not working	Repair
Antenna missing	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	2.7	2.8	-	
Rear	1.5	1.6	-	
Emergency / Parking	1.6	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Sailwin	Antares 68	V	1121	1 mm
Front Right	185/60R15	84H	Bridgestone	Turanza	V	4419	3 mm
Rear Left	185/60R15	84H	Lanvigator	Comfort	V	3523	1 mm
Rear Right	185/60R15	84H	Sumitomo	Htr	V	1218	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE/ STATIC	B10021B	FRONT PASSENGER SENSOR RESISTANCE TOO HIGH	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Vehicle got some scratches, stone chips and dents. Discoloring on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

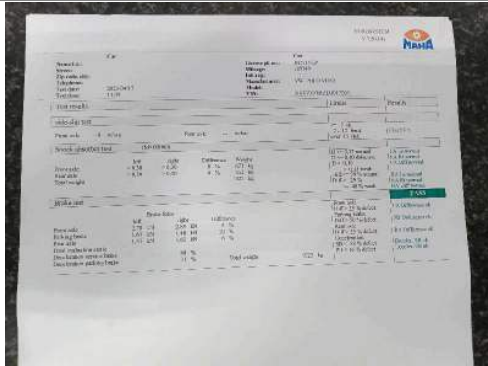DATE
17/04/2025


Shock and brake report



Diagnostic report



Diagnostic report

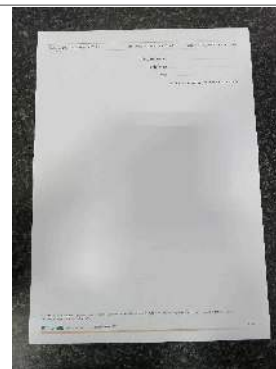

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

90 DEGREE REAR




90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

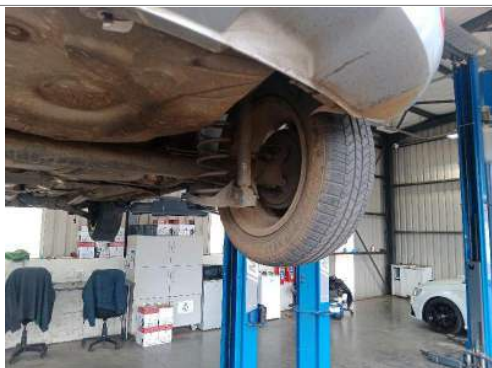

RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

No spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

Bonnet release handle missing



Expansion bottle



Oil cap and dipstick



Switch Electrical Window Winder front left



Switch Electrical Window Winder front right



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

Center Console / Cubbyhole + Lid



Parcel Tray



Water level



Radio/CD/USB



Dash Padding



Window Winder rear right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT


Report No: 2016847492

DATE
17/04/2025

Bonnet



Grill

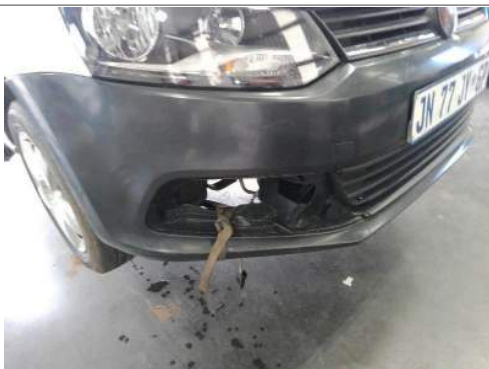

Front Bumper



Front Bumper



Front Fender Right



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

Door Rear Right



Door Front Right



Door Rear Left



Door Front Left



Rear Fender Left



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266



CONDITION REPORT

Report No: 2016847492

DATE
17/04/2025

Boot Lid / Hatch door



Rear bumper



Sill Panel Right



Roof



Windscreen Wiper



Steering Wheel Trim

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZLU017266