



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	04/01/2024		M57 Pretoria Road - 1619
Inspection Date	04/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KC78GDGP
Model	POLO TSI	Register Number	
VIN	AAVZZAWZLU023769	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	04/01/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	110,068 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Wiring Defective	Repair
Caps Defective	Replace
Hoses Defective	Repair
Battery clamps Defective	Repair
Air conditioner pipes Defective	Repair
Air cleaner Damaged	Replace
Bonnet safety caps Damaged	Replace
Engine Oil Sweat	Repair
Switch Electrical Window Winder front left Missing	Replace
Switch Electrical Window Winder front right Missing	Replace
Air Conditioner Insufficient	Replace
Tail Light Left Defective	Repair
Headlight Right Defective	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Seat Belt Front Left Defective	Replace
Seat Belt Front Right Defective	Replace
Hood Lining Dirty	Repair
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Left Torn / Cut	Replace
Steering Wheel Trim Defective	Repair
Side Mirror Left Damaged	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Damaged	Replace
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Replace
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZLU023769

1 / 20



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

Damage	Repair Way
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Damaged	Repair
Roof Dented	Repair
Windscreen Chipped	Repair
Caliper 1. Axle right Defective	Repair
Service Brake Performance Front Axle Left / Right Difference out of legal range	Repair
Service Brake Performance Rear Axle Left / Right Difference out of legal range	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Shock Absorber Front Left Defective	Repair
Shock Absorber Front Right Leak	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Ball Joint(s) Front Axle Left Defective	Repair
Tyre Front Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Belly plates Defective	Repair
Steering Noisy	Repair
Engine Performance Insufficient	Repair
Engine Noise Excessive	Repair
Warning lights illuminated on dashboard	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	0.76	0.33	-	
Rear	1.92	1.08	-	
Emergency / Parking	1.23	0.46	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/45Z R17	87Y	Sumitomo	HTR Z	V	5020	0 mm
Front Right	185/60 R15	82H	Sumitomo	HTR	V	1622	5 mm
Rear Left	185/70 R14	88H	Falken	Sincera	V	2619	5 mm
Rear Right	215/45Z R17	87Y	Sumitomo	HTRZ	V	5020	0 mm

* Tyre Legend: V=Virgin, R=Recap



CONDITION REPORT

VIN: AA777A071623749

Report No: 201623749

2 / 20

DATE

04/01/2024

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P048000	COOLING FAN 1 CONTROL CIRCUIT	

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: VEHICLE LICENSE DISC MISSING.SHOCK ABSORBER TEST COULD NOT BE PERFORMED.
 Engine Compartment: Engine bay dirty. Brake fluid level ok. Bonnet release handle damaged. Bonnet slam plate cover missing. Fan Cowley damaged.
 Electrical Components and Instruments: Front right electrical window switch mechanism missing.
 Lights: Front left and right daytime running lights not working.
 Interior: Vehicle interior dirty and some interior panels scratched.
 Body • Exterior: Dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.
 Residual traces of repair on some body panels. Front number plate missing. Bonnet struggles to open. Signs of impact damage to front of vehicle.
 Axle and Suspension: Abnormal noise coming from front and rear suspension. Front suspension faulty. Wire strapped onto front left shock absorber and brake caliper. Nut missing on front left ball joint. Signs of vehicle grabbing.
 Tyres and Rims: Alloy and steel rims scratched. Front and rear tyre sizes different. Spare wheel missing.
 Undercarriage: Vehicle undercarriage dirty. Bottom of engine and gearbox fully covered. Exhaust heat shields damaged. Fuel tank scratched. Rear exhaust cross member bracket dented.
 Road Test: Vehicle unsafe to drive due steel wire strapped on front left shock absorber and brake caliper.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za



CONDITION REPORT


Report No: 2016217479

VIN: AAVZZAWZLU023769


DATE
30
04/01/2024




Brake test report

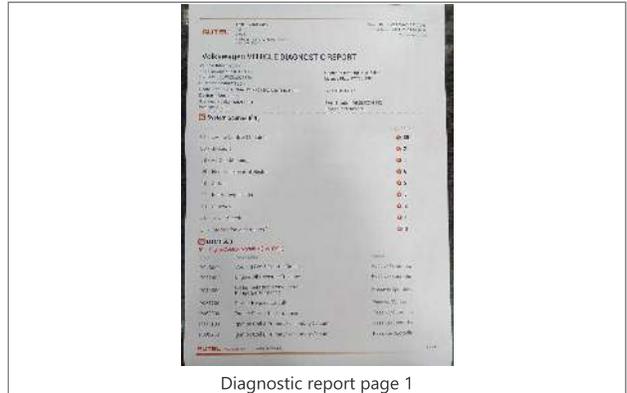


Diagnostic report page 1

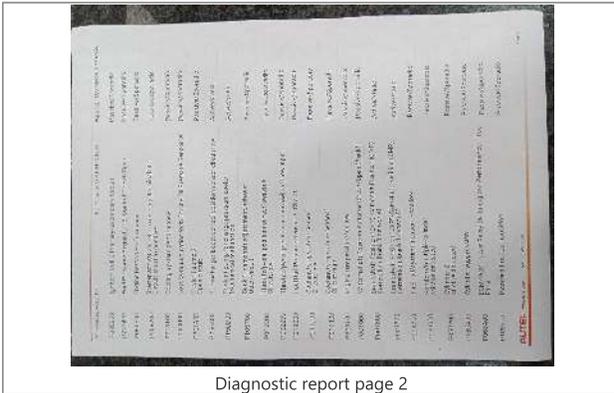


Diagnostic report page 2

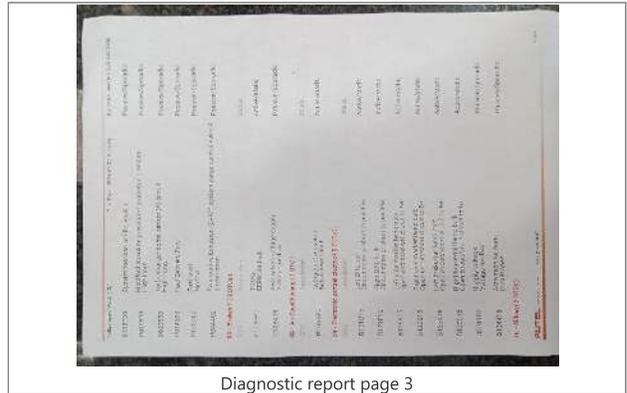

Diagnostic report page 3

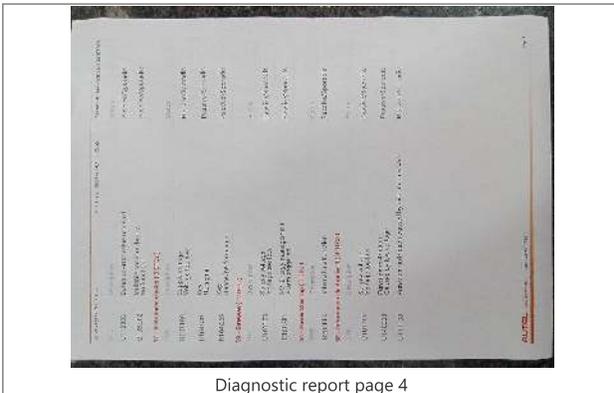

Diagnostic report page 4

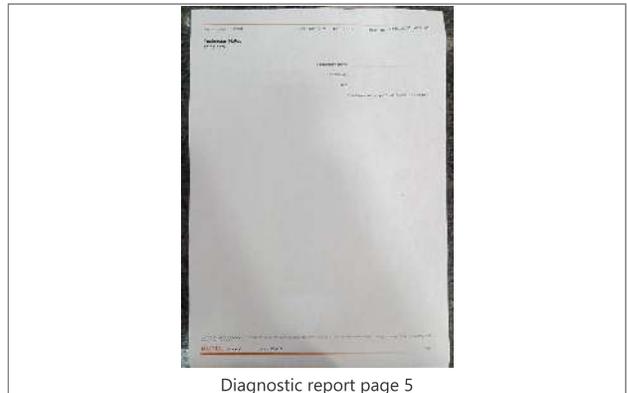

Diagnostic report page 5

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

VIN: AAVZZZAW74012024
DATE: 04/03/2024
4 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769

5 / 20



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769
6 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769

7 / 20



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769

8 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769

10 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



Spare wheel Accessories



Oil cap




Manual Transmission



Seat Front Right



Seat Belt Front Right

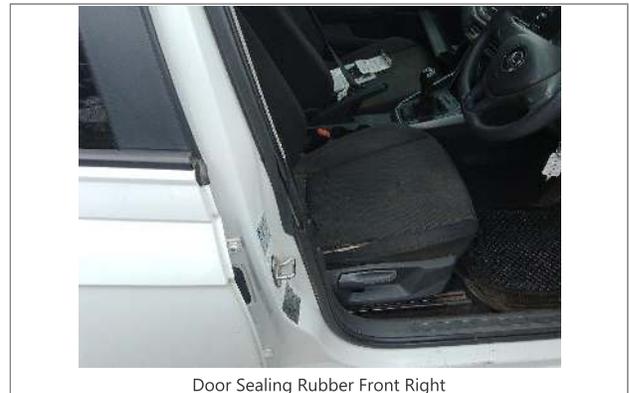

Door Sealing Rubber Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769
12 / 20



DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

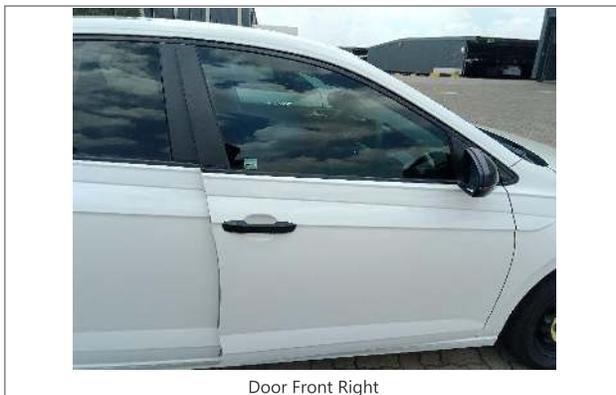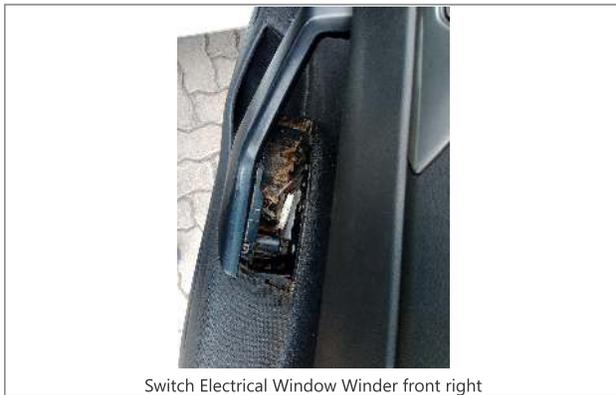

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769

14 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



Rear Fender Right



Seat Rear

ZZZ / ZU023769
15 / 20



Sill Panel Right



Sill Panel Right



Roof



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZAWZLU023769
16 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



Rear bumper



Rear Fender Left



Door Rear Left



Door Front Left



Front Fender Left



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769

18 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



Tail Light Left



Boot Lid / Hatch door VIN: AAVZZZAWZLU023769

19 / 20



Front Fender Right



Front Bumper



Front Bumper



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

VIN: AAVZZZAWZLU023769
20 / 20

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



Bonnet



Headlight Right




Bonnet safety caps



Bonnet safety caps



Air cleaner

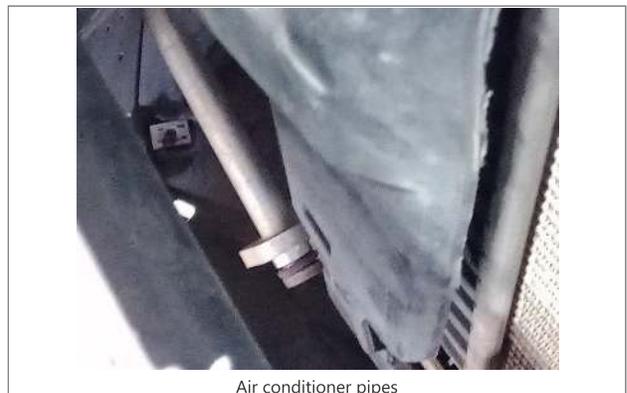

Air conditioner pipes

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



Battery clamps



Engine



Water level



Caps



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024




Shock Absorber Front Right




Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left

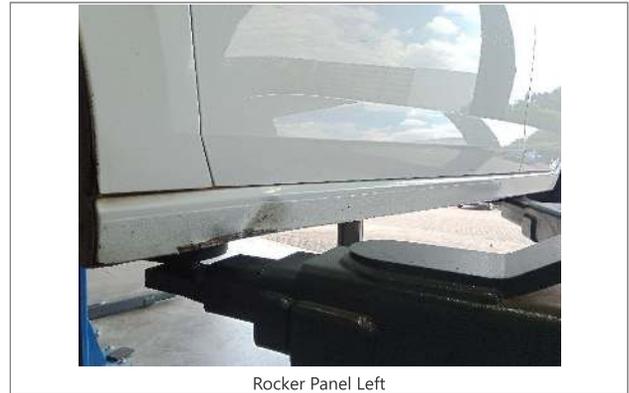

Rocker Panel Left

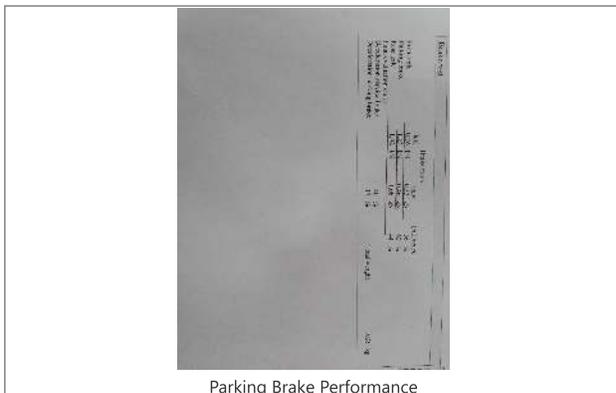

Parking Brake Performance



Service Brake Performance Rear Axle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


Report No: 2016217479

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

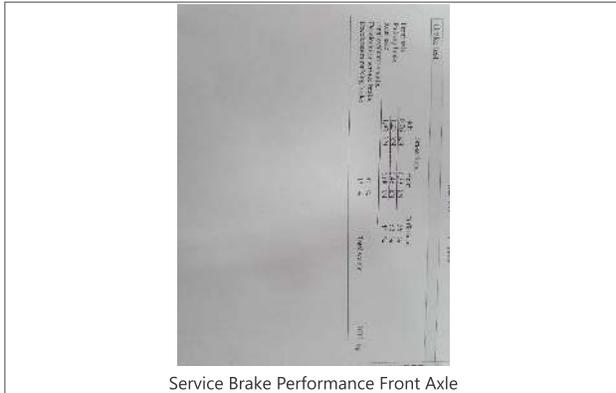

Service Brake Performance Front Axle

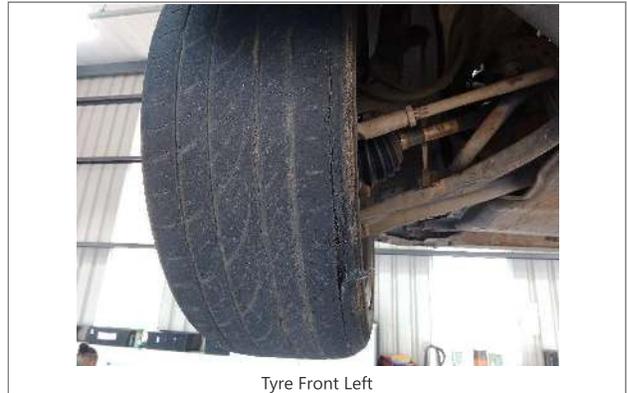

Tyre Front Left



Shock Absorber Front Left



Caliper 1. Axle right



Belly plates



Belly plates



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



Tyre Rear Right



Engine Wiring



Ball Joint(s) Front Axle Left



Hoses



Hoses



Hoses

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024



Windscreen



Switch Electrical Window Winder front left



Seat Belt Front Left



Seat Front Left



Sill Panel Left



Sill Panel Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



Door Sealing Rubber Rear Left



CONDITION REPORT

Report No: 2016217479

DATE
04/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za