

CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025

MFC Auction House M57 Pretoria Rd, Glenmarais, KEMPTON PARK Gauteng

DEKRA MFC M57 Pretoria Rd - 1619 KEMPTON PARK - GT 08610 33572











Assignment

Client MFC Auction House Inspection Location MFC M57 Pretoria Road - 1619 Requested Date 25/07/2025 Kempton Park -25/07/2025 Inspection Date

Vehicle Data

Vehicle Type PASSENGER VEHICLE Registered Owner Manufacturer TOYOTA KWD527NW Registration Number Model HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS

[2021-2024]

AHTSS22P207140442

Engine Number

Doors

WHITE Year Model 2022

Km Reading 228,122 KM STATION WAGON Cab / Body Type

Register Number

Date Of First Licensing

Last COR

License Expiry Date

Power / Displacement

Paint Finish TWO COAT UNI Fuel DIESEL Transmission MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025



Damage	Repair Way
Engine Oil Leak	Repair
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Rear (2. Row) Damaged	Repair
Door Sealing Rubber Rear Left Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Rear Left Damaged	Repair
Wheel Cylinder / Caliper 2. Axle left Leak	Replace
Service Brake Performance Rear Axle Left / Right	Doodyyawthy, Doloyawt
Difference out of legal range	Roadworthy Relevant
Brakes Insufficient	Repair

Brakes Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.04	4.05	-	
Rear	0.65	0.89	-	
Emergency / Parking	0.35	0.54	-	

Tyres and Rims Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15C	104R	Autogrip	Radial	V	1025	2 mm
Front Right	195R15C	104R	Autogrip	Radial	V	1025	1 mm
Rear Left	195R15C	104R	Autogrip	Radial	V	1025	2 mm
Rear Right	195R15C	104R	Autogrip	Radial	V	0125	2 mm

^{*} Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0087	FUEL RAIL/ SYSTEM PRESSURE TO LOW	

Inspection Conditions

No Test Drive

Rain at time of inspection

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. EXCESSIVE NOISE FROM FRONT AND REAR SUSPENSION.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025

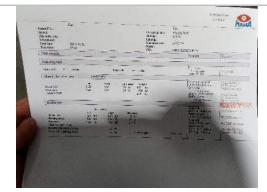

Brake and shock absorber



Diagnostic report



FRONT RIGHT CORNER







DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025



ODOMETER



ADDITIONAL 11



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025



















VIN: AHTSS22P207140442

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025












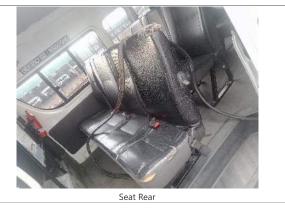

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025













DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za



CONDITION REPORT



Report No: 2016958195 DATE 25/07/2025













DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za