



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/03/2025		M57 Pretoria Road - 1619
Inspection Date	05/03/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	JZ00XMGP
Model	HI-ACE 2.5 SESFIKILE 16-S DSL MINIBUS [2020-2022]	Register Number	
VIN	AHTSS22P607122140	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2023
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	C - COMMON
Km Reading	268,128 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

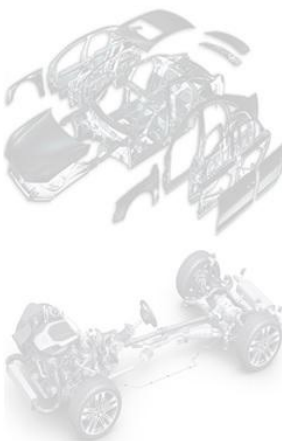

Damage	Repair Way
Expansion Bottle Damaged	Replace
Dim and Bright Indicator Light Malfunction	Repair
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Front Bumper Damaged	Repair
Grill Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Dented	Repair
Sliding Door Dented	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P607122140

1 / 12



CONDITION REPORT

Report No: 2016788421

 DATE
05/03/2025

Damage	Repair Way
Parking Brake Performance Left / Right Difference out of legal range	Repair
Wheel bearing Front Left Free play	Replace
Tyre Front Left Smooth	Replace
Spare Tyre Smooth	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Body exterior	Vehicle got some scratches, stone chips and dents
Body exterior	Sliding door not opening
All four hup caps missing	Replace
Rear and Front tyres size differs.	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.5	4.7	-	
Rear	1.3	3.1	-	
Emergency / Parking	0.6	3.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15	106/104Q	Radar	Rlt-71	V	2622	0 mm
Front Right	205/70R15	106/104S	Continental	Contact	V	1421	3 mm
Rear Left	205/70R15	106/104S	Continental	Contact	V	1521	3 mm
Rear Right	195R15	106/104S	Toyo	Ho7	V	0421	3 mm
Spare	195R15	106/104N	Durun	D212	V	2222	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	HISTORY	B1801	DRIVER SIDE SQUIB CIRCUIT OPEN	

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025**Technician**

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

VIN: AHTSS22P607122140

2 / 12


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

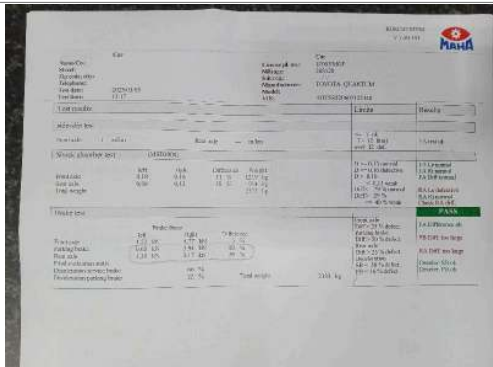

Shock and brake report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

VIN: AHTSS22P607122140
4 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: AHTSS22P607122140
5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

VIN: AHTSS22P607122140
6 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P607122140



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016788421

DATE
05/03/2025

VIN PLATE OR STICKER



ENGINE 1

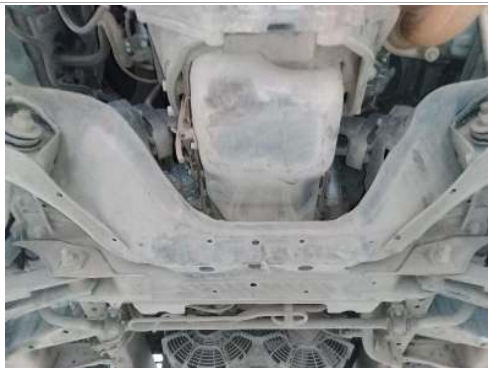

ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

VIN: AHTSS22P607122140
9 / 12


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

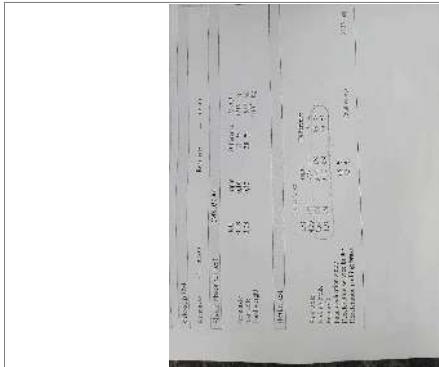

Parking Brake Performance

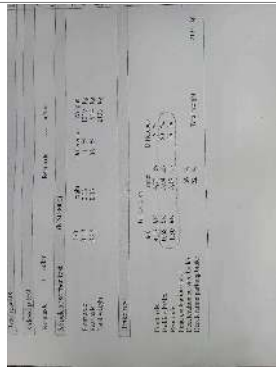

Service Brake Performance Rear Axle



Expansion Bottle



Water level

VIN: AHTSS22P607122140
10 / 12



Bonnet



Grill

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

VIN: AHTSS22P607122140
11 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

Seat Front Right



Seat Front Left



Seat Rear



Tail Light Right



Tail Light Left



Rear Fender Right

VIN: AHTSS22P607122140

12 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

Door Front Right



Front Bumper



Front Bumper



Door Front Left



Sliding Door



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025


Boot Lid / Hatch door



Rear bumper



Spare Tyre

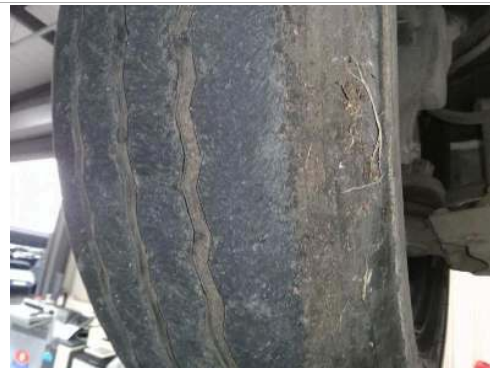

Tyre Front Left



Wheel bearing Front Left



Bolt(s) / Nut(s) Front Wheel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

Report No: 2016788421

DATE
05/03/2025

Bolt(s) / Nut(s) Front Wheel Left



Dim and Bright Indicator Light

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016788421

DATE
05/03/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za