



## CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
GautengDEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/04/2025		M57 Pretoria Road - 1619
Inspection Date	02/04/2025		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	RENAULT	Registration Number	FM70FHGP
Model	SANDERO II 0.9 STEPWAY 66KW TURBO 5-DR [2014-2017]	Register Number	
VIN	VF15SRAAC55714984	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLUE	Power / Displacement	
Year Model	2016	Paint Finish	M - METALLIC
Km Reading	116,874 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

Damage	Repair Way
Expansion Bottle Defective	Repair
Air conditioner pipes Damaged	Replace
Fog Light Front Right Malfunction	Repair
Interior Mirror Missing	Replace
Dash Padding Damaged	Repair
Steering Wheel Trim Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Residual Traces of Repair	Repair
Front Bumper Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



## CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025

Damage	Repair Way
Rear bumper Paintwork • Scratched	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
Airbag light on	Repair

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.5	2.6	-	
Rear	1.7	1.6	-	
Emergency / Parking	1.2	1.3	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Tracmax	X-privilo	V	3023	3 mm
Front Right	205/55R16	91V	Tracmax	X-privilo	V	3023	3 mm
Rear Left	205/55R16	91W	Rovelo	Rpx-988	V	3820	3 mm
Rear Right	205/55R16	91W	Rovelo	Rpx-988	V	3820	3 mm
Spare	185/65R15	88T	Barum	Brilliants	V	2018	5 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE	DTC907F49	REPLACE COMPUTER AFTER IMPACT	

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
 www.dekraauto.co.za

VIN: VF15SRAAC55714984



**CONDITION REPORT**

**Report No: 2016824283**

**DATE**  
**02/04/2025**

strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: VF15SRAAC55714984




CONDITION REPORT

Report No: 2016824283


DATE  
02/04/2025

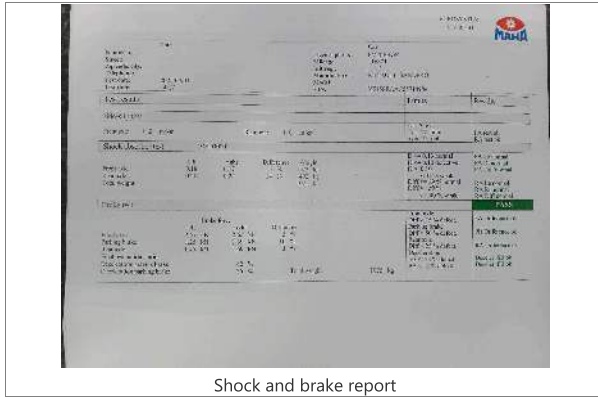


Shock and brake report

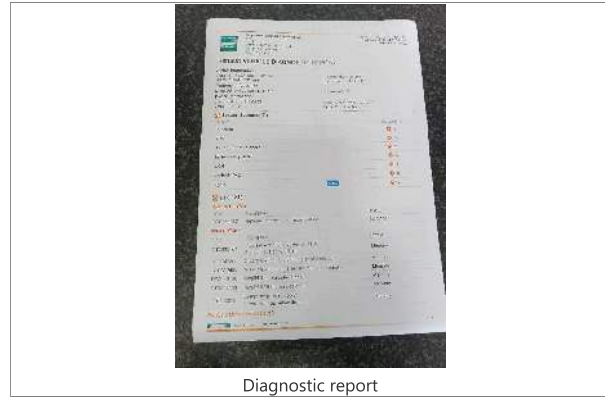


Diagnostic report

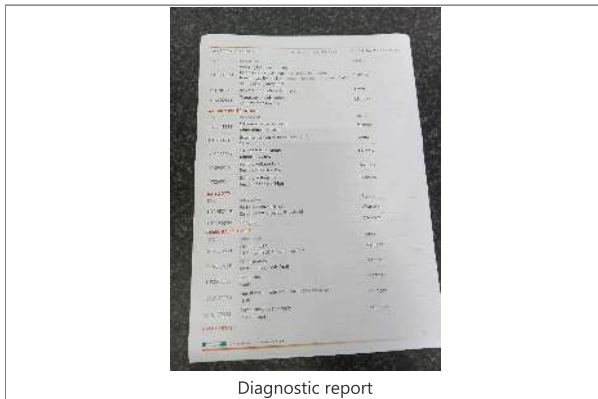

Diagnostic report

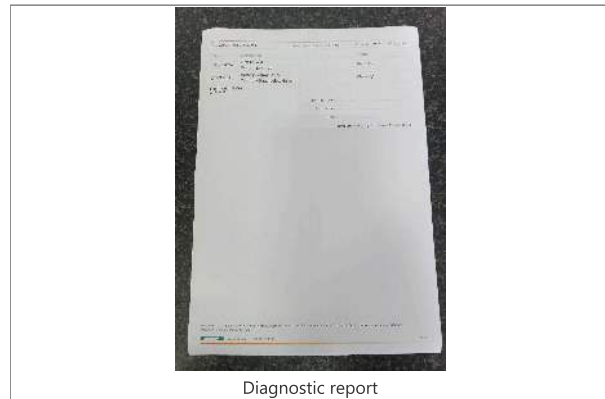

Diagnostic report

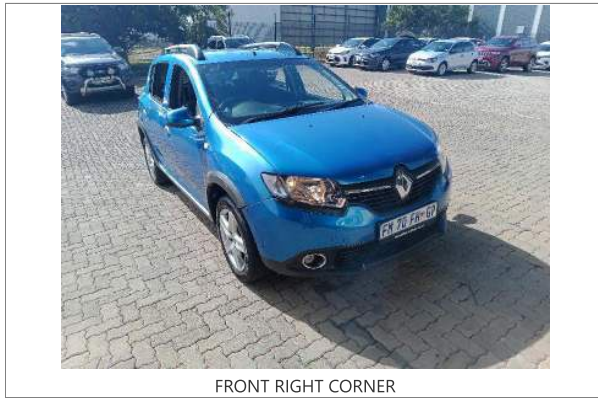

FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025




90 DEGREE REAR



90 DEGREE LEFT




LF TYRE TREAD

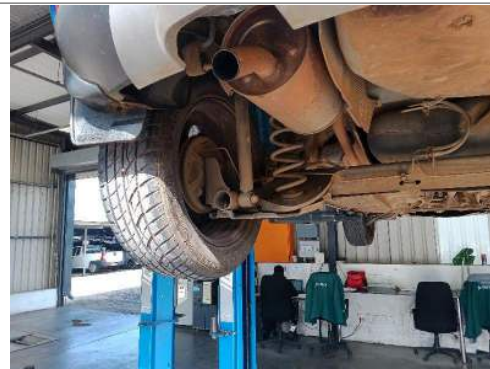

LR TYRE TREAD



RR TYRE TREAD

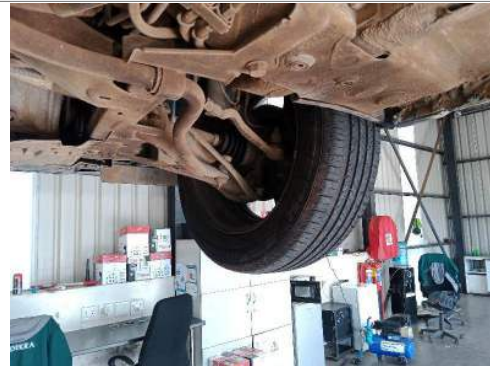

RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025



Spare wheel




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

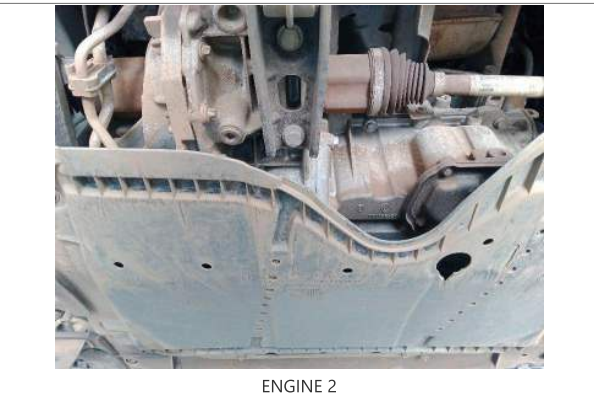

ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025



Expection bottle



Oil cap and dipstick



Interior Mirror



Dash Padding



Steering Wheel Trim



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025



Expansion Bottle



Bonnet slam plate (Shock tower/ Inner tray)



Air conditioner pipes



Side Mirror Right



Front Fender Right



Door Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025



Door Rear Right



Rear Fender Right



Front Bumper



Front Bumper



Front Fender Left



Side Mirror Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984



CONDITION REPORT

Report No: 2016824283

DATE  
02/04/2025



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Boot Lid / Hatch door



Fog Light Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: VF15SRAAC55714984