



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/07/2025		M57 Pretoria Road - 1619
Inspection Date	28/07/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	BMW	Registration Number	CH82PCGP
Model	335i AT [2008-2013]	Register Number	
VIN	WBAPM56060NM66197	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2024
Color	WHITE	Power / Displacement	
Year Model	2010	Paint Finish	C - COMMON
Km Reading	294,535 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025

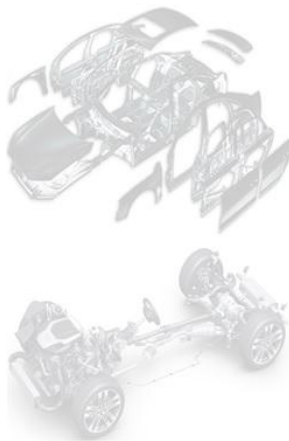

Damage

Repair Way

Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Bonnet stay and shocks Missing	Replace
Windscreen Wiper Missing	Replace
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Door Lock Boot Lid Missing	Replace
Front Bumper Residual Traces of Repair	Repair
Bonnet Residual Traces of Repair	Replace
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Residual Traces of Repair	Repair
Roof Residual Traces of Repair	Repair
Shock Absorber Front Right Loose / Excessive Play	Replace
Shock Absorber Mounting Front Right Damaged	Replace
Alignment Left / Right Difference out of legal range	Repair
Tyre Front Right Smooth	Replace
Tyre Rear Right Smooth	Replace
Rim Front Left Scratched	Repair
Rim Rear Right Cracked	Repair
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Catalytic converter Welded	Replace
Gearbox Oil Leak	Repair
Engine Performance Idling / Hunting	Repair
Engine Noise Idling / Hunting	Repair
Engine Smoke Excessive	Repair
unpleasant odor inside of vehicle	Repair
vehicle fitted with lower suspension	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40R19	93W	Windforce	Catchpower	V	0124	5 mm
Front Right	225/40R19	89Y	Bridgestone	Potenza	V	3417	0 mm
Rear Left	255/35R19	96Y	Lanvigator	Catchpower	V	4923	3 mm
Rear Right	255/35R19	96Y	Michelin	Primacy	V	0222	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	DME	002775	AIR MASS, PLAUSIBILITY, AIR MASS TOO LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Signs of spray work done on some body. Residual traces of repair work done on some body panels.
Undercarriage: Undercarriage covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: WBAPM56060NM66197



CONDITION REPORT




Report No:
2016960327
DATE
28/07/2025

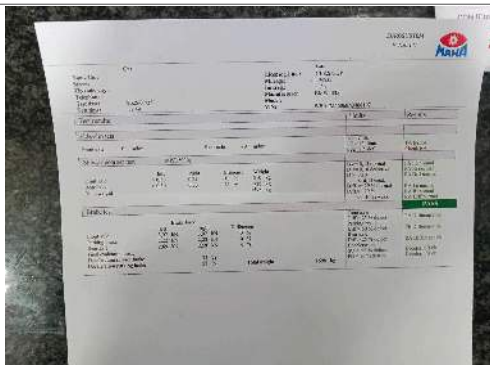

Shock and brake report



Diagnostic test

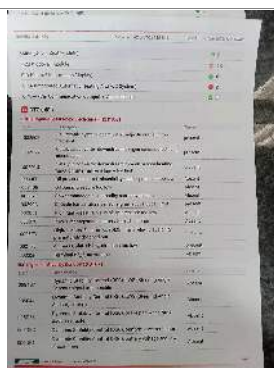

Diagnostic test



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM5606NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Expansion bottle



Oil cap



No sparewheel



Front Fender Right



Door Front Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Rear Fender Right



Roof



Door Lock Boot Lid



Boot Lid / Hatch door



Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Front Fender Left



Bonnet



Bonnet stay and shocks



Bonnet stay and shocks



Front Fender Left / Inner Tray



Front Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Engine Wiring



Engine Wiring



Seat Front Right



Seat Front Left



Bolt(s) / Nut(s) Front Wheel Right



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Shock Absorber Front Right




Shock Absorber Mounting Front Right



Front Bumper



Front Bumper

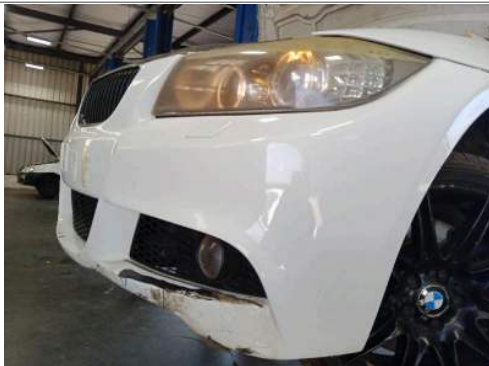

Front Bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Rear bumper



Rear bumper



Rim Front Left



Engine Wiring



Catalytic converter



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Gearbox



Gearbox



Engine



Tyre Rear Right



Rim Rear Right



Shock Absorber Mounting Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197



CONDITION REPORT



Report No:
2016960327
DATE
28/07/2025



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: WBAPM56060NM66197