



CONDITION REPORT



Report No:
2017304626
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	FY52XVGP
Model	COROLLA 1.3 PROFESSIONAL [2010-2014]	Register Number	
VIN	AAPV0182620711061	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/02/2027
Color	GREY	Power / Displacement	
Year Model	2010	Paint Finish	M - METALLIC
Km Reading	275,399 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:

2017304626

DATE

29/09/2026

Damage

Repair Way

Radio/CD/USB Missing	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Side Mirror Left Paintwork • Chipmarks	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Discoloured	Repair
Bonnet Paintwork • Discoloured	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Discoloured	Repair
Rear Fender Left Paintwork • Discoloured	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Discoloured	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Discoloured	Repair
Door Rear Right Paintwork • Discoloured	Repair
Boot Lid / Hatch door Paintwork • Discoloured	Repair
Rear bumper Paintwork • Flaking	Repair
Gearbox Oil Leak	Repair
Boot release cable damage	Replace
Battery loose	Repair
Vehicle got AAPV Vin	Repair
Vehicle Vin not matching license disc	Repair
All four hup caps missing	Replace
Boot not opening can not see spare wheel	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.6	3.3	-	
Rear	2.3	2.3	-	
Emergency / Parking	1.1	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91V	Sun wide	Rs-zero	V	2825	3 mm
Front Right	195/65R15	91V	Sun wide	Rs-zero	V	2825	3 mm
Rear Left	195/65R15	91V	Sun wide	Rs-zero	V	2825	3 mm
Rear Right	195/65R15	91V	Sun wide	Rs-zero	V	2825	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: AAPV0182620711061

**CONDITION REPORT**

Report No:
2017304626
DATE
29/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS / DISCOLORING ON SOME BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:

2017304626

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:
2017304626
DATE
29/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:
2017304626
DATE
29/09/2026



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:


2017304626

DATE _____

29/09/2026



RF TYRE TREAD

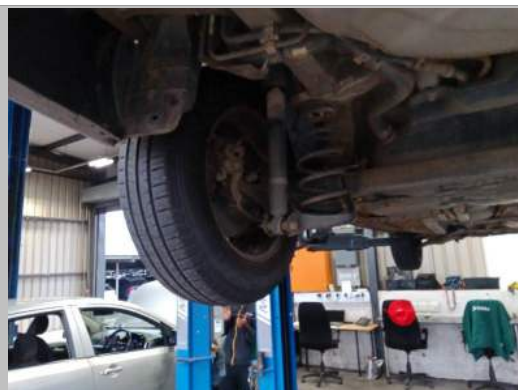

LR TYRE TREAD



RR TYRE TREAD



Battery loose

Motor Vehicle Particulars		Vehicle Registration Details	
License number	FY2010CP	Class number/plate	AP010200010001
Vehicle registration number	CY19411	Engine number	16100110001
Previous license number		Pre-previous license number	
Year of validity for first licensing	2017-01-24	Date of validity for first registration	2017-01-27
Locality of vehicle owner	F90004	Make	PERCIVA
Year of age	1	Series	CONJOL4
Gross vehicle mass (GVW) (kg)	1763	Model	SWANNO
Vehicle construction class (CC) (kg)	2004	Category	Light passenger vehicle less than 12 persons
Net power (kW)	86	Series	
Engine capacity (cc)	1058	License	Small passenger vehicle
Fuel type	Petrol	First color	White (other than black)
Transmission	Manual	Color	White
Seating	9	Registration number	1
Vehicle description			
Overall length (mm)	4542	Overall width (mm)	1752
Number of wheels	4	Wheelbase	2500
Front end height (mm)	1473	Adapt Total	3
Rear end height (mm)	1415	Adapt Side	1142
Weight	1610	Adapt Front	1000mm
Vehicle class	90 Registered (exempt from licensing)	APR class	2000 registered over 20100
APR vehicle class	2000-00-10	SAF's mark	None
SAF's mark date	2000-00-00-00-00		

174 report

[illegible]

Shock and brake report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAPV0182620711061



CONDITION REPORT



Report No:
2017304626
DATE
29/09/2026

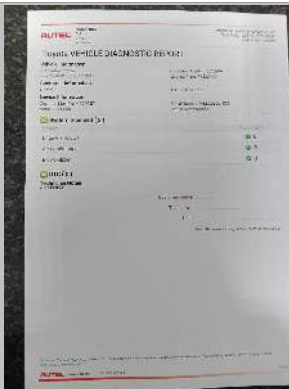

Diagnostic report



AAPV Vin



Seat Front Left



Seat Front Right



Seat Rear



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:
2017304626
DATE
29/09/2026



Radio/CD/USB



Bonnet



Front Bumper



Front Fender Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:

2017304626

DATE

29/09/2026



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:
2017304626
DATE
29/09/2026



Rear bumper



Rear bumper



Rear bumper



Rear Fender Right



Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061



CONDITION REPORT



Report No:
2017304626
DATE
29/09/2026



Side Mirror Right



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0182620711061