



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/05/2026		M57 Pretoria Road - 1619
Inspection Date	13/05/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	NONE
Model	TUCSON 2.0 ELITE AT [2016-2018]	Register Number	
VIN	AAPV0202500705193	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	BLACK	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT UNI
Km Reading	125,795 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026

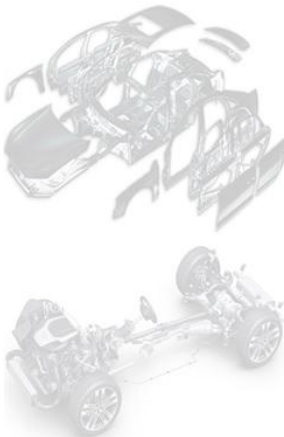	Damage	Repair Way
	Engine Oil Sweat Seat Front Right Torn / Cut Door Sealing Rubber Front Right Damaged Front Fender Left Paintwork • Scratched Rear Fender Left Dented Door Rear Left Paintwork • Scratched Boot Lid / Hatch door Residual Traces of Repair Rear bumper Damaged Inner Boot Floor Pan and Spare Wheel Well Damaged Tyre Front Left Damaged Tyre Front Right Worn Engine Noise Excessive Rear right door doesn't open	Repair Repair Replace Repair Repair Repair Repair Repair Replace Replace Replace Repair Repair

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	4.15	4.35	-	
Rear	2.79	2.72	-	
Emergency / Parking	2.13	1.87	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/55Z R18	102W	Windforce	Catchfors	V	0922	3 mm
Front Right	225/55 R18	98H	Kumho	Solus	V	4919	0 mm
Rear Left	225/55 R18	98H	Kumho	Solus	V	1221	3 mm
Rear Right	225/55 R18	98H	Kumho	Crugen	V	5217	5 mm
Spare	225/60 R17	99H	Yeadar	Radial	V	2223	8 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1748:00	FRONT PASSENGER PRESSURE SIDE IMPACT SENSOR(P-SIS)	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.AAPV0202500705193VIN NUMBER STAMPED ON VEHICLE.LICENCE DISK VIN DOES NOT MATCH AAPV VIN NUMBER.Body • Exterior: Residual traces of repair on some body panels.Stone chips and spray work on some body panels.Some body panels misaligned.Dents and scratches on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026



Automatic Transmission



Oil cap and dipstick




Front chassis



Rear chassis



Spare wheel and Accessories

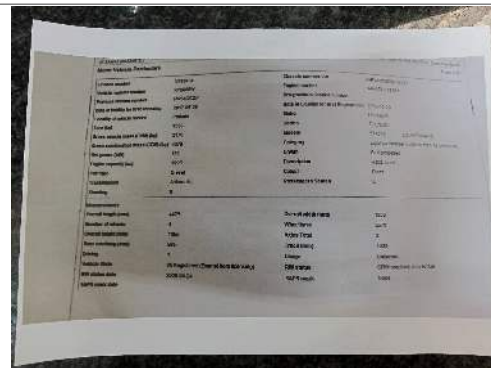

174 Form

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026

[illegible]

Brake and shock absorber repor

[illegible]

Diagnostic report page 1

1. Name: _____ 2. Address: _____ 3. City: _____ 4. State: _____ 5. Zip: _____ 6. Phone: _____ 7. E-mail: _____ 8. Date: _____ 9. Signature: _____ 10. Print Name: _____	11. Name: _____ 12. Address: _____ 13. City: _____ 14. State: _____ 15. Zip: _____ 16. Phone: _____ 17. E-mail: _____ 18. Date: _____ 19. Signature: _____ 20. Print Name: _____
--	---

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026



ENGINE 1



Seat Front Right



Seat Front Right



Door Sealing Rubber Front Right



Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026

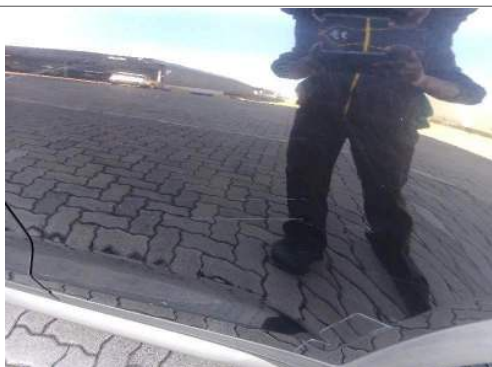

Door Rear Left



Front Fender Left



Front Fender Left



Boot Lid / Hatch door



Water level



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193



CONDITION REPORT



Report No:
2017235744
DATE
13/05/2026



Rear bumper



Tyre Front Left



Tyre Front Right



Engine



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0202500705193