



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

| | | | |
|-----------------|-------------------|---------------------|--------------------------|
| Client | MFC Auction House | Inspection Location | MFC |
| Requested Date | 17/01/2024 | | M57 Pretoria Road - 1619 |
| Inspection Date | 17/01/2024 | | Kempton Park - GT |

Vehicle Data

| | | | |
|-----------------|-------------------|-------------------------|-------------------|
| Vehicle Type | PASSENGER VEHICLE | Registered Owner | MFC AUCTION HOUSE |
| Manufacturer | RENAULT | Registration Number | CJ05HZGP |
| Model | SANDERO | Register Number | |
| VIN | AAPV0342010672620 | Date Of First Licensing | |
| Engine Number | | Last COR | |
| Doors | 5 | License Expiry Date | 31/10/2023 |
| Color | BLUE | Power / Displacement | |
| Year Model | | Paint Finish | TWO COAT METALLIC |
| Km Reading | 64,230 KM | Fuel | PETROL |
| Cab / Body Type | HATCHBACK | Transmission | MANUAL |

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

| Damage | Repair Way |
|---|------------|
| Engine Oil Sweat | Repair |
| Engine Wiring Defective | Repair |
| Tail Light Left Scratched | Repair |
| Headlight Right Scratched | Repair |
| Seat Front Right Damaged | Repair |
| Seat Rear Dirty | Repair |
| Hood Lining Dirty | Repair |
| Door Panel Front Left Defective | Repair |
| Door Panel Rear Left Defective | Repair |
| Parcel Tray Missing | Replace |
| Side Mirror Left Paintwork • Scratched | Repair |
| Side Mirror Right Paintwork • Scratched | Repair |
| Front Bumper Damaged | Repair |
| Bonnet Dented | Repair |
| Bonnet slam plate (Shock tower/ Inner tray) Damaged | Repair |
| B • Pillar Left Defective | Repair |
| B • Pillar Right Defective | Repair |
| Front Fender Left Paintwork • Scratched | Repair |
| Front Fender Right Paintwork • Scratched | Repair |
| Door Front Left Dented | Repair |
| Door Front Right Paintwork • Scratched | Repair |
| Door Rear Left Paintwork • Scratched | Repair |
| Boot Lid / Hatch door Paintwork • Scratched | Repair |
| Rear bumper Paintwork • Scratched | Repair |
| Inner Boot Floor Pan and Spare Wheel Well Defective | Repair |
| Sill Panel Right Paintwork • Scratched | Repair |
| Shock Absorber Front Left Sweat | Replace |
| Rim Rear Left Dented | Repair |
| Chassis Dented | Repair |

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAPV0342010672620

1 / 14



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

| Damage | Repair Way |
|-----------------------|------------|
| Belly plates Damaged | Replace |
| Jack Missing | Replace |
| Wheel Spanner Missing | Replace |
| Triangle Missing | Replace |

Brakes

Brake Test Results

| | Left | Right | Axle Weight [KG] | Deceleration [m/s ²] |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
| | Braking Force [KN] | Braking Force [KN] | | |
| Front | 2.72 | 2.95 | - | |
| Rear | 2.1 | 2.4 | - | |
| Emergency / Parking | 1.37 | 1.81 | - | |

Tyres and Rims

Tyre Specification & Measurement

| | Size | Load/Speed Index | Manufacture | Model | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|--------------|-------|-----------------|------------------|
| Front Left | 205/55 R16 | 91H | Continental | Contipremuim | V | 1019 | 5 mm |
| Front Right | 205/55 R16 | 91H | Continental | Contipremuim | V | 1019 | 6 mm |
| Rear Left | 205/55 R16 | 91H | Continental | Contipremuim | V | 1019 | 2 mm |
| Rear Right | 205/55 R16 | 91V | Continental | Contipremuim | V | 1019 | 4 mm |

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code | Description | Status |
|----|-----------|-----------|---------------------------------------|--------|
| 1 | INJECTION | DTC001013 | CAMSHAFT SHIFTER CIRCUIT OPEN CIRCUIT | |

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: VEHICLE HAS AN AAPV0342010672620 STAMPED ON FRONT LEFT SHOCK TOWER WHICH IS THE VIN MATCHING THE ONE ON THE LICENSE DISK. Electrical Components and Instruments: Radio need code to operate. Vehicle electronics malfunctioning. Central locking system fault

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

VIN: AAPV0342010672620

DATE

17/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE: 17/01/2024
VIN: AAPV034210017001
4 / 14



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

VIN: AAPV0342010672620

5 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

VIN: AAPV0342010672620

6 / 14



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

VIN: AAPV0342010672620
7 / 14


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

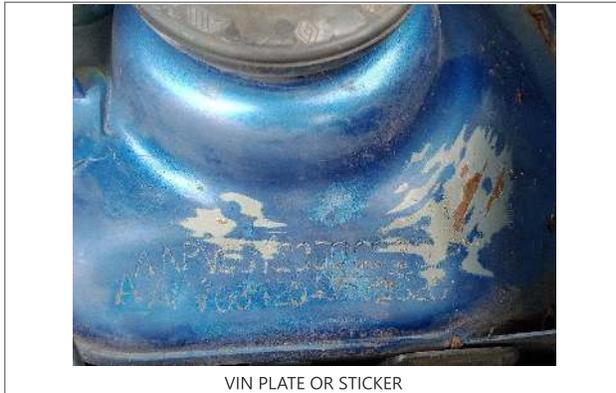

VIN PLATE OR STICKER

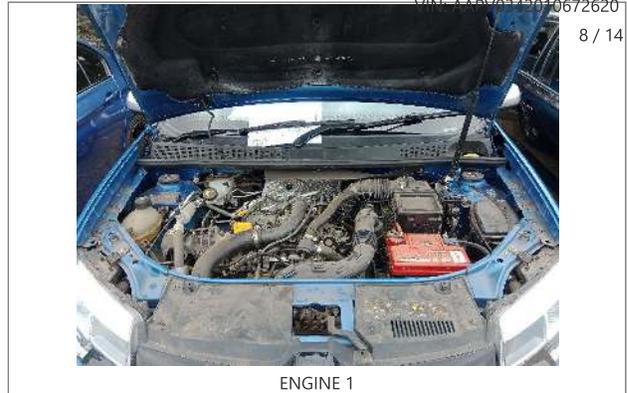

ENGINE 1

VIN: 1A8V0312010672620
8 / 14



Front chassis



Rear chassis



Manual Transmission



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

VIN: AAPV0342010672620

9 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024




Hood Lining



Front Bumper



Front Bumper

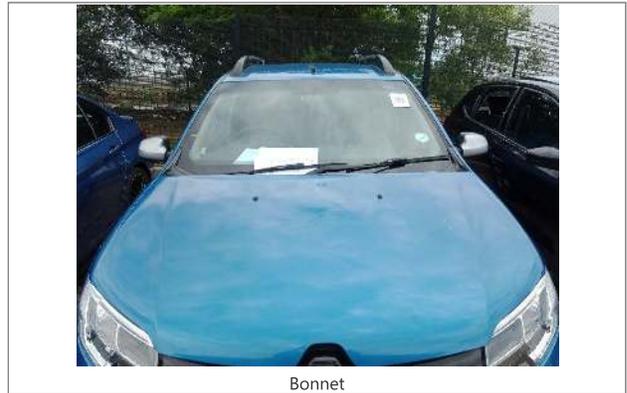

Bonnet



Headlight Right



Bonnet slam plate (Shock tower/ Inner tray)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

VIN: AAPV0342010672620
11 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024



Bonnet slam plate (Shock tower/ Inner tray)



Water level

VIN: AAP... 2010672620
12 / 14



Water level



Engine Wiring



Seat Front Right



B • Pillar Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

VIN: AAPV0342010672620
13 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024



Sill Panel Right



Sill Panel Right



Seat Rear



Door Front Right



Side Mirror Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024



Rear bumper



Rear bumper



Tail Light Left



Boot Lid / Hatch door



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024



Front Fender Left



Side Mirror Left



Door Panel Rear Left



Seat Rear



Door Panel Front Left



B • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024



B • Pillar Left



Inner Boot Floor Pan and Spare Wheel Well



Parcel Tray



Shock Absorber Front Left



Engine



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024



Belly plates



Rim Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232102

DATE
17/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za