



CONDITION REPORT



Report No:
2017304588
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LL21TVGP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2023-2024]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6R7RU002587	Last COR	
Engine Number		License Expiry Date	31/10/2026
Doors	5	Power / Displacement	
Color	RED	Paint Finish	M - METALLIC
Year Model	2023	Fuel	PETROL
Km Reading	159,967 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6R7RU002587



CONDITION REPORT



Report No:

2017304588

DATE

29/09/2026

Damage

Repair Way

Dim Light Left Malfunction	Repair
Side Mirror Left Cracked	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Right Dented	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Antenna damage	Replace
Front tyres size differs	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	2.9	-	
Rear	1.2	1.8	-	
Emergency / Parking	0.4	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R14	82H	Goodyear	Efficient gr	V	3423	3 mm
Front Right	185/65R15	88H	Goodyear	Duragrip	V	2416	2 mm
Rear Left	185/60R15	88H	Autogreen	Smart chaser	V	4724	1 mm
Rear Right	185/60R15	88H	Autogreen	Smart chaser	V	4724	2 mm
Spare	185/60R15	88H	Autogreen	Smart chaser	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za

VIN: AAVZZ6R7RU002587



CONDITION REPORT



Report No:
2017304588
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE SPORADIC	U101100	SUPPLY VOLTAGE VOLTAGE TOO LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6R7RU002587



CONDITION REPORT




Report No:


2017304588

DATE

29/09/2026

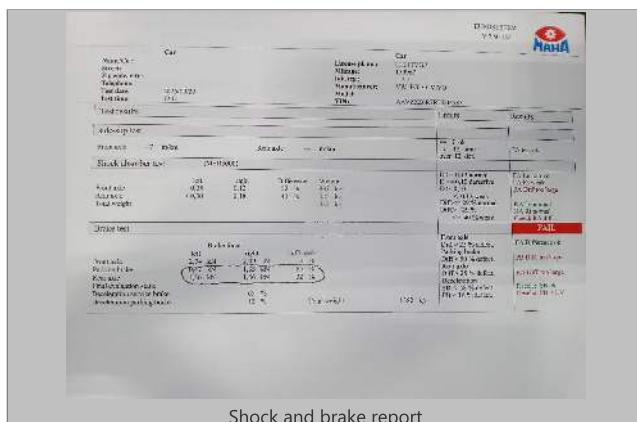

Shock and brake report

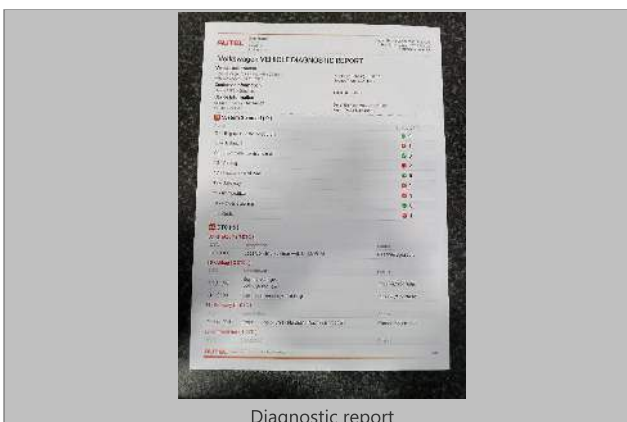


Diagnostic report




Diagnostic report



FRONT RIGHT CORNER

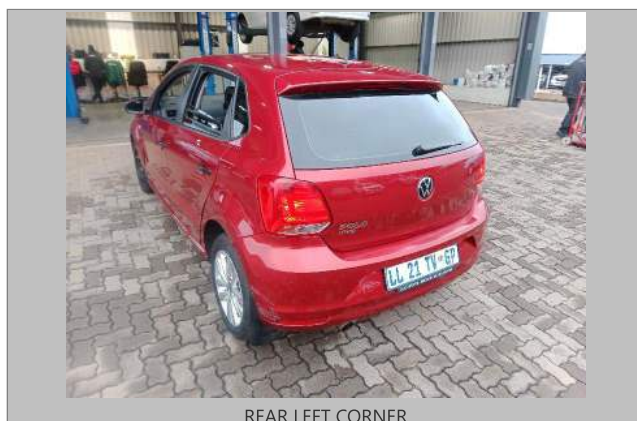

REAR LEFT CORNER

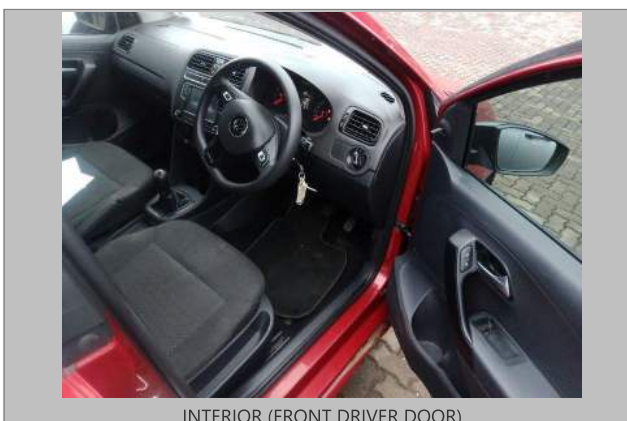

INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6R7RU002587



CONDITION REPORT



Report No:

2017304588

DATE


29/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

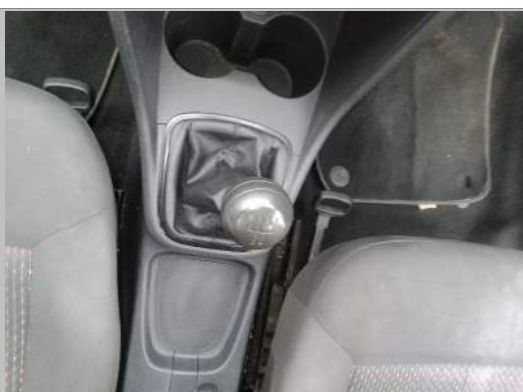

Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6R7RU002587



CONDITION REPORT



Report No:
2017304588
DATE
29/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel fitted

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6R7RU002587



CONDITION REPORT



Report No:

2017304588

DATE

29/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Expenditure bottle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6R7RU002587




CONDITION REPORT




Report No:
2017304588
DATE
29/09/2026

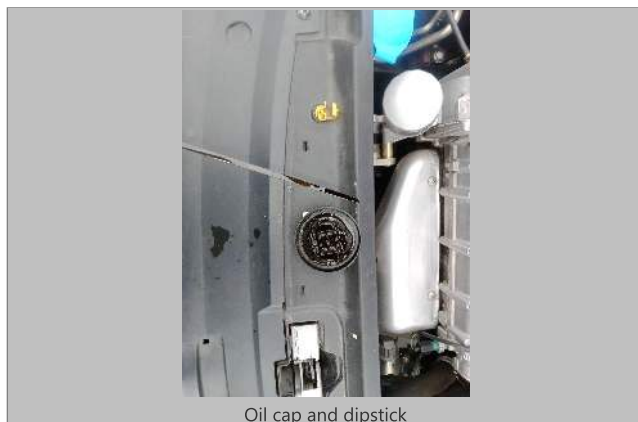


Oil cap and dipstick

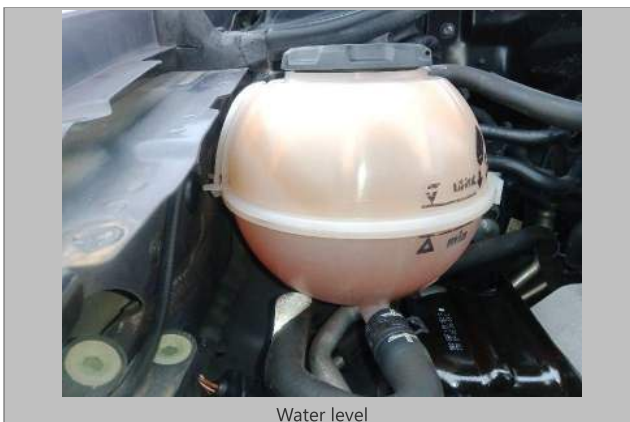


Water level

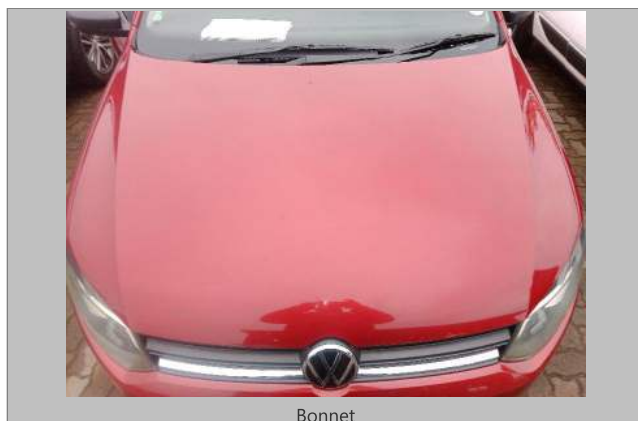

Bonnet

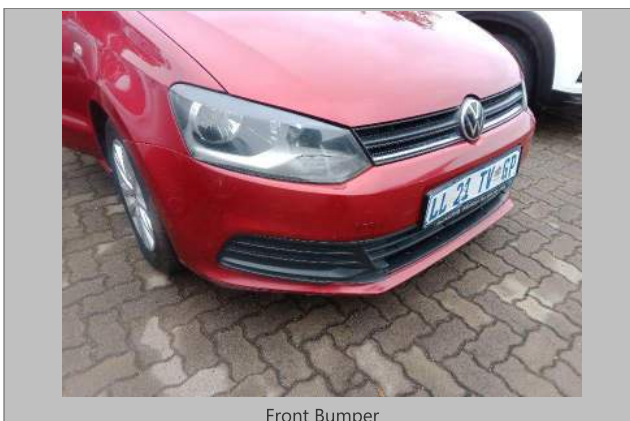

Front Bumper

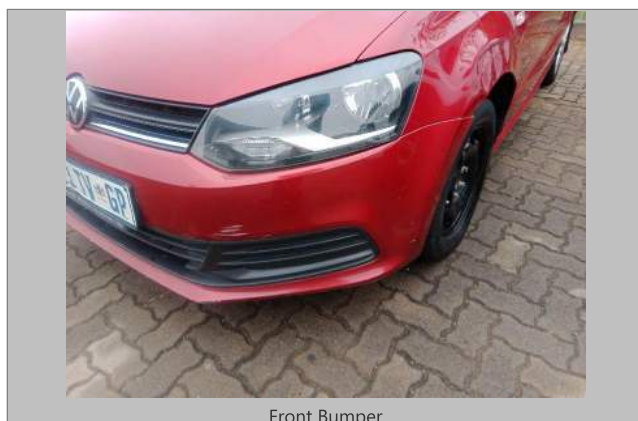

Front Bumper



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6R7RU002587



CONDITION REPORT



Report No:
2017304588
DATE
29/09/2026



Dim Light Left

Test time:	12:01	Model:	AAVZ
Test results	VIN: AAVZZ67RU002587		
side-slip test			
Front axle	- 7 m/km	Rear axle	- m/km
Shock absorber test (MSD3000)			
	left	right	Difference
Front axle	0,23	0,12	52 %
Rear axle	> 0,30	0,15	40 %
Total weight			1362 kg
Brake test			
	Brake test		
	left	right	Difference
Front axle	2,74 kN	2,99 kN	8 %
Parking brake	0,27 kN	1,33 kN	65 %
Rear axle	1,26 kN	1,86 kN	32 %
Final evaluation static			65 %
Deceleration service brake			13 %
Deceleration parking brake			13 %
			Total weight 1362 kg

Parking Brake Performance

Test time:	12:01	CHASSIS:	VIN:	AA
Test results				
side-slip test				
Front axle	-7 m/km	Rear axle	-- m/km	
Shock absorber test (MSD3000)				
	left	right	Difference	Weight
Front axle	0,23	0,12	52 %	837 kg
Rear axle	> 0,30	0,15	40 %	545 kg
Total weight				1382 kg
Brake test				
	Brake force		Difference	
	left	right		
Front axle	2,74 kN	2,99 kN	8 %	
Parking brake	0,27 kN	1,33 kN	65 %	
Rear axle	1,26 kN	1,86 kN	32 %	
Final evaluation static			65 %	
Deceleration service brake			13 %	Total weight
Deceleration parking brake				

Service Brake Performance Rear Axle



Door Rear Right



Door Front Right



Front Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ67RU002587



CONDITION REPORT




Report No:
2017304588
DATE
29/09/2026




Door Front Left




Door Rear Left

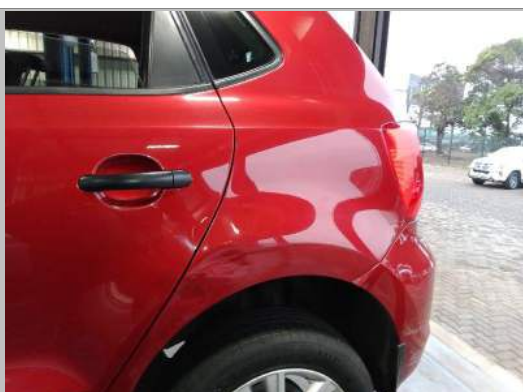

Rear Fender Left

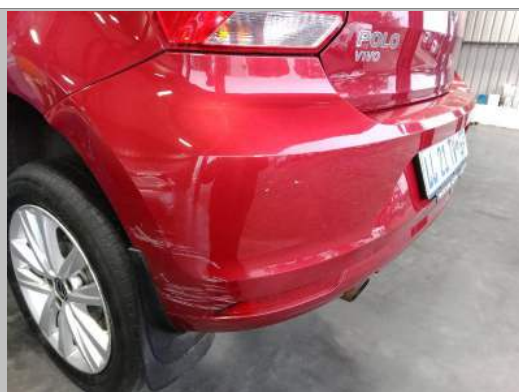

Rear bumper

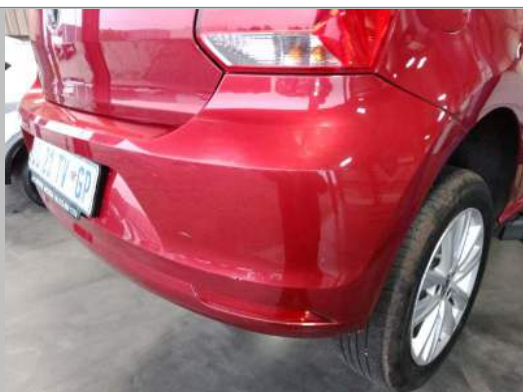

Rear bumper



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6R7RU002587

**CONDITION REPORT**

Report No:
2017304588
DATE
29/09/2026



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6R7RU002587