



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/05/2024		M57 Pretoria Road - 1619
Inspection Date	10/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	HR37RBGP
Model	POLO VIVO	Register Number	
VIN	AAVZZZ6RZJU017982	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2024
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	173,489 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Switch Electrical Window Winder front right Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Front Bumper Residual Traces of Repair	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Residual Traces of Repair	Repair
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Alignment Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Right Excessive Wear & Tear	Replace
Rim Front Left Damaged	Repair
Engine Noise Idling / Hunting	Repair
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches and stone chips on some body
Front tyre size differs	Replace.
Rear tyre size differs	Replace.
Body exterior	Body panels misaligned

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZJU017982

1 / 13



CONDITION REPORT

Report No: 2016372169

 DATE
10/05/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.3	-	
Rear	1.4	1.4	-	
Emergency / Parking	1	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	84T	Tracmak	Privilo	V	3321	1 mm
Front Right	185/65R14	86H	Goodyear	Duragrip	V	4310	1 mm
Rear Left	175/65R14	82T	Winrun	R330	V	2923	3 mm
Rear Right	175/70R14	84T	Tracmak	Privilo	V	3321	5 mm
Spare	185/60R14	82H	Continental	Contact	V	/////	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	56-RADIO (3 DTCS)	01044:000	CONTROL MODULE INCORRECTLY CODED	

Inspection Conditions

No Test Drive
 Vehicle doesn't start
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. RESIDUAL TRACES OF REPAIR WORK DONE ON SOME BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za




CONDITION REPORT

Report No: 2016372169


2 / 13

DATE


10/05/2024

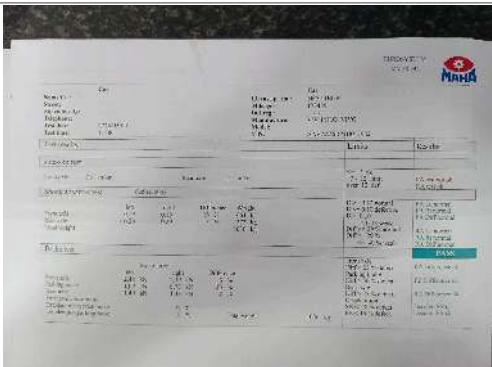

Shock and brake report

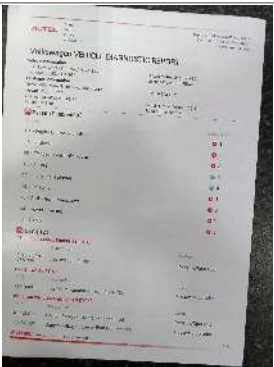

Diagnostic report

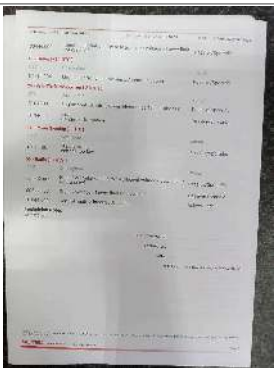

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

VIN: AAVZZZ6RZJU017982

DATE

10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
VIN: AAVZZZ6R0Y0000000
10/05/2024
4 / 13



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

VIN: AAVZZZ6RZJU017982

5 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

VIN: AAVZZZ6RZJU017982

6 / 13



90 DEGREE LEFT




LF TYRE TREAD



RF TYRE TREAD



RR TYRE TREAD

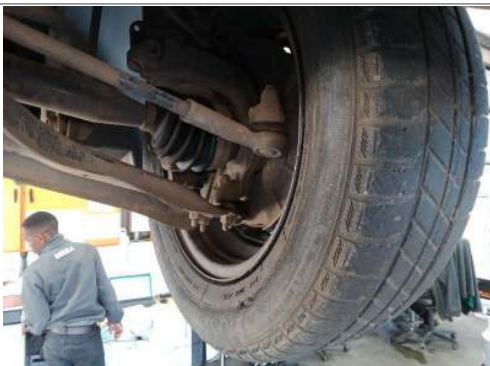

LR TYRE TREAD



Sparewheel



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

VIN: AAVZZZ6RZJU017982
7 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024



LICENSE DISC




VIN PLATE OR STICKER



ENGINE 1



ENGINE 2

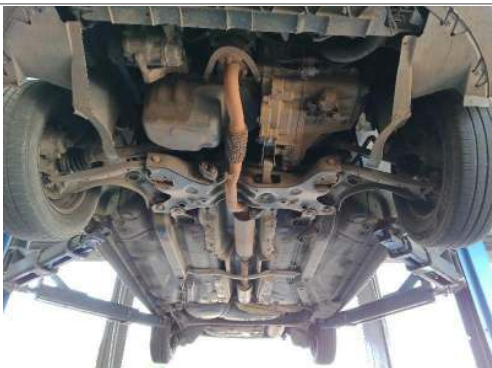

CHASSIS



Rear end

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

VIN: AAVZZZ6RZJU017982
9 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

Oil cap and dipstick



Oil cap and dipstick



Water level



Engine



Seat Front Right



Seat Front Left



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

VIN: AAVZZZ6RZJU017982

11 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

Switch Electrical Window Winder front right



Switch Electrical Window Winder front right

VIN: AAYZZ6RZJU017982
12 / 13

Windscreen



Front Fender Right



Door Front Right



Tyre Front Right



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

VIN: AAVZZZ6RZJU017982
13 / 13

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

Control Arm Bush(es) Front Axle Right



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Control Arm Bush(es) Front Axle Left



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

Door Front Left



Door Rear Left



Rear bumper



Rear bumper



Rear bumper



Door Front Right



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

Door Front Right




Door Rear Right



Rim Front Left



Engine

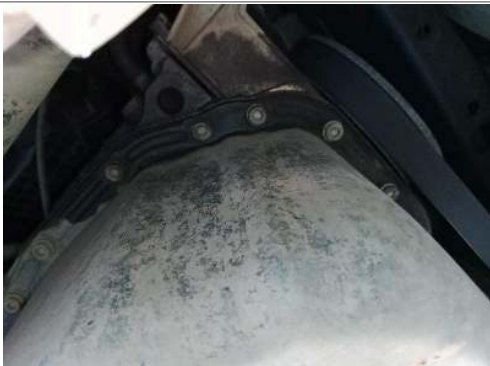

Engine



Bonnet



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016372169

DATE
10/05/2024

Bonnet



Bonnet

**CONDITION REPORT****Report No: 2016372169****DATE**
10/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za