

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/12/2023		M57 Pretoria Road - 1619
Inspection Date	08/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	JP74CHGP
Model	POLO VIVO	Register Number	
VIN	AAVZZZ6RZKU001867	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/07/2022
Color	GREY	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	108,278 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Headlight Left Damaged	Replace
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Rear bumper Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Worn	Replace
Radiator Cradle Damaged	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.45	2.47	-	
Rear	1.63	1.49	-	
Emergency / Parking	1.16	1.06	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Firestone	Radial	V	3018	0 mm
Front Right	185/60R15	84T	Goodyear	radial	V	3020	0 mm
Rear Left	195/60R15	88H	Dunlop	Sp	V	3721	0 mm
Rear Right	195/60R15	88H	Radar	Radial	V	4419	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CHASSIS REAR



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD

VIN: AAVZZZ6RZKU001867

7 / 9

VIN: AAVZZZ6RZKU001867

8 / 9



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Water level

VIN: AAVZZZ6RZKU001867

9 / 9



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Rear bumper



Rear bumper




Door Front Right



Front Fender Right



Seat Front Right

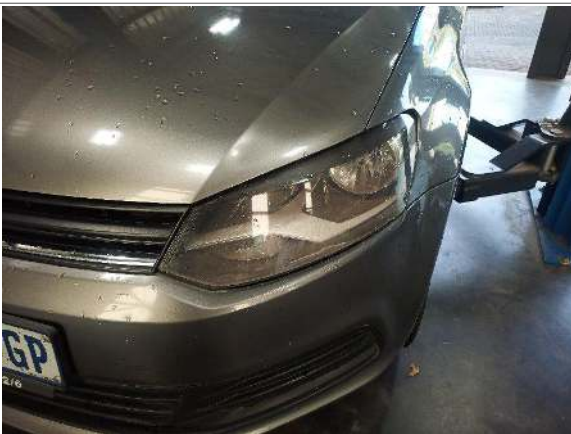

Headlight Left



Tyre Rear Left



Tyre Rear Right



Tyre Front Left



Tyre Front Right



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za