



CONDITION REPORT

Report No: 201656799

DATE  
10/10/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/10/2024		M57 Pretoria Road - 1619
Inspection Date	10/10/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	HR98MKGP
Model	POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2018-2020]	Register Number	
VIN	AAVZZZ6RZKU004329	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2023
Color	SILVER	Power / Displacement	
Year Model	2018	Paint Finish	TWO COAT METALLIC
Km Reading	125,339 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Radiator Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Damaged	Replace
Engine to silencer pipe Damaged	Replace
Gearbox Damaged	Replace
Radiator Cradle Damaged	Replace
Engine	Battery loose
Body and exterior	Signs of impact damage to front of vehicle.
Body and exterior	bonnet struggles to open.
Body and exterior	Minor dents and scratches and stone chips.
Body and exterior	Signs of repair work done to somebody panels.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZKU004329



## CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

Damage	Repair Way
Body and exterior	Poor alignment to somebody panels.
Body and exterior	Repair work done to vehicle below standard.
Body and exterior	Vehicle body and poor condition.
gearbox	big piece of gearbox broken off
Cluster	engine management light intermittent

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	2.62	2.7	-	
Rear	1.3	1.33	-	
Emergency / Parking	1.18	0.9	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	84H	Continental	Conti	V	0917	0 mm
Front Right	195/50R15	82v	Tracmax	Radial	V	1921	0 mm
Rear Left	185/60R15	84H	Continental	Contipremium	V	2115	2 mm
Rear Right	185/60R15	84H	Continental	Contipremium	V	3618	2 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BRAKES 1	U101100	SUPPLY VOLTAGE VOLTAGE TOO LOW	

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
 www.dekraauto.co.za




CONDITION REPORT

VIN: AAVZ776RZK1004370  
Report No: 2016565799


2 / 12

DATE


10/10/2024

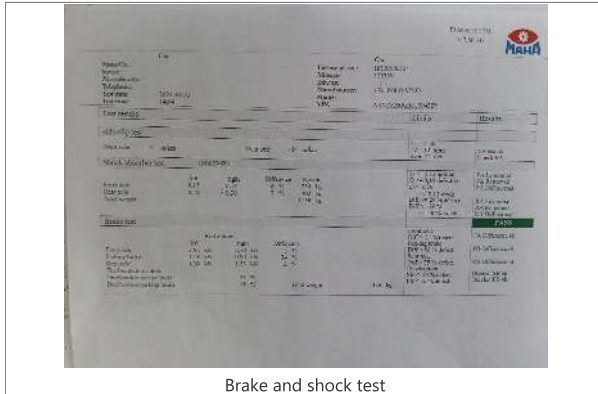


Brake and shock test

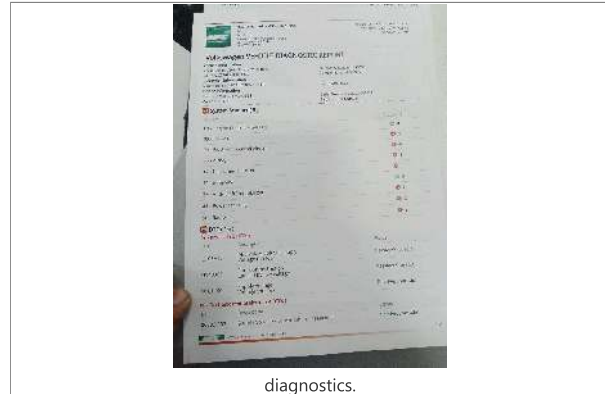

diagnostics.

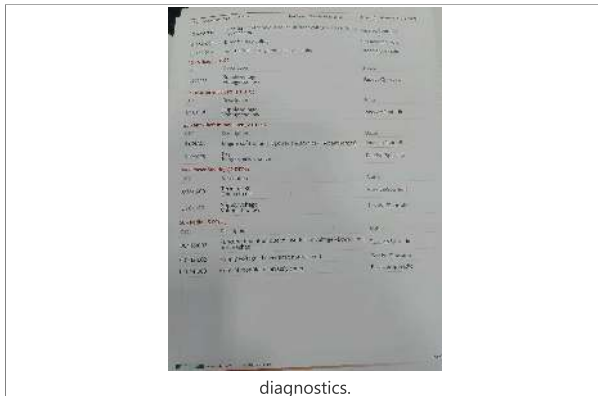

diagnostics.

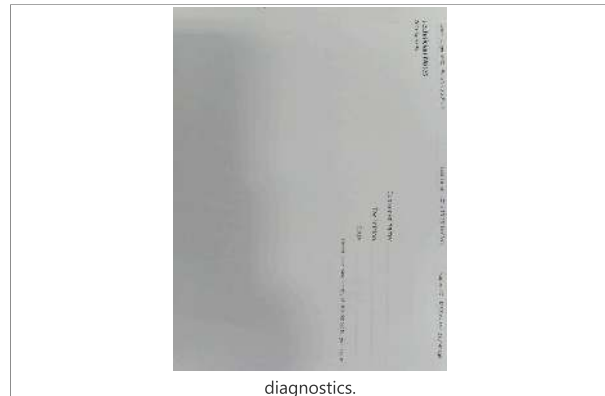

diagnostics.



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016565799**  
VIN: AAVZZZ6RZKU004329  
DATE  
10/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE 10/10/2024  
VIN: AAVZZZ6RZKU00339  
4/12



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



manual.



90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE

10/10/2024

VIN: AAVZZZ6RZKU004329

5 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

VIN: AAVZZZ6RZKU004329

6 / 12



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

VIN: AAVZZZ6RZKU004329

7 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024



LICENSE DISC




VIN PLATE OR STICKER




ENGINE 1



undercarriage front.

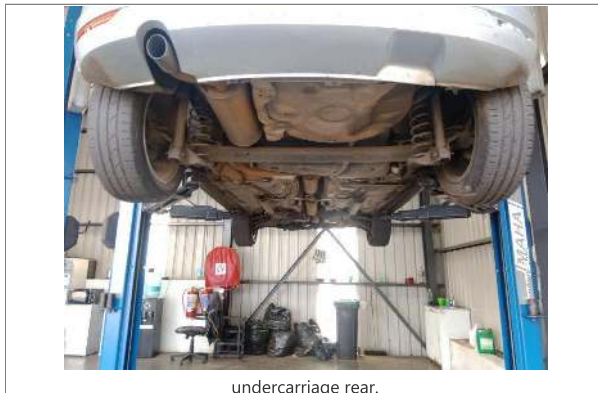

undercarriage rear.

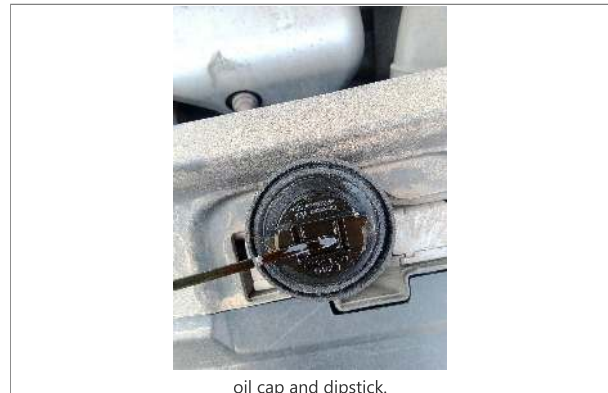

oil cap and dipstick.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

VIN: AAVZZZ6RZKU004329

9 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024



Water level




Headlight Left


VIN: AAVZZZ6RZKU004329  
10 / 12



Headlight Right

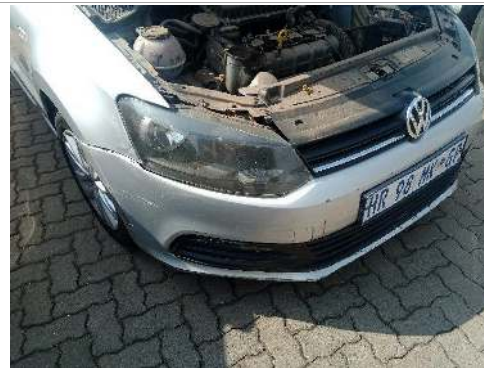

Front Bumper

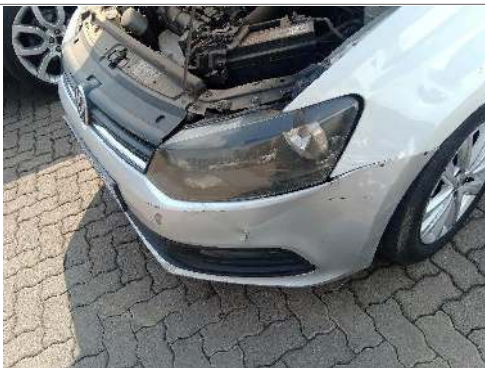

Front Bumper



Front Fender Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

VIN: AAVZZZ6RZKU004329

11 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024



Bonnet



Door Rear Left

VIN: AAV7...ZKU004329  
12 / 12




Rear Fender Left



Rear bumper



Rear bumper

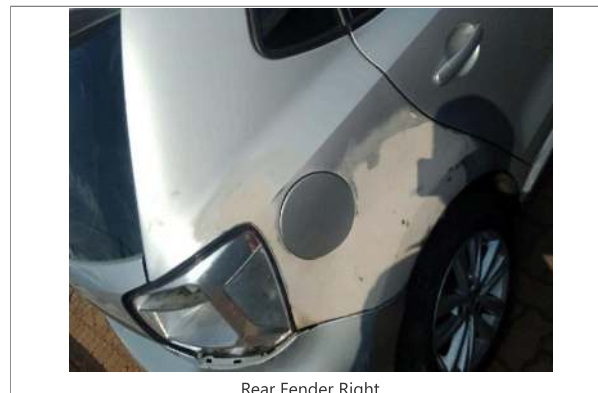

Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024



Front Fender Right



Door Front Right



Tail Light Right



Side Mirror Right



Side Mirror Left



Windscreen

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za









CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

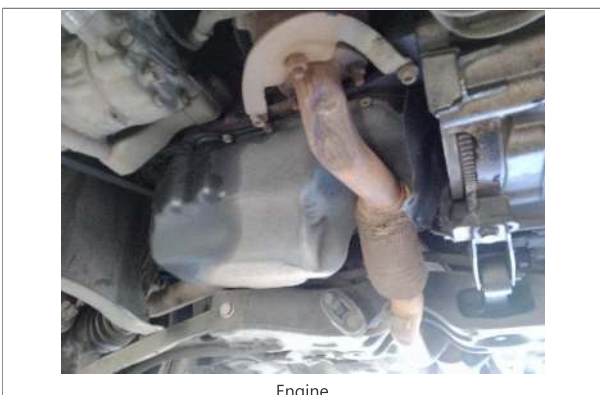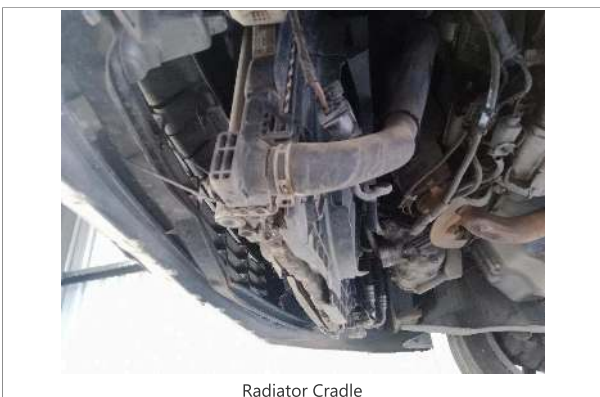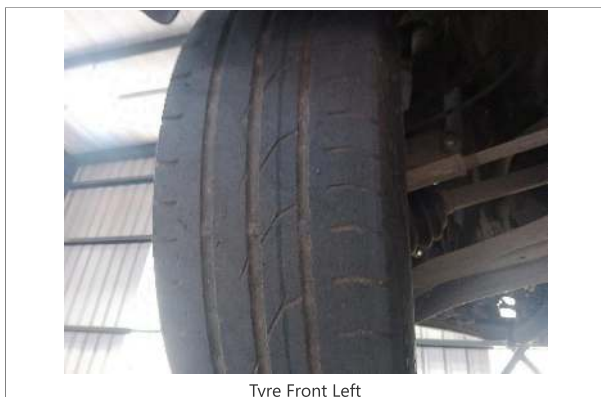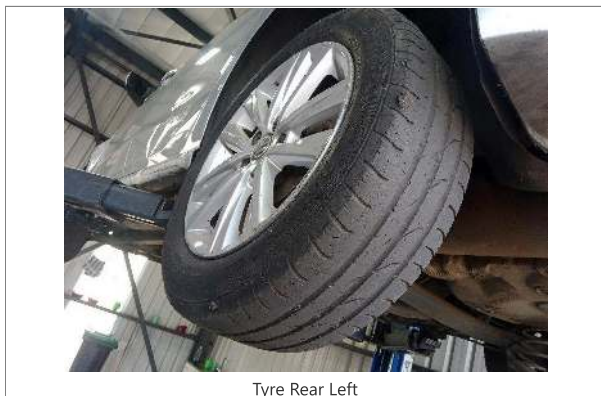

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016565799

DATE  
10/10/2024

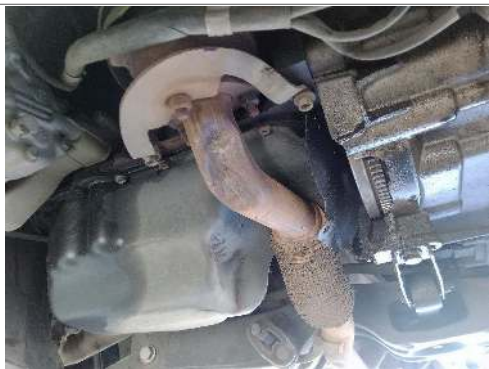

Engine to silencer pipe



Radiator

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016565799**

**DATE**  
**10/10/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za