



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	07/09/2026		M57 Pretoria Road - 1619
Inspection Date	07/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	CB55HNZN
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2018-2020]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZKU010620	Last COR	
Engine Number		License Expiry Date	30/11/2026
Doors	5	Power / Displacement	
Color	SILVER	Paint Finish	M - METALLIC
Year Model	2018	Fuel	PETROL
Km Reading	113,627 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:

2017295334


DATE

07/09/2026

Damage

Repair Way

Window Winder rear left Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair

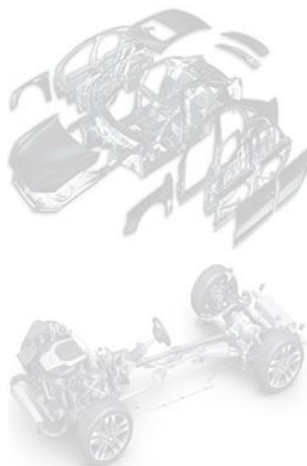

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	3.0	-	
Rear	1.3	1.1	-	
Emergency / Parking	1.1	1.2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R15	88H	Goodyear	Efficient gr	V	3423	3 mm
Front Right	185/60R15	88H	Goodyear	Efficient gr	V	3123	3 mm
Rear Left	185/60R15	88H	Goodyear	Efficient gr	V	3423	3 mm
Rear Right	185/60R15	88H	Goodyear	Efficient gr	V	3223	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE STATIC	01044:000	CONTROL MODULE INCORRECTLY CODED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:

2017295334

DATE

07/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026



INTERIOR (FRONT DRIVER DOOR)



Manual



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026



ENGINE 1



ENGINE 2



CHASSIS



Expection bottle



Oil cap and dipstick



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026



RF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



No spare wheel

Car				Car			
Name/Cell:	Vehicle ID:	License plate:	Year:	Name/Cell:	Vehicle ID:	License plate:	Year:
2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17
Test results				Test results			
Stability test				Stability test			
Stability test	Stability test	Stability test	Stability test	Stability test	Stability test	Stability test	Stability test
Shock absorber test				Shock absorber test			
Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test
Brake test				Brake test			
Brake test	Brake test	Brake test	Brake test	Brake test	Brake test	Brake test	Brake test

Shock and brake report

Car				Car			
Name/Cell:	Vehicle ID:	License plate:	Year:	Name/Cell:	Vehicle ID:	License plate:	Year:
2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17	2014/10/17
Test results				Test results			
Stability test				Stability test			
Stability test	Stability test	Stability test	Stability test	Stability test	Stability test	Stability test	Stability test
Shock absorber test				Shock absorber test			
Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test	Shock absorber test
Brake test				Brake test			
Brake test	Brake test	Brake test	Brake test	Brake test	Brake test	Brake test	Brake test

Diagnostic Report page 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZ6RZKU010620



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026

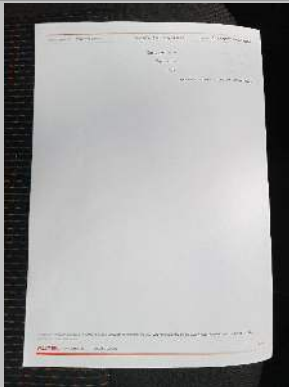

Diagnostic Report page 2



Water level



Bonnet



Window Winder rear left



Windscreen



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026



Door Rear Right



Front Fender Right



Front Bumper



Front Bumper



Door Front Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620



CONDITION REPORT



Report No:
2017295334
DATE
07/09/2026



Rear Fender Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZKU010620