



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/07/2025		M57 Pretoria Road - 1619
Inspection Date	28/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	FPP610L
Model	POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2020-2022]	Register Number	
VIN	AAVZZZ6RZMU016559	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2025
Color	WHITE	Power / Displacement	
Year Model	2021	Paint Finish	TWO COAT UNI
Km Reading	83,542 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025

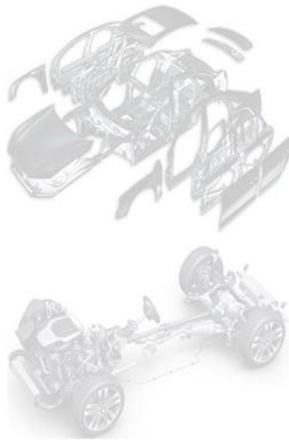

Damage	Repair Way
Center Console / Cubbyhole + Lid Damaged	Replace
Parcel Tray Damaged	Repair
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
C • Pillar Left Damaged	Repair
C • Pillar Right Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Boot Lid / Hatch door Hinge Left Damaged	Repair
Boot Lid / Hatch door Hinge Right Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Brake disc 1. Axle left Worn	Replace
Brake disc 1. Axle right Worn	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Worn	Replace
Radiator Cradle Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.37	2.4	-	
Rear	1.35	1.28	-	
Emergency / Parking	0.98	0.86	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/55R16	87V	Delmax	Radial	V	3524	3 mm
Front Right	195/55R16	87V	Autogrip	Radial	V	0325	3 mm
Rear Left	195/55R16	91V	Duratum	Radial	V	3519	0 mm
Rear Right	195/55R16	87H	Firestone	Radial	V	2622	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	RADIO	00856:011	ANTENNA, ON RADIO- OPEN CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to somebody panels. Repair work done to vehicle below standard. Vehicle body in poor condition. Poor alignment to somebody panels. Signs of impact damage to rear of vehicle.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025

Vehicle Data		Test Data		Results	
Make/Model	VW Polo	Engine	1.4 TSI	Transmission	Manual
Year	2016	Weight	1320 kg	Brake Type	Disc
Test Date	28/07/2025	Test Location	DEKRA	Test Result	Pass
Test Method	ISO 15855	Test Speed	100 km/h	Brake Distance	23.5 m
Test Result	Pass	Test Result	Pass	Test Result	Pass

Brake test.

Vehicle Data		Test Data		Results	
Make/Model	VW Polo	Engine	1.4 TSI	Transmission	Manual
Year	2016	Weight	1320 kg	Brake Type	Disc
Test Date	28/07/2025	Test Location	DEKRA	Test Result	Pass
Test Method	ISO 15855	Test Speed	100 km/h	Brake Distance	23.5 m
Test Result	Pass	Test Result	Pass	Test Result	Pass

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025




LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

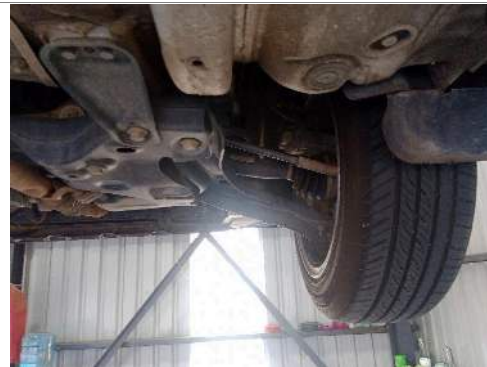

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025

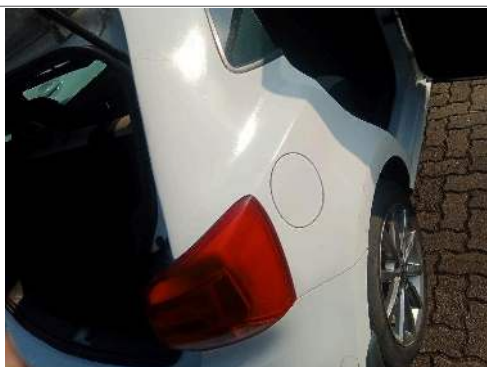

Rear Fender Right



C • Pillar Right



C • Pillar Left



Boot Lid / Hatch door Hinge Left



Boot Lid / Hatch door Hinge Right



Parcel Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025



Rear bumper



Rear bumper



Boot Lid / Hatch door



Roof



Door Rear Right



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025



Front Fender Right



Center Console / Cubbyhole + Lid




Side Mirror Right



Tyre Rear Left



Tyre Rear Right

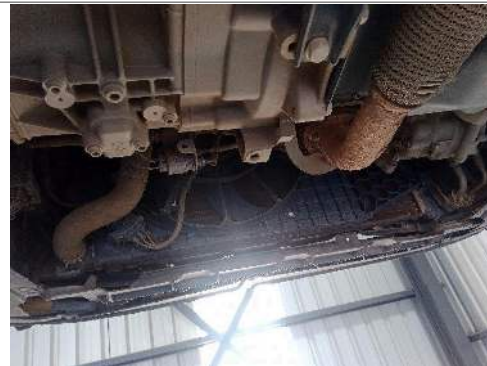

Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559



CONDITION REPORT



Report No:
2016960721
DATE
28/07/2025



Brake disc 1. Axle left



Brake disc 1. Axle right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZMU016559