



## CONDITION REPORT



Report No:  
2017294612  
DATE  
04/09/2026

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 04/09/2026        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 04/09/2026        |                     | Kempton Park -           |

## Vehicle Data

|                 |                                                 |                         |              |
|-----------------|-------------------------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE                               | Registered Owner        | MFC          |
| Manufacturer    | VOLKSWAGEN                                      | Registration Number     | LPL238MP     |
| Model           | POLO VIVO 1.4 63KW COMFORTLINE 5-DR [2021-2023] | Register Number         |              |
|                 |                                                 | Date Of First Licensing |              |
| VIN             | AAVZZZ6RZNU019248                               | Last COR                |              |
| Engine Number   |                                                 | License Expiry Date     |              |
| Doors           | 5                                               | Power / Displacement    |              |
| Color           | WHITE                                           | Paint Finish            | TWO COAT UNI |
| Year Model      | 2022                                            | Fuel                    | PETROL       |
| Km Reading      | 61,044 KM                                       | Transmission            | MANUAL       |
| Cab / Body Type | HATCHBACK                                       |                         |              |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZNU019248



## CONDITION REPORT




Report No:  
2017294612  
DATE  
04/09/2026

## Damage

## Repair Way

|                                             |        |
|---------------------------------------------|--------|
| Front Bumper Damaged                        | Repair |
| Front Fender Left Residual Traces of Repair | Repair |
| Door Rear Left Damaged                      | Repair |
| Rear bumper Paintwork • Scratched           | Repair |

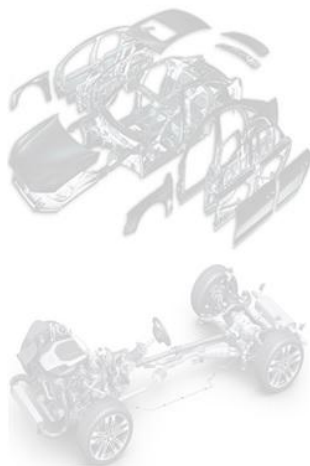

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.02               | 3.12               | -                |                                  |
| Rear                | 1.49               | 1.61               | -                |                                  |
| Emergency / Parking | 1.28               | 1.53               | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model       | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|-------------|-------|-----------------|------------------|
| Front Left  | 195/55R16 | 91V              | Continental | Contipremiu | V     | 2822            | 2 mm             |
| Front Right | 195/55R16 | 91V              | Continental | Contipremiu | V     | 3923            | 2 mm             |
| Rear Left   | 195/55R16 | 91V              | Continental | Contipremiu | V     | 2822            | 3 mm             |
| Rear Right  | 195/55R16 | 91V              | Continental | Contipremiu | V     | 2822            | 3 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZNU019248

**CONDITION REPORT**

Report No:  
2017294612  
DATE  
04/09/2026

**Diagnostic**

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

**Inspection Conditions**

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: AAVZZZ6RZNU019248




## CONDITION REPORT




Report No:  
2017294612  
DATE  
04/09/2026

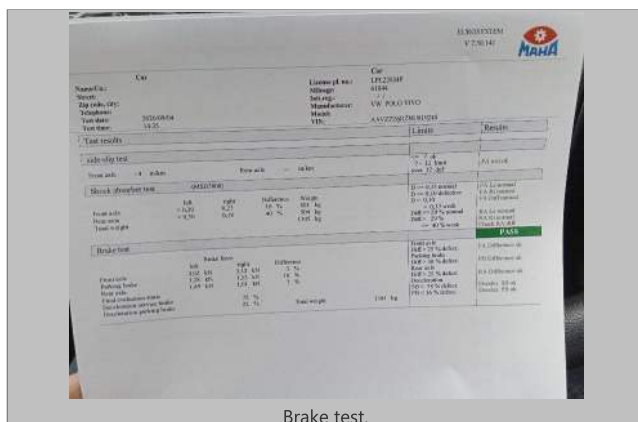

Brake test.

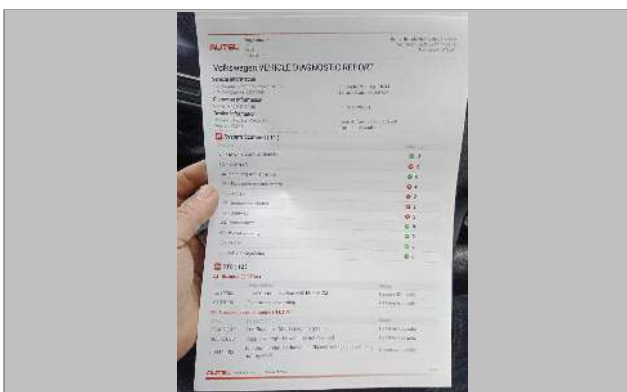

Diagnostic.

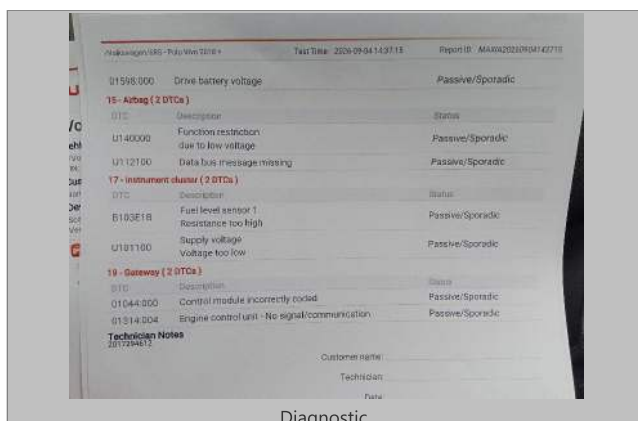

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZNU019248



## CONDITION REPORT



Report No:  
2017294612  
DATE  
04/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: AAVZZZ6RZNU019248



## CONDITION REPORT



Report No:  
2017294612  
DATE  
04/09/2026



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



No license disc

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZNU019248



## CONDITION REPORT



Report No:

2017294612

DATE

04/09/2026



VIN PLATE OR STICKER



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZNU019248



## CONDITION REPORT



Report No:  
2017294612  
DATE  
04/09/2026



Front Bumper



Front Bumper



Front Fender Left



Door Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: AAVZZZ6RZNU019248