



CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/09/2026		M57 Pretoria Road - 1619
Inspection Date	22/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LF92DPGP
Model	POLO VIVO 1.4 55KW TRENDLINE 5-DR [2022-2024]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6RZPU014427	Last COR	
Engine Number		License Expiry Date	31/10/2026
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2023	Fuel	PETROL
Km Reading	85,129 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6RZPU014427



CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026

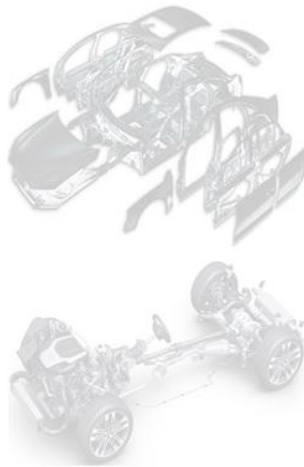

Damage	Repair Way
Windscreen Wiper Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Parcel Tray Damaged	Repair
Front Bumper Damaged	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Defective	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair
Chassis Dented	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Repair
Radiator Cradle Damaged	Replace
Front right shock absorber weak	Replace
Center exhaust cross member bracket dented	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.71	2.99	-	
Rear	1.26	1.16	-	
Emergency / Parking	0.91	0.76	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R14	82T	Autogrip	P308	V	3124	2 mm
Front Right	185/60 R14	82T	Autogrip	P308	V	3124	2 mm
Rear Left	185/60 R14	82H	Goodyear	Efficient	V	1023	3 mm
Rear Right	185/60 R14	82H	Goodyear	Efficient	V	1023	6 mm
Spare	185/60 R14	82H	Goodyear	Efficient	V	1023	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014427



CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P1603:00/05635:000	CTRL.MODULE FAULTY	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Residual traces of repair on body panels. Body panels misaligned. Stone chips and spray work on body panels. Dents and scratches on body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014427



CONDITION REPORT



Report No:

2017302239

DATE

22/09/2026

Vehicle Information			
Report No:	2017302239	Client:	MAHA
Vehicle No:	AAVZZ6RZPU014427	Make:	Volkswagen
Model:	POLO	Year:	2017
Engine:	1.4 TSI	Power:	110 kW
Transmission:	Manual	Drive:	Front
Test Results			
Test Name	Result	Unit	Status
Brake pad wear	100%	mm	Pass
Shock absorber	100%	mm	Pass
Wheel alignment	100%	mm	Pass
Steering rack	100%	mm	Pass
Brake master cylinder	100%	mm	Pass
Brake booster	100%	mm	Pass
Brake lines	100%	mm	Pass
Brake pads	100%	mm	Pass
Brake discs	100%	mm	Pass
Brake calipers	100%	mm	Pass
Brake hoses	100%	mm	Pass
Brake fluid	100%	mm	Pass
Brake master cylinder	100%	mm	Pass
Brake booster	100%	mm	Pass
Brake lines	100%	mm	Pass
Brake pads	100%	mm	Pass
Brake discs	100%	mm	Pass
Brake calipers	100%	mm	Pass
Brake hoses	100%	mm	Pass
Brake fluid	100%	mm	Pass

Brake and shock absorber report

Vehicle Information			
Report No:	2017302239	Client:	MAHA
Vehicle No:	AAVZZ6RZPU014427	Make:	Volkswagen
Model:	POLO	Year:	2017
Engine:	1.4 TSI	Power:	110 kW
Transmission:	Manual	Drive:	Front
Diagnostic Report			
Test Name	Result	Unit	Status
Engine oil level	100%	mm	Pass
Engine oil pressure	100%	mm	Pass
Engine oil temperature	100%	mm	Pass
Engine oil quality	100%	mm	Pass
Engine oil filter	100%	mm	Pass
Engine oil pump	100%	mm	Pass
Engine oil sump	100%	mm	Pass
Engine oil drain	100%	mm	Pass
Engine oil filler	100%	mm	Pass
Engine oil dipstick	100%	mm	Pass
Engine oil cap	100%	mm	Pass
Engine oil seal	100%	mm	Pass
Engine oil gasket	100%	mm	Pass
Engine oil pan	100%	mm	Pass
Engine oil filter	100%	mm	Pass
Engine oil pump	100%	mm	Pass
Engine oil sump	100%	mm	Pass
Engine oil drain	100%	mm	Pass
Engine oil filler	100%	mm	Pass
Engine oil dipstick	100%	mm	Pass
Engine oil cap	100%	mm	Pass
Engine oil seal	100%	mm	Pass
Engine oil gasket	100%	mm	Pass
Engine oil pan	100%	mm	Pass


Diagnostic report page 1

Vehicle Information			
Report No:	2017302239	Client:	MAHA
Vehicle No:	AAVZZ6RZPU014427	Make:	Volkswagen
Model:	POLO	Year:	2017
Engine:	1.4 TSI	Power:	110 kW
Transmission:	Manual	Drive:	Front
Diagnostic Report			
Test Name	Result	Unit	Status
Engine oil level	100%	mm	Pass
Engine oil pressure	100%	mm	Pass
Engine oil temperature	100%	mm	Pass
Engine oil quality	100%	mm	Pass
Engine oil filter	100%	mm	Pass
Engine oil pump	100%	mm	Pass
Engine oil sump	100%	mm	Pass
Engine oil drain	100%	mm	Pass
Engine oil filler	100%	mm	Pass
Engine oil dipstick	100%	mm	Pass
Engine oil cap	100%	mm	Pass
Engine oil seal	100%	mm	Pass
Engine oil gasket	100%	mm	Pass
Engine oil pan	100%	mm	Pass
Engine oil filter	100%	mm	Pass
Engine oil pump	100%	mm	Pass
Engine oil sump	100%	mm	Pass
Engine oil drain	100%	mm	Pass
Engine oil filler	100%	mm	Pass
Engine oil dipstick	100%	mm	Pass
Engine oil cap	100%	mm	Pass
Engine oil seal	100%	mm	Pass
Engine oil gasket	100%	mm	Pass
Engine oil pan	100%	mm	Pass

Diagnostic report page 2



FRONT RIGHT CORNER

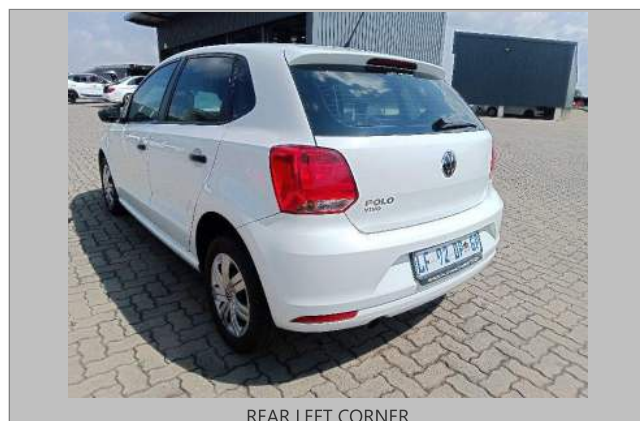

REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU014427



CONDITION REPORT



Report No:

2017302239

DATE

22/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU014427



CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026



90 DEGREE LEFT




LF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD

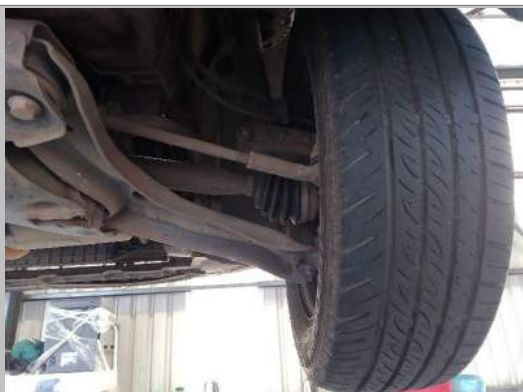

RF TYRE TREAD

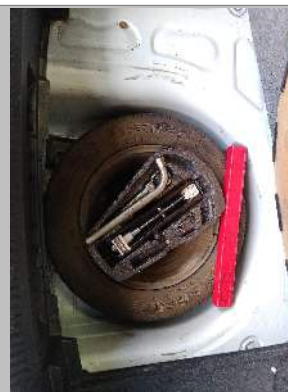

Spare Wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014427



CONDITION REPORT



Report No:

2017302239

DATE

22/09/2026



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Center exhaust cross member br

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZ6RZPU014427




CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026

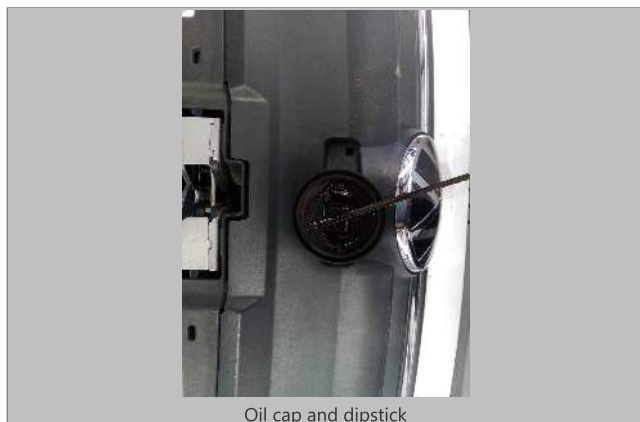

Oil cap and dipstick

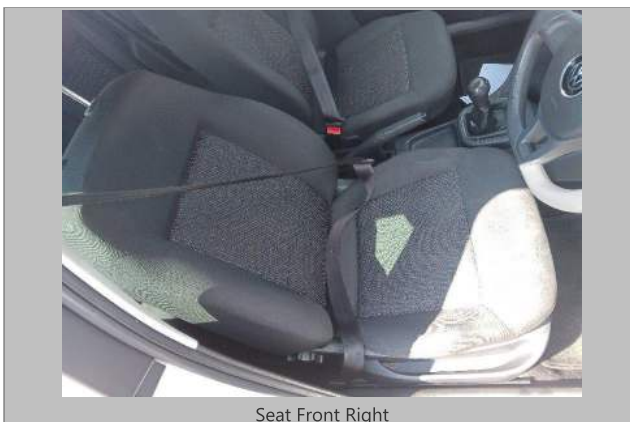

Seat Front Right




Seat Rear



Seat Front Left



Windscreen Wiper

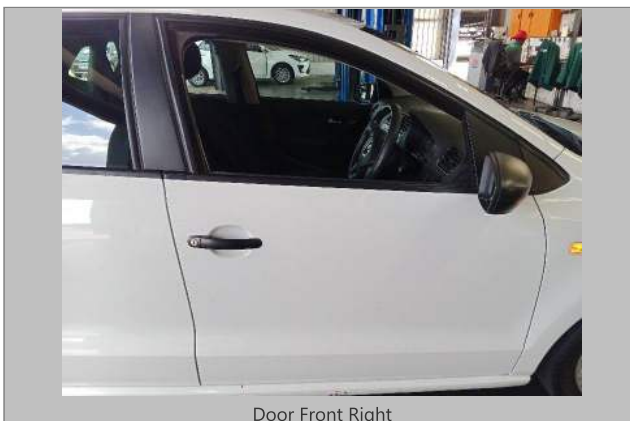

Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014427



CONDITION REPORT



Report No:

2017302239

DATE

22/09/2026



Door Front Right



Front Fender Right



Rear bumper



Rear bumper



Boot Lid / Hatch door



Parcel Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014427



CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026



Door Rear Left



Door Rear Left



Door Front Left



Front Fender Left



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU014427



CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026



Front Bumper



Front Bumper



Sill Panel Left



Sub Frame



Sub Frame



Radiator Cradle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6RZPU014427



CONDITION REPORT



Report No:
2017302239
DATE
22/09/2026



Belly plates



Chassis



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZPU014427