



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/07/2025		M57 Pretoria Road - 1619
Inspection Date	28/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	FBS863L
Model	POLO VIVO GP 1.6 77KW GTS 5-DR [2016-2018]	Register Number	
VIN	AAVZZZ6SZHU025429	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2026
Color	RED	Power / Displacement	
Year Model	2017	Paint Finish	TWO COAT UNI
Km Reading	148,230 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025

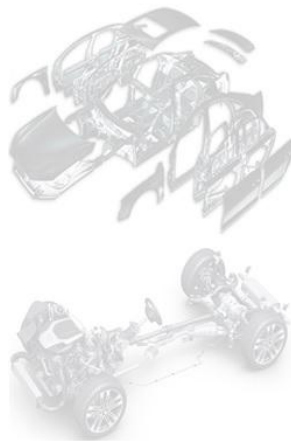

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Windscreen Wiper Missing	Replace
Air Conditioner Insufficient	Replace
Fog Light Front Left Damaged	Replace
Fog Light Front Right Defective	Repair
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Seat Belt Front Right Damaged	Replace
Parcel Tray Damaged	Replace
Clutch Pedal Rubber Missing	Replace
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Rocker Panel Left Damaged	Repair
Roof Dented	Repair
Windscreen Chipped	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Damaged	Replace
Tyre Front Right Damaged	Replace
Rim Front Left Scratched	Repair
Rim Front Right Dented	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Chassis Dented	Repair
Cross Member Rear Right Damaged	Repair
Sub Frame Damaged	Replace
Engine to silencer pipe Damaged	Repair
Silencer Missing	Replace
Belly plates Damaged	Repair
Fuel Tank Defective	Repair
Interior	OBD switch loose
Body and Exterior	Boot does not open
Engine	Brake booster reservoir damaged
Engine	Engine oil sump damaged
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025

Damage

Engine
Tyres and rims
Interior

Repair Way

Computer box loose
Front and rear tyre sizes different
Aftermarket sound fitted to vehicle

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.51	2.84	-	
Rear	1.62	1.55	-	
Emergency / Parking	1.3	0.61	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/45 R16	84V	Autogrip	Radial	V	1323	3 mm
Front Right	195/45 R16	84V	Royalblack	Performance	V	3524	3 mm
Rear Left	205/45Z R16	87W	Royalblack	Performance	V	4023	4 mm
Rear Right	205/45Z R16	87W	Royalblack	Performance	V	4023	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	09-ELECTRONIC CENTRAL ELECTRIC	01598:007	DRIVE BATTERY VOLTAGE-SIGNAL TOO LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025

Vehicle Information			
Make/Model	VW Polo	Year	2015
Engine/Trans	1.4 TSI 150kW	Color	Red
Registration	FB 863	Inspection Date	28/07/2025
Inspector	J. van der Merwe	Station	AAVZZZ6SZHU025429
Brake and Shock Absorber Report			
Wheel	Brake	Shock Absorber	Notes
Front Left	Good	Good	
Front Right	Good	Good	
Rear Left	Good	Good	
Rear Right	Good	Good	

Brake and shock absorber report

Vehicle: VW POLO 1.4 TSI 150kW	
Engine	1.4 TSI 150kW
Transmission	6-Speed Manual
Drive Type	Front-wheel drive
Color	Red
Registration	FB 863
Inspection Date	28/07/2025
Inspector	J. van der Merwe
Station	AAVZZZ6SZHU025429
Diagnostic Report Page 1	
Engine	1.4 TSI 150kW
Transmission	6-Speed Manual
Drive Type	Front-wheel drive
Color	Red
Registration	FB 863
Inspection Date	28/07/2025
Inspector	J. van der Merwe
Station	AAVZZZ6SZHU025429

Diagnostic report page 1

Vehicle: VW POLO 1.4 TSI 150kW	
Engine	1.4 TSI 150kW
Transmission	6-Speed Manual
Drive Type	Front-wheel drive
Color	Red
Registration	FB 863
Inspection Date	28/07/2025
Inspector	J. van der Merwe
Station	AAVZZZ6SZHU025429
Diagnostic Report Page 2	
Engine	1.4 TSI 150kW
Transmission	6-Speed Manual
Drive Type	Front-wheel drive
Color	Red
Registration	FB 863
Inspection Date	28/07/2025
Inspector	J. van der Merwe
Station	AAVZZZ6SZHU025429

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Engine oil sump



Brake booster reservoir

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Oil cap and dipstick



Front Bumper



Front Bumper



Bonnet



Seat Front Right



Seat Belt Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Front Fender Right



Side Mirror Right



Door Front Right



Door Rear Right



Rear Fender Right



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Rear bumper



Boot Lid / Hatch door



Roof



Windscreen Wiper



Rear Fender Left



Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Door Front Left



Seat Rear



Seat Front Left



Front Fender Left



Side Mirror Left



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT




Report No:
2016960716
DATE
28/07/2025



Clutch Pedal Rubber



Air Conditioner

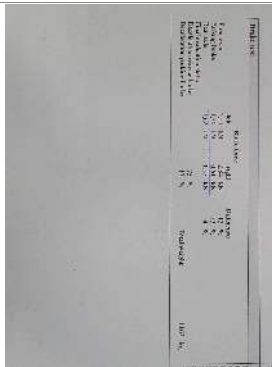

Parking Brake Performance



Headlight Right



Headlight Left



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Engine Wiring



Tyre Front Right



Rim Front Right



Control Arm Bush(es) Front Axle Right



Fog Light Front Right



Fog Light Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Rim Front Left



Control Arm Bush(es) Front Axle Left



Rocker Panel Left



Rim Rear Left



Rim Rear Right



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Sub Frame



Sub Frame



Chassis



Chassis



Cross Member Rear Right



Engine to silencer pipe

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429



CONDITION REPORT



Report No:
2016960716
DATE
28/07/2025



Belly plates



Silencer



Inner Boot Floor Pan and Spare Wheel Well



Fuel Tank



Belly plates



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429

**CONDITION REPORT**

Report No:
2016960716
DATE
28/07/2025



Parcel Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZHU025429