



CONDITION REPORT



Report No:
2017303151
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KWG997MP
Model	POLO 1.0 TSI COMFORTLINE 70KW 5-DR [2018-2019]	Register Number	
VIN	AAVZZAWZJU000830	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2018	Paint Finish	C - COMMON
Km Reading	154,112 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:

2017303151

DATE

25/09/2026

Damage

Repair Way

Switch Electrical Window Winder front left Defective	Repair
Switch Electrical Window Winder front right Defective	Repair
Windscreen Wiper Worn	Replace
Seat Front Right Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Chipmarks	Repair
Rear bumper Residual Traces of Repair	Repair
Sill Panel Left Dented	Repair
Roof Dented	Repair
Windscreen Chipped	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Cracked	Replace
Tyre Front Left Torn / Cut	Replace
Tyre Front Right Damaged	Replace
Rim Rear Right Deformed	Repair
Engine to silencer pipe Welded	Replace
Both front electric window switches not working	Repair
Warning lights illuminated	Repair
Body exterior	Signs of spray work done on body panels
Body exterior	Minor dents scratches stone chips on body panels
Aftermarket exhaust system fitted	Undercarriage
Body exterior	Residual traces of repair work on body panels
Front tyre size differs	Replace
Rear tyre size differs	Replace
Engine	Bottom of engine is fully covered
Undercarriage	Undercarriage cover

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.5	3.2	-	
Rear	2.0	1.7	-	
Emergency / Parking	1.7	1.9	-	

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:
2017303151
DATE
25/09/2026

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/40R17	84W	Roadx	RXmotion	V	4024	6 mm
Front Right	215/45R17	91W	Autogreen	Smart chaser	V	4727	3 mm
Rear Left	205/45R17	88V	Continental	Contact	V	5021	4 mm
Rear Right	215/45R17	91W	Kumho	Ecsta	V	2421	3 mm
Spare	185/65R15	88H	Goodyear	Efficient	V	////////	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE CONTROL 6	U101700	ABS CONTROL MODULE CHECK EVENT MEMORY	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU000830



CONDITION REPORT




Report No:
2017303151
DATE
25/09/2026



Tyre pressure warning lights i




Manual transmission

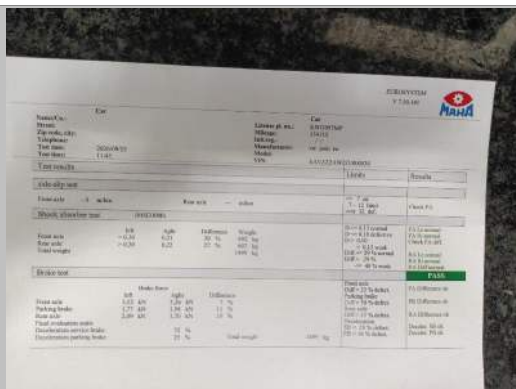


Shock and brake report



Diagnostics report

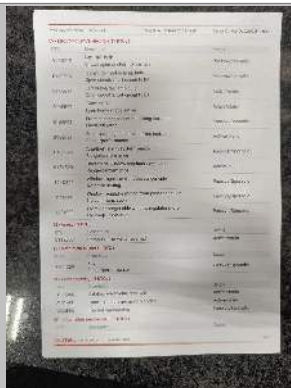

Diagnostics report

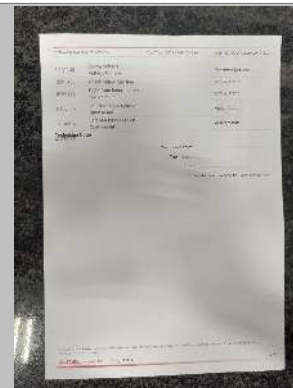

Diagnostics report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:
2017303151
DATE
25/09/2026



Sparewheel



Oil cap and dipstick



Expansion bottle



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:

2017303151

DATE

25/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZAWZJU000830




CONDITION REPORT



Report No:
2017303151
DATE
25/09/2026

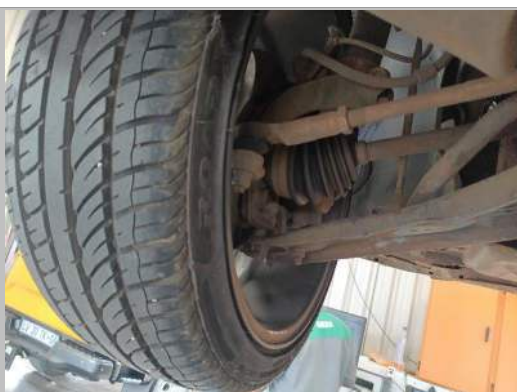


LF TYRE TREAD

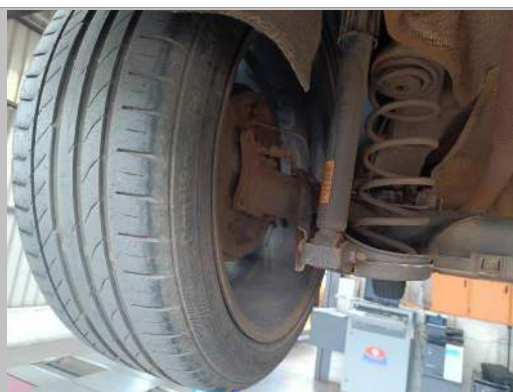

LR TYRE TREAD



RR TYRE TREAD

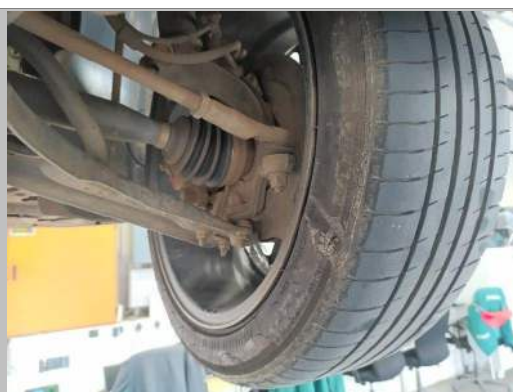

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:

2017303151

DATE

25/09/2026



REAR



ENGINE 1



CHASSIS



ENGINE 2



Seat Front Right



Switch Electrical Window Winder front left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:

2017303151

DATE

25/09/2026



Switch Electrical Window Winder front right



Switch Electrical Window Winder front left



Windscreen



Door Rear Right



Windscreen Wiper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:

2017303151

DATE

25/09/2026



Rear Fender Left



Front Fender Left



Tie Rod End right



Front Bumper



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:


2017303151

DATE

25/09/2026



Tie Rod End left

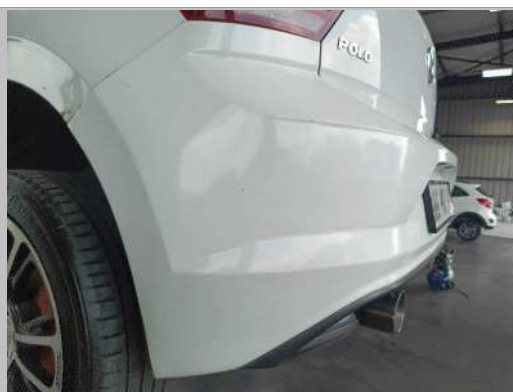

Rear bumper




Rear bumper



Rear bumper



Rear bumper

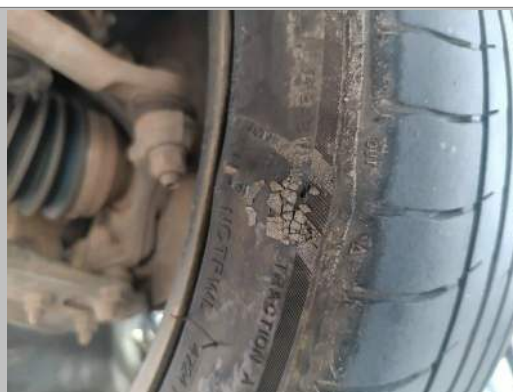

Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU000830



CONDITION REPORT



Report No:
2017303151
DATE
25/09/2026



Tyre Front Left



Engine to silencer pipe



Engine to silencer pipe



Rim Rear Right



Sill Panel Left



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZAWZJU000830




CONDITION REPORT



Report No:
2017303151
DATE
25/09/2026

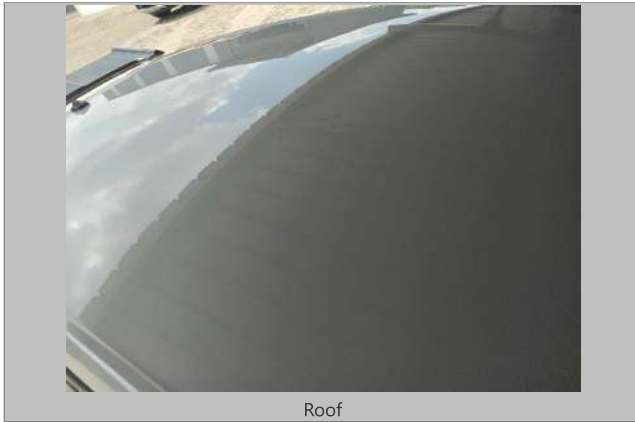

Roof

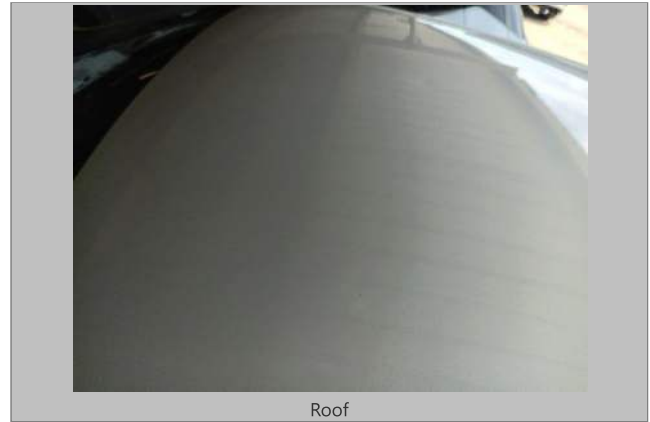

Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU000830