



CONDITION REPORT



Report No:
2017303555
DATE
25/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	25/09/2026		M57 Pretoria Road - 1619
Inspection Date	25/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	FVW163L
Model	POLO 1.0 TSI COMFORTLINE 70KW 5-DR [2018-2019]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZAWZJU049633	Last COR	
Engine Number		License Expiry Date	
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	TWO COAT UNI
Year Model	2018	Fuel	PETROL
Km Reading	81,367 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU049633



CONDITION REPORT



Report No:

2017303555

DATE

25/09/2026

Damage

Repair Way

Engine Management Lights Set
 Tail Light Left Damaged
 Headlight Left Damaged
 Headlight Right Damaged
 Seat Front Right Damaged
 Front Bumper Damaged
 Bonnet Damaged
 Front Fender Left Damaged
 Rear Fender Left Damaged
 Door Front Left Damaged
 Door Front Right Damaged
 Door Rear Left Damaged
 Door Rear Right Damaged
 Rear bumper Damaged
 Roof Damaged
 Windscreen Damaged

Repair
 Replace
 Replace
 Replace
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair
 Repair



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.14	2.97	-	
Rear	2.81	3.12	-	
Emergency / Parking	0.96	0.93	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Falken	Radial	V	1718	1 mm
Front Right	185/65R15	88H	Symmetry	Radial	V	2124	2 mm
Rear Left	175/65R15	84S	Toyo	Radial	V	1723	2 mm
Rear Right	185/65R15	88H	Falken	Radial	V	1618	2 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU049633



CONDITION REPORT



Report No:
2017303555
DATE
25/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels. Signs of hail damage to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
SUNGLASS HOLDER DAMAGED.

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU049633



CONDITION REPORT



Report No:

2017303555

DATE

25/09/2026



REAR LEFT CORNER



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU049633



CONDITION REPORT



Report No:

2017303555

DATE

25/09/2026



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual.



LF TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU049633




CONDITION REPORT



Report No:
2017303555
DATE
25/09/2026



RR TYRE TREAD

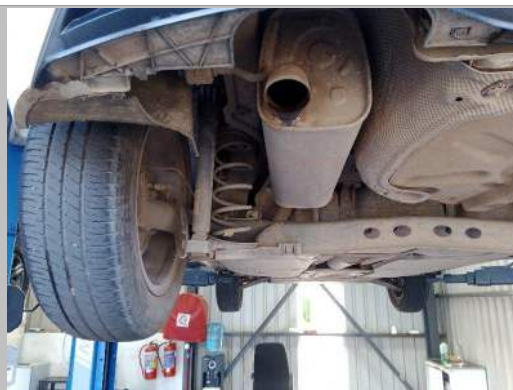

LR TYRE TREAD



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU049633



CONDITION REPORT




Report No:
2017303555
DATE
25/09/2026




VIN PLATE OR STICKER




LICENSE DISC

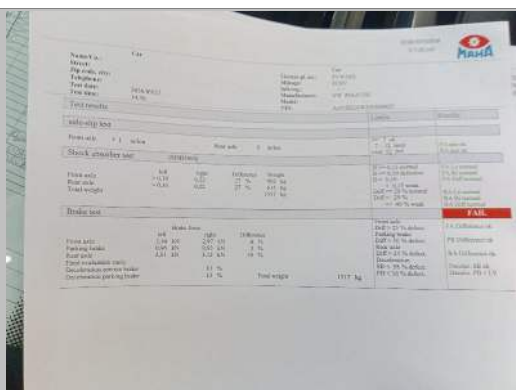


BRAKE TEST REPORT

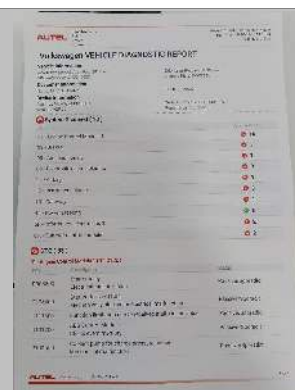

DIAGNOSTIC REPORT PAGE 1

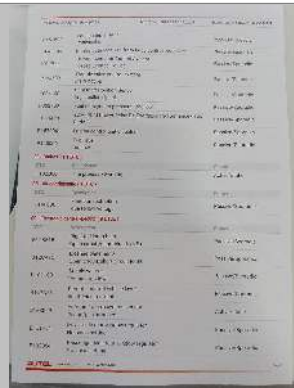

DIAGNOSTIC REPORT PAGE 2

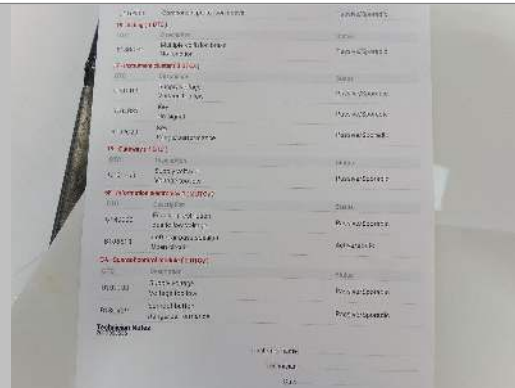

DIAGNOSTIC REPORT PAGE 3

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU049633



CONDITION REPORT



Report No:
2017303555
DATE
25/09/2026



Water level



Headlight Right



Headlight Left



Tail Light Left



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU049633



CONDITION REPORT



Report No:
2017303555
DATE
25/09/2026



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZJU049633



CONDITION REPORT



Report No:
2017303555
DATE
25/09/2026



Door Rear Right



Door Front Right



Rear Fender Left



Windscreen



Roof



Seat Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU049633



CONDITION REPORT



Report No:
2017303555
DATE
25/09/2026



Engine Management Lights

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU049633