



CONDITION REPORT



Report No:
2017302501
DATE
23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LN23VFGP
Model	POLO 1.0 TSI 70KW COMFORTLINE 5-DR [2019-2021]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZAWZKU109439	Last COR	
Engine Number		License Expiry Date	28/02/2027
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2020	Fuel	PETROL
Km Reading	82,046 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZAWZKU109439



CONDITION REPORT



Report No:
2017302501
DATE
23/09/2026

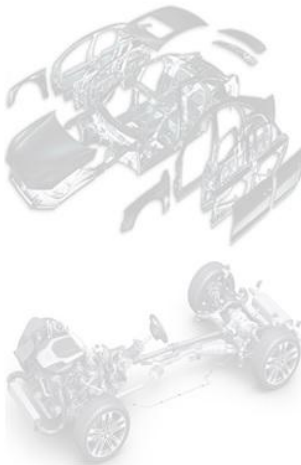

Damage	Repair Way
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	3.6	-	
Rear	1.7	1.8	-	
Emergency / Parking	1.1	0.9	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Goodyear	Efficient gr	V	2922	1 mm
Front Right	185/65R15	88H	Goodyear	Efficient gr	V	2922	1 mm
Rear Left	185/65R15	88H	Falken	Sincera	V	0619	2 mm
Rear Right	185/65R15	88H	Falken	Sincera	V	0619	2 mm
Spare	185/65R15	88H	Falken	Sincera	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU109439



CONDITION REPORT



Report No:
2017302501
DATE
23/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ACTIVE STATIC	B121E15	RIGHT DRL BULB CIRCUIT OPEN OR SHORT TO POSITIVE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU109439



CONDITION REPORT



Report No:
2017302501
DATE
23/09/2026

[illegible]

Shock and brake report

[illegible]

Diagnostic report

[illegible]

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU109439



CONDITION REPORT



Report No:

2017302501

DATE

23/09/2026



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZKU109439




CONDITION REPORT



Report No:
2017302501
DATE
23/09/2026



90 DEGREE LEFT

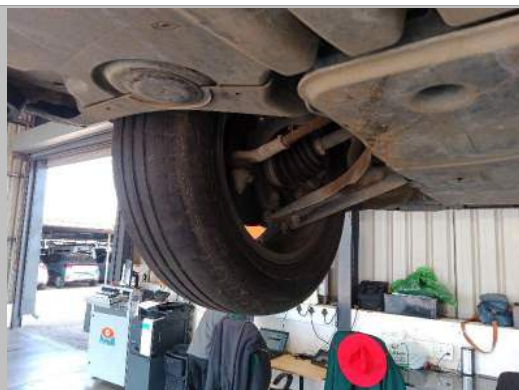


LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD

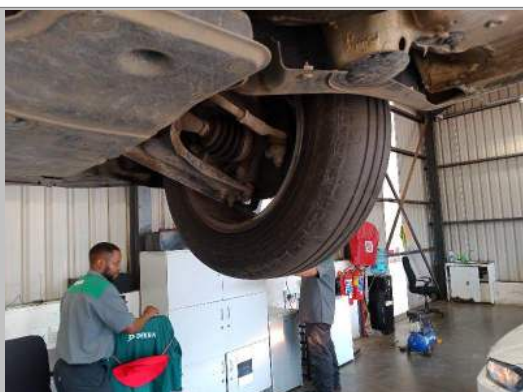

RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU109439



CONDITION REPORT



Report No:


2017302501

DATE

23/09/2026



LICENSE DISC

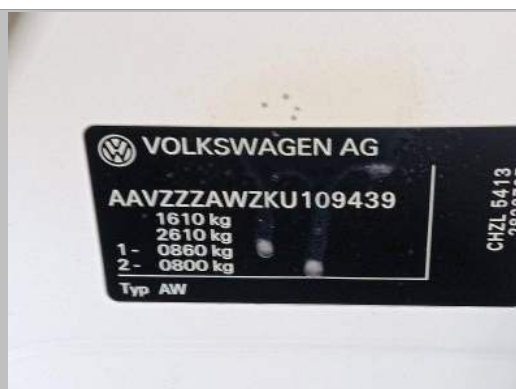

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU109439



CONDITION REPORT



Report No:
2017302501
DATE
23/09/2026



Expection bottle



Water level



Door Rear Right



Door Front Right



Side Mirror Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZKU109439



CONDITION REPORT



Report No:

2017302501

DATE


23/09/2026



Front Bumper



Bonnet

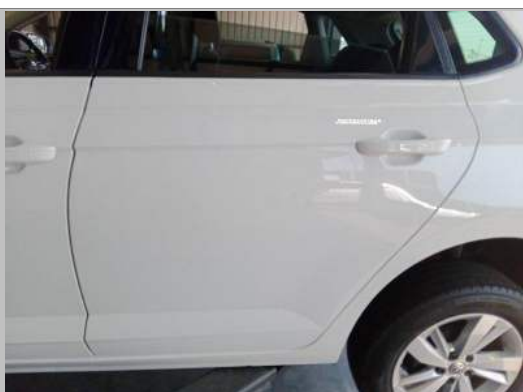

Door Rear Left



Rear bumper

DEKRA Automotive (PTY) Ltd.

97 Willem Cruywagen Ave

Klerksoord, Pretoria, 0200

Phone: 012 542 4867

www.dekraauto.co.za

VIN: AAVZZAWZKU109439