



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/01/2025		M57 Pretoria Road - 1619
Inspection Date	20/01/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KX79LZGP
Model	POLO 1.0 TSI 70KW TRENDLINE 5-DR [2019-2021]	Register Number	
VIN	AAVZZZAWZLU073351	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2025
Color	BLUE	Power / Displacement	
Year Model	2020	Paint Finish	M - METALLIC
Km Reading	115,707 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Spare Tyre Defective	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Antenna missing	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZLU073351

1 / 9



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.8	2.9	-	
Rear	1.4	2.2	-	
Emergency / Parking	1.1	1.4	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/70R14	88T	Goodyear	Efficient gr	V	5120	3 mm
Front Right	185/70R14	88T	Goodyear	Efficient gr	V	5120	3 mm
Rear Left	185/70R14	88T	Dunlop	Sp sport	V	0423	3 mm
Rear Right	185/70R14	88T	Goodyear	Efficient gr	V	0619	3 mm
Spare	185/70R14	88T	Goodyear	Duragrip	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE/SPORADIC	B13BCF2	MULTIPLE COLLISION BRAKE NO FUNCTION	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016726369

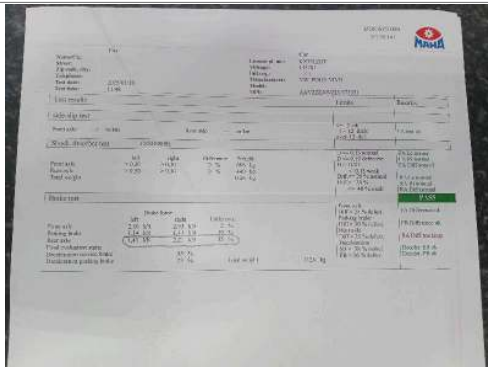DATE
20/01/2025

Brake and shock test



Diagnostic report

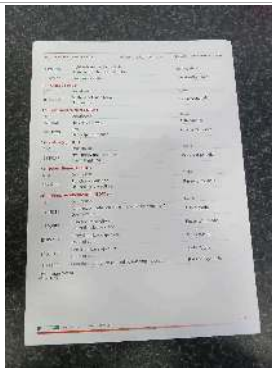

Diagnostic report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

N: AAVZZAWZLU073351
2 / 9

**CONDITION REPORT****Report No: 2016726369****DATE**
20/01/2025

VIN: AAVZZZAWZLU073351

3 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual

VIN: AAVZZAWZLU073351
4 / 9

90 DEGREE FRONT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

VIN: AAVZZZAWZLU073351

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016726369

DATE
20/01/2025

90 DEGREE REAR



90 DEGREE LEFT

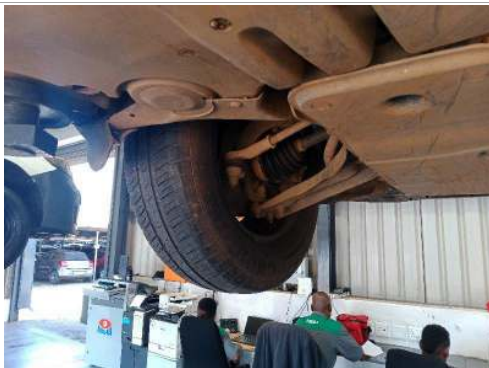

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

VIN: AAVZZZAWZLU073351

6 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZLU073351



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016726369****DATE**
20/01/2025

VIN: AAVZZZAWZLU073351

8 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

Expection bottle



Oil cap and dipstick

N: AAVZZAWZLU073351
9 / 9

Spare Tyre



Water level



Rear Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Bonnet



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016726369****DATE**
20/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016726369

DATE
20/01/2025

Rear Fender Left



Rear bumper



Rear bumper

side-slip test					
Front axle	- 5	in km	Rear axle	-	in km
Shock absorber test					
(0.843000g)					
Front axle	left	right	Difference	Weight	
Rear axle	>0,30	>0,30	0 %	600 kg	
Total weight	>0,30	>0,30	0 %	1440 kg	
Brake test					
Brake force					
Front axle	kN	right	Difference		
Parking brake	2,85 kN	2,93 kN	2 %		
Rear axle	1,13 kN	1,41 kN	10 %		
Final evaluation static	1,40 kN	2,21 kN	35 %		
Deceleration service brake		85 %			
Deceleration parking brake		25 %		Total weight	

Service Brake Performance Rear Axle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016726369****DATE**
20/01/2025

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za