



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/12/2023		M57 Pretoria Road - 1619
Inspection Date	22/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	NONE
Model	POLO GTI	Register Number	
VIN	AAVZZZAWZMU052716	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/05/2023
Color	RED	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	85,193 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Headlight Left Scratched	Repair
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Door Panel Rear Left Defective	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Dented	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rocker Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Spring Front Left Defective	Replace
Spring Front Right Defective	Replace
Spring Rear Left Defective	Replace
Spring Rear Right Defective	Replace
Shock Absorber Front Right Leak	Replace
Shock Absorber Rear Left Sweat	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZMU052716

1 / 15



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

Damage	Repair Way
Stabilizer Mounting Front Right Defective	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Right Worn	Replace
Chassis Scratched	Repair
Sub Frame Damaged	Repair
Silencer Defective	Repair
Belly plates Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Riding Height Front Incorrect	Repair
Riding Height Rear Incorrect	Repair
Warning lights illuminated on dashboard	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	3.2	-	
Rear	2.5	2.81	-	
Emergency / Parking	1.27	1.39	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	225/40Z R18	92Y	Fortune	Viento	V	0123	5 mm
Front Right	T125/60 R18	94M	Linglong	Temporary	V	0320	0 mm
Rear Left	225/40 R18	92Y	Bridgestone	Turanza	V	3619	3 mm
Rear Right	215/40 R18	89Y	Bridgestone	Turanza	V	3420	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	P085000	PARK/NEUTRAL SWITCH INPUT CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: SHOCK ABSORBER TEST REPORT COULD NOT BE PERFORMED.FRONT AND REAR NUMBER PLATES MISSING.
Engine Compartment: Engine bay dirty. Brake fluid level ok.
Interior: Vehicle interior dirty and some interior panels scratched.
Body • Exterior: Dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.
Signs of impact damage to front of vehicle. Signs of hail damage on some body panels.
Brakes: Rear left and right brake disk dust plates rusted. Change rear left and right brake pads soon.
Steering: Front sway bar misaligned.
Axle and Suspension: Abnormal noise coming from front and rear suspension.
Tyres and Rims: Spare wheel missing. Alloy rims scratched. Original spare wheel fitted to front right side of vehicle. Front and rear tyre sizes different.
Undercarriage: Vehicle undercarriage dirty. Bottom of engine and gearbox fully covered. Exhaust heat shields dented. Fuel tank scratched.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: MAVZZ1A/7M14090796

Report No: 2016210256

2 / 15

DATE

22/12/2023

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

VIN: AAVZZZAWMU052716

DATE
22/12/2023

VEHICLE INFORMATION		TEST INFORMATION	
Make/Model	Volvo V40	Test Date	22/12/2023
Year	2016	Test Time	10:00
Engine	2.0 T5	Tester	DEKRA
Transmission	Automatic	Location	DEKRA
Test Type	Brake Test	Test Result	PASS
Test Details	Brake Pedal Force: 1000N, Brake Pressure: 1200kPa, Deceleration: 0.8g	Test Notes	Brake system in good condition.

Brake test report

VEHICLE INFORMATION		TEST INFORMATION	
Make/Model	Volvo V40	Test Date	22/12/2023
Year	2016	Test Time	10:00
Engine	2.0 T5	Tester	DEKRA
Transmission	Automatic	Location	DEKRA
Test Type	Diagnostic	Test Result	PASS
Test Details	Engine, Transmission, Brakes, Steering, Suspension, Electrical	Test Notes	All systems in good condition.

Diagnostic report page 1

VEHICLE INFORMATION		TEST INFORMATION	
Make/Model	Volvo V40	Test Date	22/12/2023
Year	2016	Test Time	10:00
Engine	2.0 T5	Tester	DEKRA
Transmission	Automatic	Location	DEKRA
Test Type	Diagnostic	Test Result	PASS
Test Details	Engine, Transmission, Brakes, Steering, Suspension, Electrical	Test Notes	All systems in good condition.

Diagnostic report page 2

VEHICLE INFORMATION		TEST INFORMATION	
Make/Model	Volvo V40	Test Date	22/12/2023
Year	2016	Test Time	10:00
Engine	2.0 T5	Tester	DEKRA
Transmission	Automatic	Location	DEKRA
Test Type	Diagnostic	Test Result	PASS
Test Details	Engine, Transmission, Brakes, Steering, Suspension, Electrical	Test Notes	All systems in good condition.

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016210236

VIN: AAVZZZAW7211052023
DATE: 27/12/2023
4 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN: AAVZZZAWZMU052716

5 / 15



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN: AAVZZZAWZMU052716
6 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN: AAVZZZAWZMU052716

7 / 15



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN: AAVZZZAWZMU052716
8 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN PLATE OR STICKER



ENGINE 1

VIN: AAVZZAWZMU052716
9 / 15

Front chassis



Rear chassis



Automatic Transmission



Spare wheel Accessories



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN: AAVZZZAWZMU052716
10 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

Oil cap and dipstick



Headlight Right

052716
11 / 15

Water level



Engine Wiring



Seat Rear



Seat Rear



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN: AAVZZZAWZMU052716
12 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

Seat Front Left



Windscreen

052716
13 / 15

Front Bumper



Front Bumper



Bonnet



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

VIN: AAVZZZAWZMU052716
14 / 15

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

Seat Front Right



Boot Lid / Hatch door



Boot Lid / Hatch door



Shock Absorber Front Right



Spring Front Right



Front Fender Right



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

Door Front Right



Door Rear Right



Rear Fender Right



Rear Fender Left



Door Rear Left



Door Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023


Front Fender Left



Spring Front Left



Headlight Left

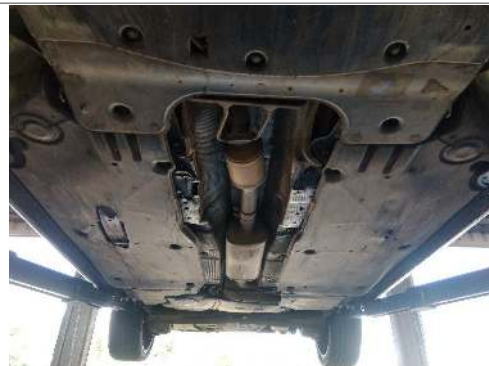

Belly plates



Belly plates



Tyre Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

CV Joint(s) Boot(s) Front Right (inner/outer)



Sub Frame



Front Fender Right / Inner Tray



Tyre Rear Right



Spring Rear Left



Spring Rear Right



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

Shock Absorber Rear Left



Silencer



Chassis



Stabilizer Mounting Front Right



Rocker Panel Right



Riding Height Front



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

Riding Height Rear



Engine



Door Panel Rear Left



CONDITION REPORT

Report No: 2016210236

DATE
22/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za