



CONDITION REPORT



Report No:
2017304622
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KX94ZYG
Model	POLO 1.0 TSI 70KW 5-DR [2022-2024]	Register Number	
VIN	AAVZZAWZPU030506	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2027
Color	GREY	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	103,202 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506



CONDITION REPORT



Report No:

2017304622

DATE


29/09/2026

Damage

Repair Way

Front Bumper Paintwork • Scratched
 Rear Fender Left Paintwork • Scratched
 Rear bumper Paintwork • Scratched

Repair
 Repair
 Repair

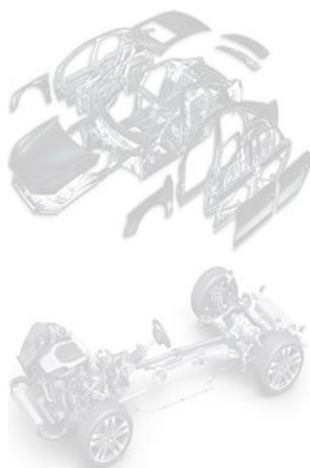

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	2.9	-	
Rear	1.7	2.8	-	
Emergency / Parking	0.9	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Centara	Vanti tourin	V	0226	5 mm
Front Right	185/65R15	88H	Centara	Vanti tourin	V	0226	6 mm
Rear Left	185/65R15	88H	Sailun	Atrezzo	V	0125	4 mm
Rear Right	185/65R15	88H	Sailun	Atrezzo	V	0125	5 mm
Spare	185/65R15	88H	Continental	Contact	V	0000	6 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506



CONDITION REPORT



Report No:
2017304622
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INSTRUMENT	U111000	FUNCTION RESTRICTION DUE TO COMMUNICATIONS	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZAWZPU030506



CONDITION REPORT



Report No:

2017304622

DATE

29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506



CONDITION REPORT



Report No:
2017304622
DATE
29/09/2026



INTERIOR (FRONT DRIVER DOOR)




Manual transmission



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER

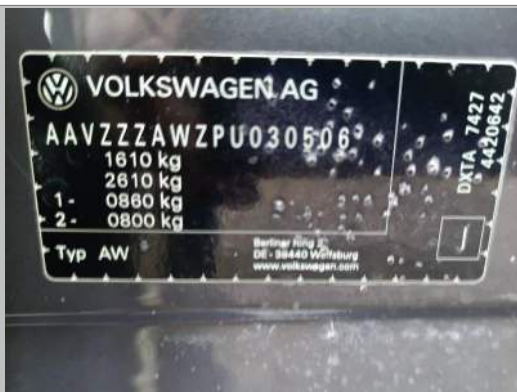

VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506



CONDITION REPORT



Report No:
2017304622
DATE
29/09/2026



ENGINE 1



ENGINE 2



CHASSIS



REAR



Expansion bottle



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506



CONDITION REPORT




Report No:

2017304622

DATE

29/09/2026

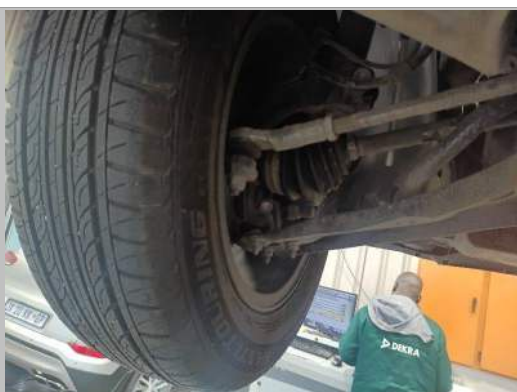

LF TYRE TREAD



RF TYRE TREAD




LR TYRE TREAD



RR TYRE TREAD



Sparewheel

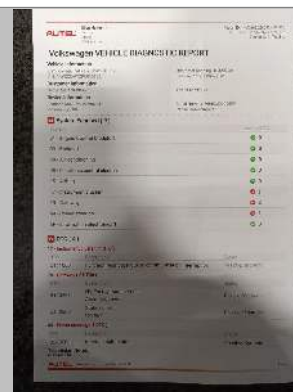

Diagnostic Report page 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506



CONDITION REPORT




Report No:


2017304622

DATE

29/09/2026

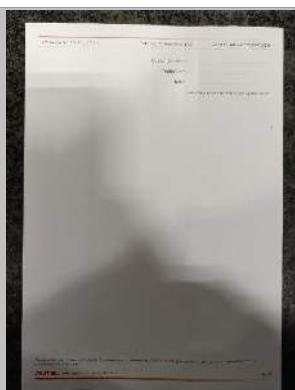

Diagnostic Report page 2

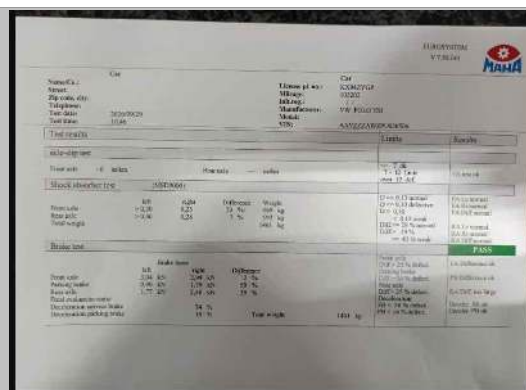


Shock and brake report



Water level



Rear Fender Left

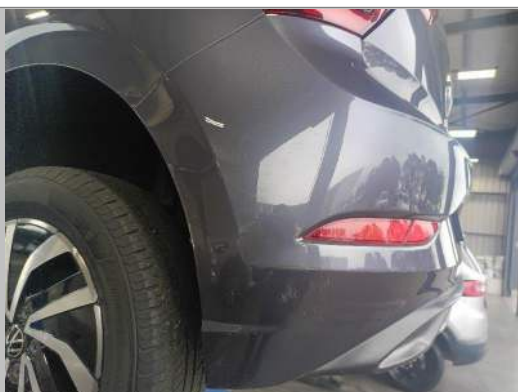

Rear bumper



Rear bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506



CONDITION REPORT



Report No:
2017304622
DATE
29/09/2026



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZPU030506