



CONDITION REPORT



Report No:

2017302469

DATE

23/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/09/2026		M57 Pretoria Road - 1619
Inspection Date	23/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	FYL431L
Model	D-MAX 250C BASE DSL PU GEN 6 [2020-ON]	Register Number	
VIN	ACVBRRAR1L4106322	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	30/04/2027
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	TWO COAT UNI
Km Reading	125,018 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: ACVBRRAR1L4106322



CONDITION REPORT



Report No:
2017302469
DATE
23/09/2026

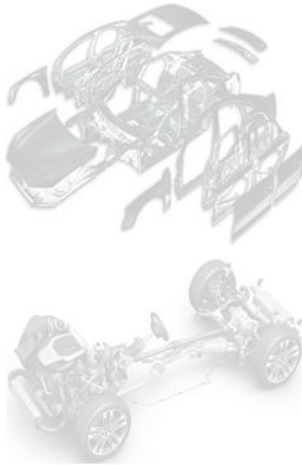

Damage	Repair Way
Engine Oil Sweat	Repair
Tail Light Right Damaged	Replace
Seat Front Left Damaged	Repair
Front Bumper Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Tailgate Damaged	Repair
Windscreen Damaged	Repair
Spare Tyre Worn	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.04	3.17	-	
Rear	3.18	2.96	-	
Emergency / Parking	2.04	1.57	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/70R16	100T	General	Radial	V	3525	3 mm
Front Right	215/70R16	100T	General	Radial	V	3525	4 mm
Rear Left	215/70R16	100T	General	Radial	V	3525	3 mm
Rear Right	215/70R16	106T	Goodyear	Marathon	V	1425	2 mm
Spare	215/70R16	106T	Goodyear	Marathon	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322

**CONDITION REPORT**

Report No:
2017302469
DATE
23/09/2026

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents and scratches and stone chips to body panels. Signs of repair work done to body panels. Poor alignment to somebody panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322



CONDITION REPORT




Report No:


2017302469

DATE

23/09/2026

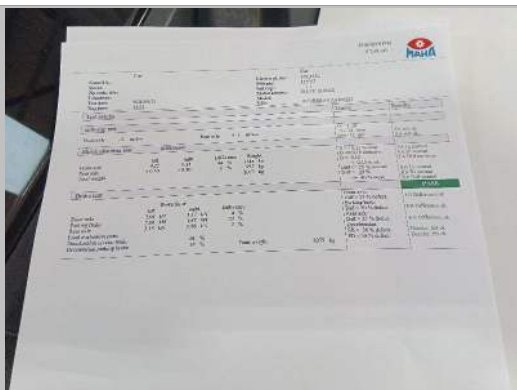

Brake test.

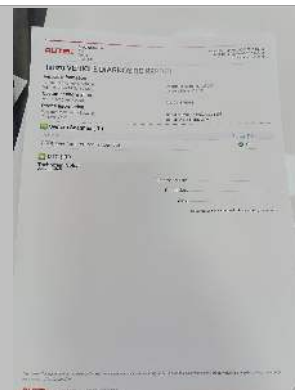

Diagnostic.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322



CONDITION REPORT



Report No:

2017302469

DATE

23/09/2026



ODOMETER



Manual.



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322



CONDITION REPORT




Report No:


2017302469

DATE


23/09/2026

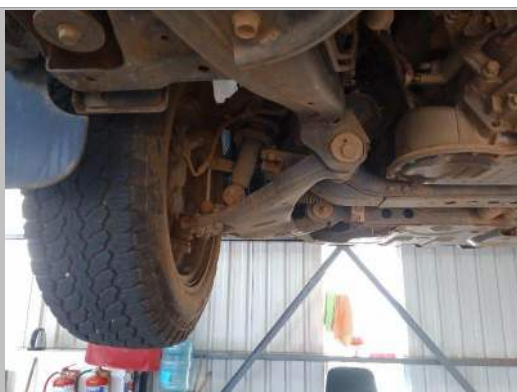

LF TYRE TREAD

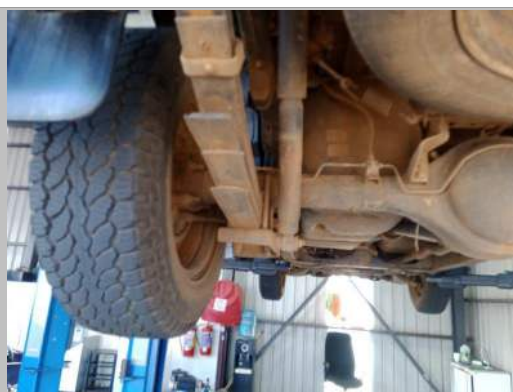

LR TYRE TREAD

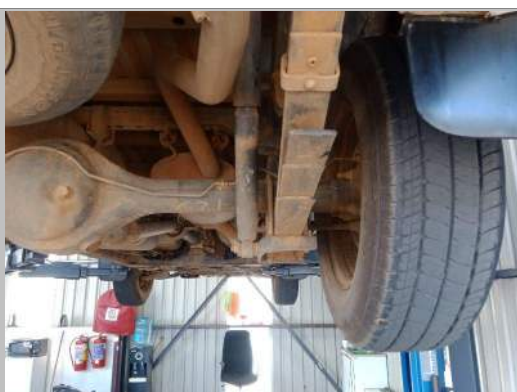

RR TYRE TREAD



RF TYRE TREAD



LICENCE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322



CONDITION REPORT



Report No:
2017302469
DATE
23/09/2026



ENGINE 1



Undercarriage front.



Undercarriage rear.



Oil cap and dipstick.



Water level



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322



CONDITION REPORT



Report No:

2017302469

DATE

23/09/2026



Front Bumper



Door Front Left



Rear Fender Left



Tailgate



Rear Fender Right



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322



CONDITION REPORT



Report No:
2017302469
DATE
23/09/2026



Tail Light Right



Seat Front Left



Spare Tyre



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVBRRAR1L4106322