



CONDITION REPORT



Report No:
2017304542
DATE
29/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/09/2026		M57 Pretoria Road - 1619
Inspection Date	29/09/2026		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	KD08KCGP
Model	D-MAX 250 HI-RIDE DSL D-CAB PU AT GEN 6 [2020-2024]	Register Number	
		Date Of First Licensing	
VIN	ACVRRCHR4K4071632	Last COR	
Engine Number		License Expiry Date	31/07/2026
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2021	Fuel	DIESEL
Km Reading	266,995 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:

2017304542

DATE

29/09/2026



Damage

Repair Way

Engine Oil Leak	Repair
Tail Light Left Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Chipmarks	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Tailgate Dented	Repair
Rear bumper Damaged	Replace
Windscreen Chipped	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.5	3.7	-	
Rear	1.6	1.5	-	
Emergency / Parking	1.6	2	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	111/109T	Goodyear	Wrangler	V	3222	3 mm
Front Right	245/70R16	107S	Bridgestone	Dueler	V	1023	3 mm
Rear Left	245/75R16	111S	Jk tyre	Elanzo	V	3423	3 mm
Rear Right	245/75R16	111S	Jk tyre	Elanzo	V	3423	3 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:
2017304542
DATE
29/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	NOT PRESENT	C0800_07	HIGH VOLTAGE	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. BODY EXTERIOR - SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:
2017304542
DATE
29/09/2026



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:
2017304542
DATE
29/09/2026



INTERIOR (FRONT DRIVER DOOR)



Automatic



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



VIN PLATE OR STICKER



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:
2017304542
DATE
29/09/2026



ENGINE 1



ENGINE 2




CHASSIS



Oil cap and dipstick



Coolant bottle

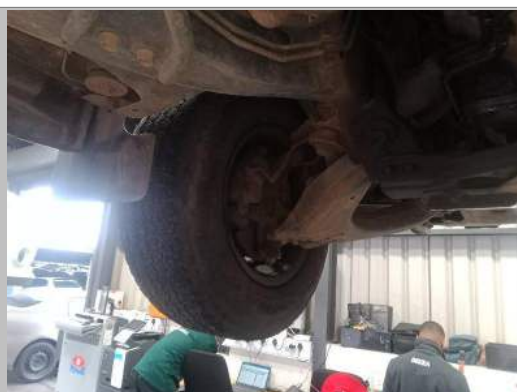

LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:


Report No.
2017304542

DATE

29/09/2026



RF TYRE TREAD

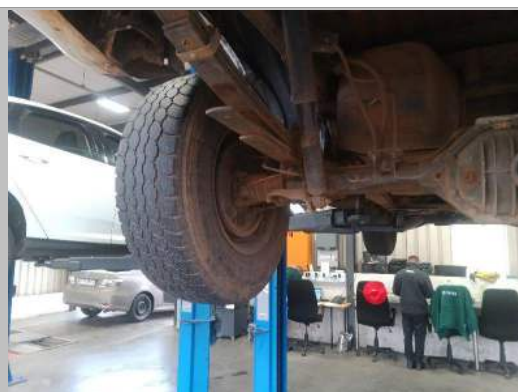

LR TYRE TREAD



RR TYRE TREAD



No spare wheel

[illegible]

Shock and brake report

[illegible]

Diagnostic report

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:
2017304542
DATE
29/09/2026



Seat Front Left



Seat Front Right



Water level



Tail Light Left



Rear bumper



Tailgate

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:

2017304542

DATE

29/09/2026



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Bonnet



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:

2017304542

DATE

29/09/2026



Front Fender Left



Side Mirror Left



Door Front Left



Door Rear Left



Rear Fender Left



Windscreen

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632



CONDITION REPORT



Report No:
2017304542
DATE
29/09/2026



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVRRCHR4K4071632