



CONDITION REPORT



Report No:
2017296433
DATE
09/09/2026

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/09/2026		M57 Pretoria Road - 1619
Inspection Date	09/09/2026		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	KVB205MP
Model	D-MAX 3.0 DDI 4X4 LSE DSL D-CAB PU AT [2022-2023]	Register Number	
		Date Of First Licensing	
VIN	ACVTFS40JMD114468	Last COR	
Engine Number		License Expiry Date	
Doors	4	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2023	Fuel	DIESEL
Km Reading	12,866 KM	Transmission	AUTOMATIC
Cab / Body Type	DOUBLE CAB		

Vehicle Options & Accessories

Items


VEHICLE INSPECTION



CONDITION REPORT



Report No:
2017296433
DATE
09/09/2026

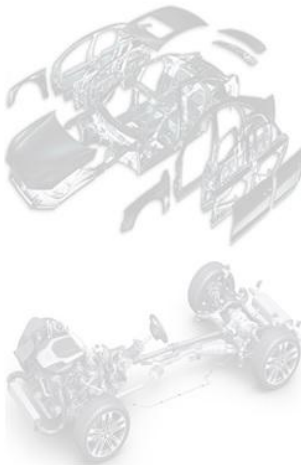

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Door Rear Left Cracked	Repair
Door Rear Right Paintwork • Scratched	Repair
Warning lights illuminated	Repair
Body exterior	Minor dents scratches stone chips on body panels
Body exterior	Signs of spray work done on body panels
Engine	Bottom of engine is fully covered

Brakes

Brake Test Results

No Brake Test on a brake test machine has been performed.

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	
Rear	-	-	-	
Emergency / Parking	-	-	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	255/65R17	110H	Dunlop	Grandtrek	V	0523	1 mm
Front Right	255/65R17	110H	Dunlop	Grandtrek	V	0523	1 mm
Rear Left	255/65R17	110H	Dunlop	Grandtrek	V	0523	3 mm
Rear Right	255/65R17	110H	Dunlop	Grandtrek	V	0523	2 mm
Spare	255/70R16	111T	Continental	Contact	V	0000	10 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFS40JMD114468



CONDITION REPORT



Report No:
2017296433
DATE
09/09/2026

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C0020_01	PUMP MOTOR ELECTRICAL FAULT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE: NORMAL WEAR AND TEAR MARKS ON THE BODY, INTERIOR, AND MECHANICAL.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFS40JMD114468



CONDITION REPORT




Report No:

2017296433

DATE

09/09/2026

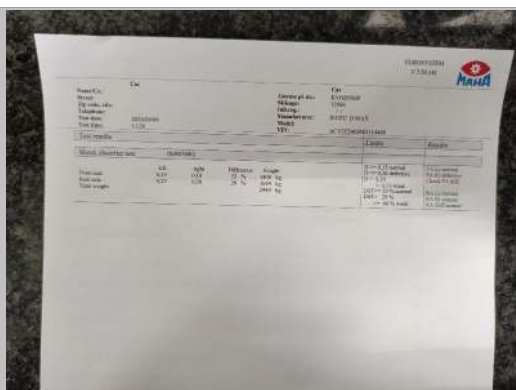

Shock test



Diagnostics report



Diagnostics report



Sparewheel



Coolant reservoir



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTF540JMD114468



CONDITION REPORT



Report No:
2017296433
DATE
09/09/2026



Automatic transmission



Warning lights illuminated



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFS40JMD114468



CONDITION REPORT



Report No:
2017296433
DATE
09/09/2026



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFS40JMD114468



CONDITION REPORT




Report No:

2017296433

DATE


09/09/2026

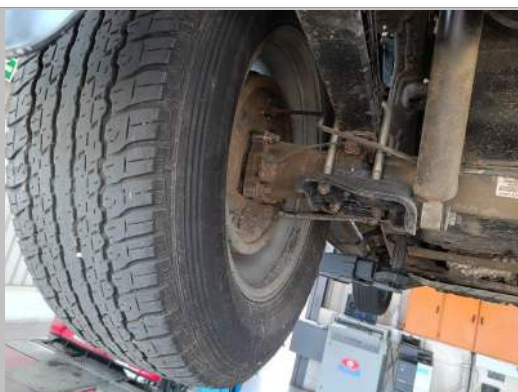

LR TYRE TREAD



RR TYRE TREAD

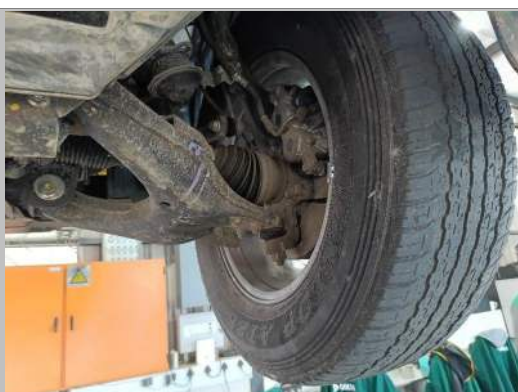

RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTF540JMD114468



CONDITION REPORT



Report No:
2017296433
DATE
09/09/2026



ENGINE 2



CHASSIS



Door Rear Left



Door Rear Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVTFS40JMD114468