



CONDITION REPORT

Report No: 2016183465

DATE  
29/11/2023

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/11/2023		M57 Pretoria Road - 1619
Inspection Date	29/11/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	FBR024L
Model	NP300 HARD BODY	Register Number	
VIN	ADNCPGD22ZR115185	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/12/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	210,096 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Tail Light Right Broken	Replace
Headlight Left Broken	Replace
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Replace
Door Handle Rear Left Damaged	Replace
Carpet Front Torn / Cut	Repair
Front Lower Valance Corrosion	Replace
Front Bumper Paintwork • Scratched	Repair
C • Pillar Left Damaged	Repair
Door Rear Right Dented	Repair
Tailgate Hinge Left Defective	Repair
Fuel Flap Defective	Repair
Windscreen Cracked	Replace
Brake disc 1. Axle right Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Ball Joint(s) Front Axle Left Cracked	Replace
Spring Shackle Bush Rear Axle Left Damaged	Replace
Spring Shackle Bush Rear Axle Right Damaged	Replace
Tyre Rear Left Smooth	Replace

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: ADNCPGD22ZR115185

1 / 12



## CONDITION REPORT

Report No: 2016183465

DATE  
29/11/2023

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	4.4	4.6	-	
Rear	2.0	2.9	-	
Emergency / Parking	2.5	2.9	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	107S	Falken	Wildpeak	V	3919	0 mm
Front Right	255/70R16	111T	Continental	Contact	V	3522	1 mm
Rear Left	255/70R16	111T	Habilead	Practice	V	2018	0 mm
Rear Right	245/70R16	111/109T	Goodyear	Wrangler	V	1618	0 mm
Spare	245/70R16	107S	Firestone	Destination	V	///////	1 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels. L/R door not working.

### Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician


Trevino Julius

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

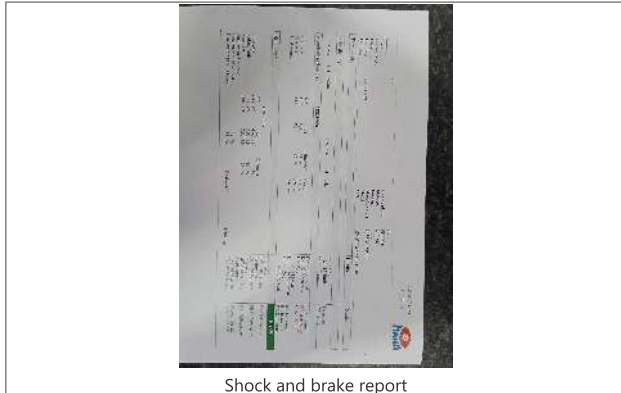

Shock and brake report

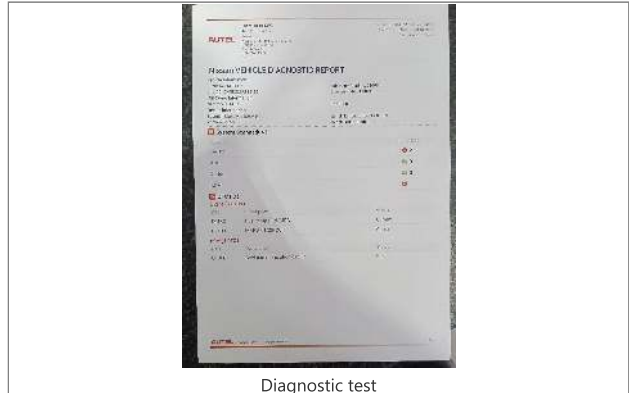

Diagnostic test

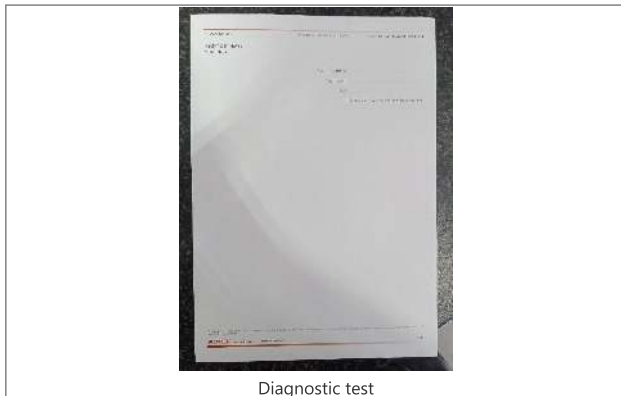

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

DATE  
29/11/2023



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: ADNCPGD22ZR115185

4 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016183465

DATE  
29/11/2023



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC

VIN: ADNCPGD22ZR115185

5 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear chassis



Coolant reservoir

VIN: ADNCPGD22ZR115185

6 / 12



Manual



Oil cap and dipstick



Door Handle Rear Left



Door Handle Rear Left



Tailgate Hinge Left



Tailgate Hinge Left

VIN: ADNCPGD22ZR115185

7 / 12



Tail Light Right



Fuel Flap



Seat Front Right



Carpet Front



Seat Front Left



Water level

VIN: ADNCPGD22ZR115185

8 / 12





CONDITION REPORT

Report No: 2016183465

DATE  
29/11/2023



Water level



Brake fluid level



Headlight Left



Stabilizer Mounting Front Right



Front Bumper



Front Bumper


VIN: ADNCPGD22ZR115185

9 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



Ball Joint(s) Front Axle Left

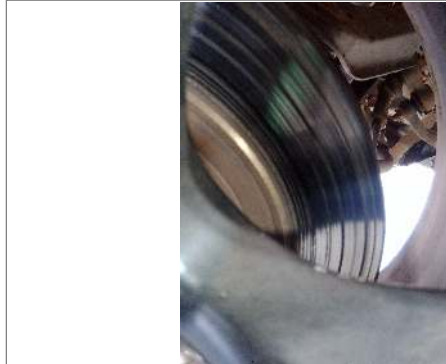

Brake disc 1. Axle right



Front Lower Valance



Tyre Rear Left



Spring Shackle Bush Rear Axle Left



Spring Shackle Bush Rear Axle Right

VIN: ADNCPGD22ZR115185

10 / 12



CONDITION REPORT

Report No: 2016183465

DATE  
29/11/2023



Door Rear Right



C • Pillar Left



Windscreen

VIN: ADNCPGD22ZR115185

11 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: ADNCPGD22ZR115185

12 / 12